



IXRF Systems, Inc. 3019 Alvin DeVane Blvd. Suite 130, Austin, TX 78741 • 512-386-6100 • Fax 512-386-6105

Web: www.IXRFsystems.com

E-mail: info@IXRFsystems.com

Iridium Ultra Version 1.4 Software User's Guide

7 February 2012

Japan only:

The power cable packed in the carton is used exclusively for the included EDS system.

This page intentionally blank

Table of Contents

1. Introduction	7
2. Customer Support	8
2.1 Contacting Us.....	8
2.2 Software Updates	8
3. Application Overview.....	9
3.1 TitleBar	10
3.2 ToolBar	11
3.3 Menus.....	13
3.4 File Menu	13
3.4.1 New	13
3.4.2 Open.	13
3.4.3 Save EDS Data Set	14
3.4.4 Set Sample Name.....	14
3.4.5 Image Browse	15
3.4.6 Image Batch Export	15
3.4.7 Setup Export Formats	16
3.4.8 Close	16
3.4.9 Close All.....	16
3.4.10 Save.....	17
3.4.11 Save As	17
3.4.12 Export.....	17
3.4.13 Print.....	17
3.4.14 Print Preview	17
3.4.15 Print Setup.....	17
3.4.16 Exit	17
3.4.17 Create Word Report	18
3.5 View Menu.....	19
3.5.1 Interactive Help	19
3.5.2 Folders Panel	20
3.5.3 Application Look.....	21
3.6 Tools Menu	21
3.6.1 System Setup User Interface.....	21
3.6.2 System Setup Security	22
3.6.3 System Setup Options.....	22
3.7 Window Menu	23
3.7.1 Cascade.....	23
3.7.2 Tile.....	23
3.7.3 Arrange Icons	23
3.8 Help Menu	23
3.8.1 Help Topics	23
3.8.2 About... ..	23
3.8.3 View Release Notes... ..	23
3.9 Data Protection.....	24
4. Working With Spectra	25
4.1 Acquiring Spectra	26
4.1.1 Returning to Acquisition Location	26
4.2 Viewing Tools.....	26
4.2.1 Expanding and Contracting views	26
4.2.2 Auto Vertical Scale.....	27
4.2.3 Manual Setting of Displayed Energy.....	27
4.2.4 Bipolar Display.....	27
4.3 Overlaying Spectra.....	28
4.4 Annotations and Notes	29
4.5 Customizing Display and Printing Colors.....	31
4.6 Painting Windows.....	32

4.7	Identifying Peaks	32
4.7.1	Element ID Buttons	32
4.7.2	Periodic Table.....	33
4.7.3	Scrolling Peak Identifier.....	33
4.7.4	Cursor Identification.....	34
4.7.5	Customizing Display of MLK markers	34
4.7.6	Automatic Element Identification.....	35
4.7.7	Configuring Automatic Identification	35
4.8	Customizing Spectrum Rendering for Printing, Exporting, and Clipboard.....	36
4.9	Exporting Files.....	37
4.9.1	File/Export/Spectrum.....	38
4.9.2	File/Export/Analysis	38
4.9.3	File/Export/Multi-Spectrum Export.....	38
4.9.4	File/Export/Export to Word.....	38
4.10	Quantitative Analysis of Spectra.....	39
4.10.1	Analysis Settings.....	40
4.10.2	Using Stoichiometry (Oxides, etc)	42
4.10.3	Minimum Intensity Criteria.....	44
4.10.4	Sample Coating and Thickness.	44
4.10.5	Customizing Report Output.....	45
4.10.6	Using the Manual Processing Tool	46
4.10.7	Background Modeling.....	47
4.10.8	Background File	49
4.10.9	Selection of Element Analysis Lines.....	49
4.10.10	Gaussian Deconvolution	52
4.11	Detector Geometry	54
4.11.1	On-Axis Detector Setup	55
4.11.2	Off-Axis Detector Geometry	56
4.12	Detector Setup.....	57
4.12.1	Window Parameters	57
4.12.2	Detector Parameters	58
4.13	ZAF Quantitative Analysis using Standards	59
4.13.1	Standardless vs. Standards	59
4.13.2	Calibrations	60
4.13.3	Creating a ZAF Calibration File.....	60
4.13.4	Performing ZAF Quantitation with Standards.....	64
4.13.5	ZAF Warnings and Errors	65
4.14	Match Analysis	66
4.14.1	Qualitative Match Analysis.....	67
4.14.2	Quantitative Match Analysis.....	69
4.14.3	Viewing Match Results	70
4.15	Least-Squares quantitation method.....	71
4.15.1	Creating the calibration file.....	71
4.15.2	Quantifying with Least Squares	77
4.16	Material Classification	80
4.16.1	Enable Materials Classification.....	81
4.16.2	Select or Create a Database.....	82
4.16.3	Select or Create a Materials Class.....	82
4.16.4	Edit Materials in Materials Class	82
4.16.5	Test the Materials Class with Samples.....	83
4.16.6	Setting Minimum Counts in Spectrum.....	84
4.17	Spectrum Simulation.....	84
5.	Working with Automatic Multiple Spectrum Acquisition.....	85
5.1	Selecting Locations.....	85
5.2	Adding Labeled Locations	85
5.3	Selecting Analysis Settings.....	86

5.4	Selecting Location for File Storage.....	86
5.5	Selecting Report Output Options	86
5.6	Starting the Analysis	86
5.7	Saving and Loading Location Files.....	86
6.	Working with Spectrum Reports	87
7.	Working with Combined SEM/XRF spectra	89
7.1	Acquiring Spectra	90
7.2	Identifying Peaks	90
7.3	Quantifying Spectra	90
8.	Working With VP Spectra.....	92
8.1	Enabling VP Quantitation	92
8.2	Acquiring VP Spectra	92
8.3	Quantifying VP Spectra	93
9.	Working With X-ray Maps.....	94
9.1	Acquiring An X-ray Map.....	94
9.1.1	Preparing the microscope and EDS system for acquisition	94
9.1.2	Creating and Acquiring the X-ray map.....	94
9.2	Setting Acquisition Properties.....	95
9.2.1	Returning to Acquisition Location	96
9.3	Setting Element Properties.....	96
	Adjusting Color Palettes for X-ray Maps	98
9.3.2	Setup Palette Files	100
9.4	Spectral Imaging	101
9.5	View Histogram.....	102
9.6	The Sum Spectrum and Maximum Pixel	103
9.6.1	Element Selection	104
9.7	Exporting X-ray Maps	104
9.8	Viewing Intensity/Composition of Points on X-ray Maps	105
9.8.1	Modes	106
9.8.2	Locations Menu	107
9.9	Overlaying X-ray Maps (Composites)	108
9.10	Element Quantitative X-ray Maps	109
9.11	Component Quantitative X-ray Maps	110
9.12	Viewing Quantitative Maps	110
9.13	Quantifying X-ray Maps (Composition)	111
9.14	Scatter Plot Analysis	113
9.15	Extracting Linescans from Maps	114
9.16	Annotating Maps.....	114
9.17	3D Viewer.....	115
9.17.1	3D Control Panel.....	117
9.17.2	Color Control Panel.....	118
9.17.3	Zoom Control Panel	119
9.17.4	3D Menu.....	119
9.18	X-ray Map Drift Correction	119
9.18.1	Enabling Drift Correction.....	121
9.18.2	Acquiring Maps with Drift Correction.....	121
10.	Working with X-ray Linescans	123
10.1	Acquiring X-ray Linescan.....	123
10.1.1	Preparing the microscope and EDS system for acquisition.....	123
10.1.2	Creating and Acquiring the X-ray linescan	124
10.2	Setting Acquisition Properties.....	124
10.2.1	Returning to Acquisition Location	125
10.3	Setting Element Properties.....	125
10.4	Viewing Intensities and Concentrations.....	126
10.5	Overlay Linescans.....	128
10.5.1	Intensities or Concentrations	129

10.5.2	Overlay On Image	129
10.5.3	Export, Print, and Clipboard.....	129
10.6	Printing Linescans.....	129
10.6.1	Single Page Output Style.....	129
10.6.2	Multi-Page Output.....	129
11.	RoboStage	130
12.	Stitched Images and Stitched Maps.....	132
12.1	Acquisition.....	132
12.2	Editing.....	134
12.3	Saving and Exporting.....	135
13.	WDX Support	136
14.	Energy Calibration.....	137
14.1	Offset DAC Calibration (Model 500 only)	137
14.2	Manual Energy Calibration and Threshold Adjustments	138
14.3	Automatic Energy Calibration	140
14.4	Low Energy Calibration.....	141
14.5	View Input	143
14.6	Calculating Detector FWHM	143

1. Introduction

Welcome to the EDS system from IXRF Systems, Inc. This combination of hardware and software is a powerful, yet easy-to-use system encompassing all aspects of x-ray microanalysis and optionally, XRF (X-Ray Fluorescence). Because of the technology used, Energy-Dispersive Spectrometry, this technique is often referred to as EDS analysis. The purpose of this software is to acquire and analyze x-ray spectra, x-ray maps and linescans, and electron images, to perform a complete analytical analysis of a sample located in a Scanning Electron Microscope (SEM) or Transmission Electron Microscope (TEM). Operating on all of the current Microsoft operating systems (Windows 2000, Windows XP, Vista, and Windows 7), the EDS software seamlessly integrates with many other powerful applications to provide custom report generation and connectivity with other networked systems.

The purpose of this manual is to describe the common activities that the EDS software is designed to perform. As such, the primary chapters are titled “Working with ...”. It is assumed that you are familiar with the basics of operating a Windows application and that you are familiar with the common terms and techniques of EDS analysis. If you are not familiar with Windows applications it is recommended that you review the “Getting Started” book which is provided with your computer system, and is also available from the Help menu item on your computer desktop. To gain familiarity with EDS analysis, the following books are recommended:

- “Scanning Electron Microscopy and X-Ray Microanalysis,” 2nd Edition, by J. I. Goldstein, D. E. Newbury, P. Echlin, D. C. Joy, A. D. Romig, Jr., C. E. Lyman, C. Fiori and E. Lifshin, Plenum Press, New York (1992).
- “Quantitative Electron-Probe Microanalysis,” 2nd Edition, by V. D. Scott, G. Love and S. J. B. Reed, Ellis Horwood Ltd., Hemel Hempstead, UK (1995).
- “Quantitative X-Ray Spectrometry,” 2nd Edition, by R. Jenkins, R. W. Gould and D. Gedcke, Marcel Dekker, Inc., New York (1995).

2. Customer Support

We are committed to supporting our customers. Support can be accessed via telephone, fax, or 24-hours a day via the internet.

2.1 Contacting Us

We can be contacted by:

Telephone: +1- 512-386-6100 from 9:00AM to 5:00PM Central Standard (or Daylight) Time.

FAX: +1-512-386-6105

Email: support@IXRFsystems.com

Internet: www.IXRFsystems.com

2.2 Software Updates

We provide free, lifetime updates to the original purchaser of the EDS application software via our web site. This is a complete installation package for the software. To access the latest release of the software, do the following:


- With your internet browser, go to the web site, <http://www.IXRFsystems.com>.
- Click on the Support button at the top of the home page.
- Click on the **Downloads** button on the left side of the Support .
- Please read carefully the instructions or Release Notes on the **Software Downloads** page. The instructions on this page may change as new releases are provided. For example, a new driver for the MCA card may be required, and this may require additional steps to be taken to complete the installation of the latest software.
- A password is required for most of our software and user manuals installations. To obtain the password, contact us by telephone as described in **Contacting Us**.

The software update installation is typically a two-step procedure:

1. Download the software. If you have replaced your computer, you will need to download and install the Support Files.EXE. These files **MUST** be installed prior to the EDS application.
2. Run the installation software. Typically, this installs the software automatically, overwriting the previous version.

Some Internet connections have firewall protection, which may prevent downloading of software from the Internet. If you have difficulty downloading the software from our web site, please contact your network manager to acquire the access rights necessary to download. Administrator rights may also be required on the computer.

3. Application Overview

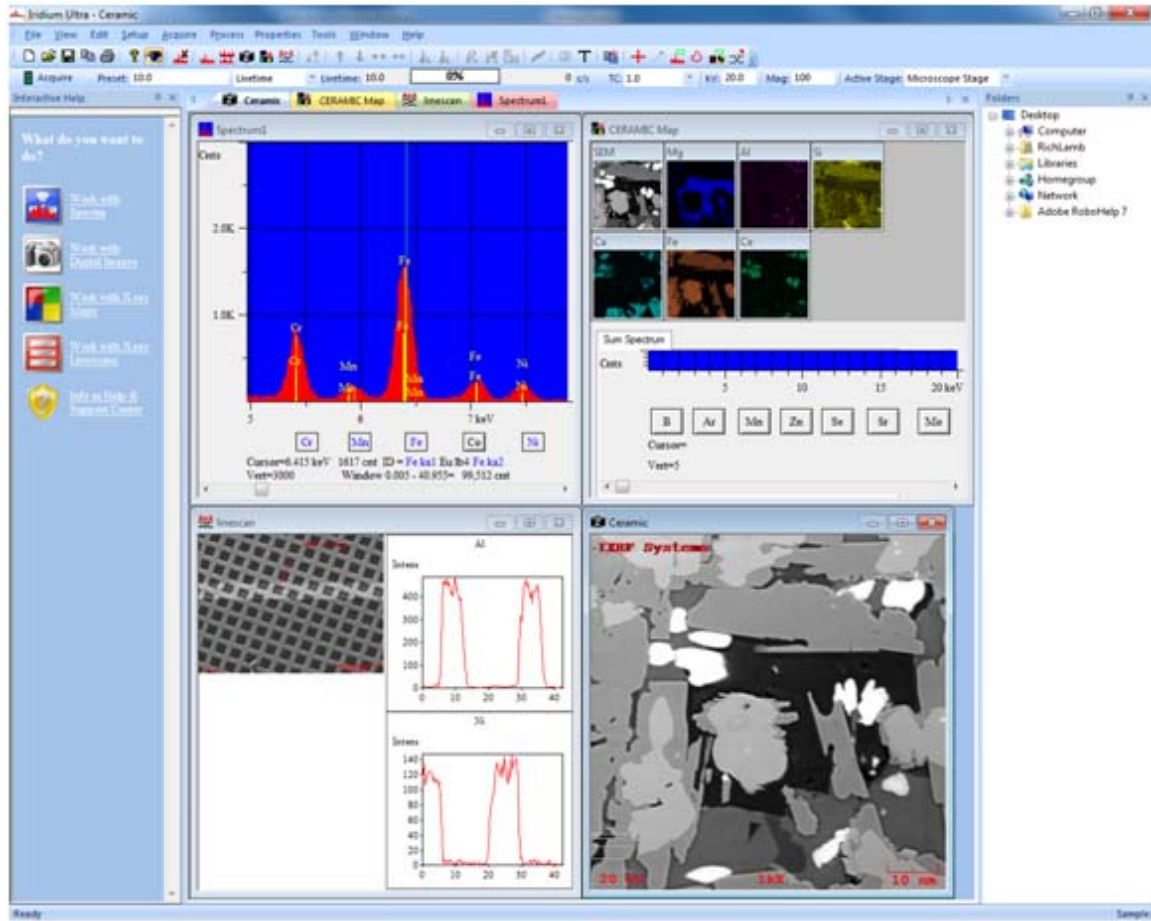


All acquisition and analysis tools provided by the EDS software are contained in a single application. Shown above is an example of the four major tools provided by the software:


- Digital Images
- EDS or XRF spectra
- X-Ray linescans
- X-Ray maps

Each one of these tools is loaded as necessary.

3.1 TitleBar

 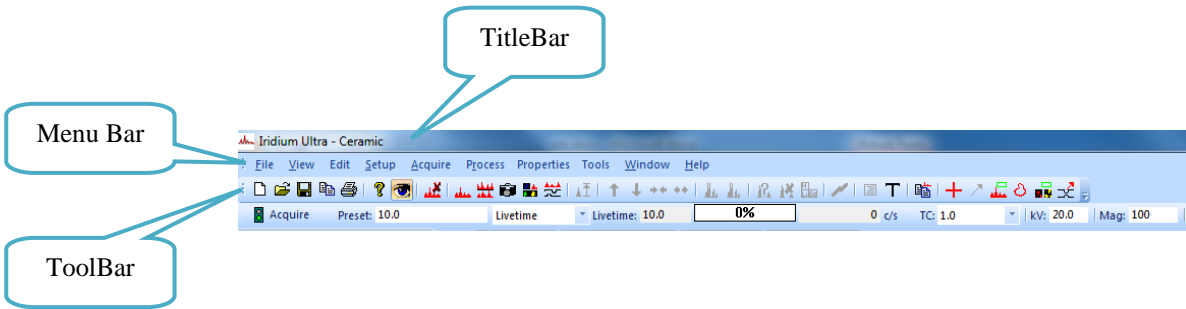





 

 





 



 

 



 







 


At the top of the application is a TitleBar. Displayed in the TitleBar are the name of the application and the name of the active window (Spectrum1, in this case). As you work with the software, you activate a window by clicking on it with the left mouse button. Activating a window will do the following:



- Place the name of the active window in the TitleBar
- Update the menu. Each type of window (spectrum, image, etc) has its own unique menu designed specifically for the kind of window.
- Update the status of the ToolBar buttons. Only the buttons that apply to the active window will be enabled, all other buttons will be deactivated, and will be displayed “grayed out”. An example of a disabled button is seen on the far right side of the ToolBar. The  button is not active for the spectrum window.

3.2 ToolBar

The ToolBar contains buttons to perform common tasks, and displays status information during spectrum acquisition. Below is a brief description of each item on the ToolBar.

	Creates a new active window (e.g. Spectrum, Image)		Prints the active window
	Opens a previously stored Spectrum, Image, etc from disk		Displays information about the software
	Stores the active window (Spectrum, X-ray Map, etc) on one of the system's disks		Creates a new spectrum and start acquisition of the spectrum
	Creates a new combined SEM/XRF spectrum.		Closes all opened windows.
	Copies the active window (e.g., Spectrum, Image) to the Windows Clipboard		Creates a new Image and start acquisition of the image
	Creates a Fast Map using the element list of the spectrum and start acquiring the Fast Map		Creates a Fast Linescan using the element list of the spectrum and start acquiring the Fast Linescan.
	Toggles Spectrum Auto Vertical Scaling		Expands the spectrum Vertical Scale
	Contracts the spectrum Vertical Scale		Compresses the spectrum horizontally
	Expands the spectrum horizontally		Enables display of the energy cursor on the spectrum
	Enables the painting of an ROI on the spectrum		Performs Automatic Element Identification
	Erases Automatic Element Identification		Displays the Periodic Chart for manual element identification
	Toggles display of Spectrum Analysis Report.		
	Enables annotation on the spectrum or image		Performs Quantitative analysis of the spectrum
	Selects a new set of default analysis settings		Image: selects spot location. Linescan: selects horizontal line
	Displays or Hides Interactive Help panel.		For images, selects a freehand area for acquisition of a spectrum.
	For linescans, selects an arbitrary line on the image for acquisition.		For images, selects a reduced raster area for acquisition of a spectrum.
	For images, selects an area for acquisition of an x-ray map.		For images, selects a line for acquisition of an x-ray linescan.

  The bottom half of the ToolBar contains controls and status readouts used for acquiring data. These controls are described below.



Acquire Start/Stop. This button starts and stops acquisition on the active window (e.g., Spectrum, Image, X-ray Map). During acquisition, the button text is changed to **Stop** to indicate that the action taken when the button is pressed is to stop acquisition.

Preset: 10.0

Spectrum Preset Value. This is the preset value in livetime seconds or total counts in the spectrum. Acquisition will automatically stop when the preset condition occurs. The Spectrum Preset Mode determines whether the value is livetime seconds or counts.

Livetime

Spectrum Preset Mode. This selects the kind of Preset to use. For Livetime, the spectrum is acquired for the given number of seconds of livetime. For Counts, the spectrum is acquired until the specified number of x rays has been acquired (total counts in the spectrum).

Livetime: 10.0

Spectrum Acquire Livetime. During acquisition of the spectrum this control displays the livetime seconds. This is the clock time that is corrected for deadtime.

0%

Spectrum Deadtime Meter. This continuously displays the deadtime percentage. A bar graph and a numeric readout are displayed. Deadtime is the time that the pulse processor is unable to process incoming x-ray events, as it is already processing a prior event.

0 c/s

Spectrum CountRate. This continuously displays the input countrate.

TC: 1.0

Time Constant. The time constant can be set directly from here. This is the time constant that will be used for all subsequent data acquisition (spectra, x-ray maps, x-ray linescans).

kV: 20.0

Microscope kV. Enter the accelerating voltage (kV) of the microscope in this box prior to acquiring a spectrum, X-ray Map, or X-ray Linescan. This value is used by the software to control the analysis of the acquired data. It is very important that this value be entered prior to acquiring the data. On systems with microscope control, the kV is automatically read from the microscope.

Mag: 100

Microscope Magnification. Enter the magnification of the microscope in this control prior to acquiring an Image. The value in this control is stored in the image at the beginning of acquisition of the image. All image measurements are based upon this value, so it is very important that it be correct for any measurements to be calculated correctly. On systems with microscope control, the magnification is automatically read from the microscope.

Active Stage: Microscope Stage

Active Stage. For systems with an IXRF Super Stage, or other supported secondary stage, the active stage is selected here. The active stage is used for image and map stitching, and stage maps and stage linescans. The full stage position is saved with all data acquired with

the EDS software (both active stage and microscope stage). This allows for accurate repositioning of the stage(s) to review acquired data locations.

3.3 Menus

A unique menu is displayed for each kind of window. There are, however, some common menu items that are applicable to all windows. These are described below.

Throughout this manual, references will be made to items on the menu. The style will be:


MenuItem/SubMenuItem

MenuItem appears on the menu directly, at the top of the application and when the right mouse button is clicked over a window (e.g., Spectrum, X-ray Map). Selecting **MenuItem** will display a drop-down (sub) menu. For example, the menu shown below for the **Open** submenu item on the **File** menu would be referenced as **File/Open**.

3.4 File Menu


The **File** menu is shown to the right. All of these menu items are common to Spectra, Images, X-ray Maps, and Linescans. Notice that an icon (picture) is displayed to the left of some of the menu items. The icon is a reminder that this menu item is also available from the ToolBar by pressing the corresponding button.

The menu items listed below **Print Setup** are special. These menu items are numbered 1, 2, 3, etc and have a file name next to each of them. These are the most recently opened files. Selecting one of these will automatically open the file, as if you had selected **Open** from the menu.

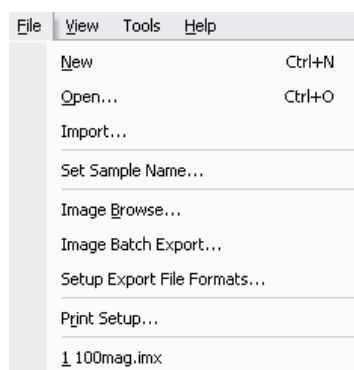

3.4.1 New

Creates a new active window (e.g. Spectrum, Image). A panel similar to the following will appear. Select the type of file desired.

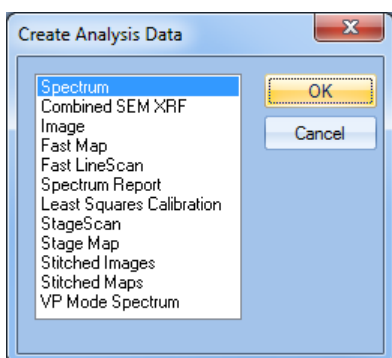

3.4.2 Open.


Opens one or more previously stored Spectrum, Image, EMSA-format spectra files, etc from disk. To open multiple files, use the control and shift keys, as with common windows list selections.

3.4.3 Save EDS Data Set

Saves all opened EDS data to an EDS data set file, so that data from an analysis may be logically grouped together in a single file.

3.4.4 Set Sample Name


Allows for setting of a sample name.

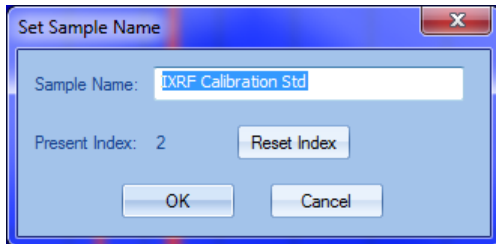

A panel similar to the following will appear. The text entered as **Sample Name** will be used to name all subsequent data acquired in the software (e.g., spectra, images, maps, linescans). In the above example, the data are given names of “IXRF Calibration Std-1”, “IXRF Calibration Std-2”, etc. The **Preset Index** is the current number that is suffixed to the **Sample Name**. In this

example, “2” is the next number. The index can be reset to restart the suffix to “1” if desired by clicking on the **Reset Index** button.


The present Sample Name is displayed on the application status bar (at the bottom of the application window), as shown below.

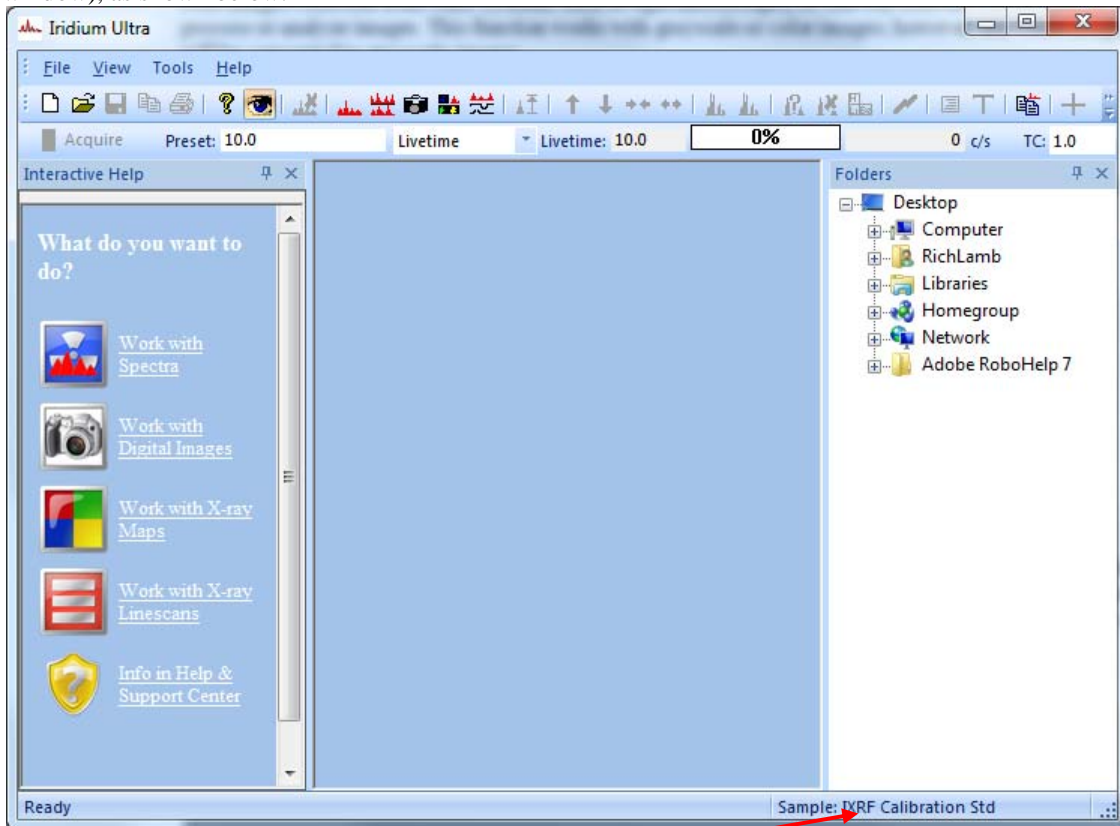

Double-clicking over the Sample Name on the status bar will display the panel for editing the Sample Name, just as the File/Set Sample Name menu item does.


3.4.5 Image Browse

Displays images as thumbnails. Click on Select Folder to change the folder from which images are displayed. Click on an image to select it.

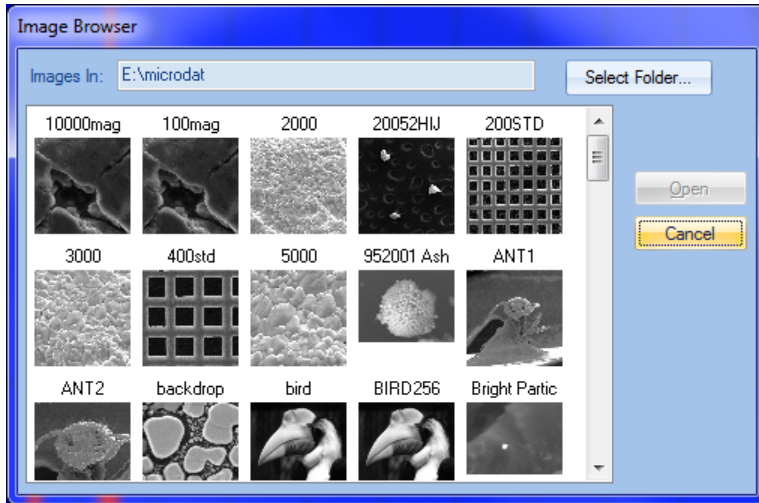

3.4.6 Image Batch Export

Exports multiple Image files automatically.

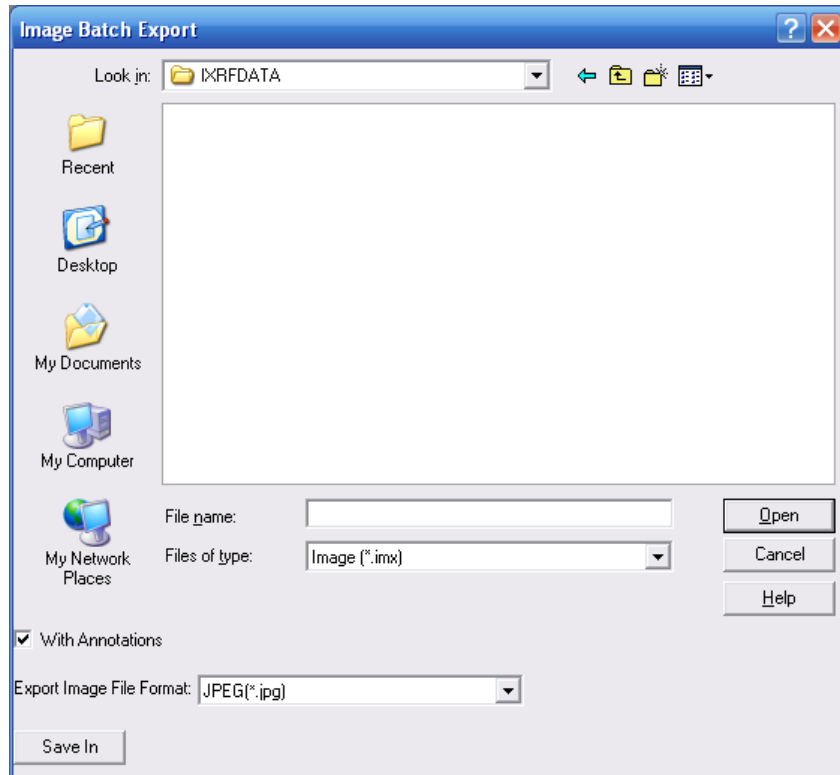

Select one or more image files (use the shift key to select multiple files).


Select **With Annotations** to include the annotations on the images (e.g., magnification, micron scale bar, any annotations such as text, drawing objects, etc.).

Choose the **Export Image File Format** and the folder in which the exported images will be **Saved In**.

3.4.7 Setup Export Formats


Allows for selection of image file formats for the export panels. Throughout the software there are options to save data in a graphic image file format such as TIFF or JPEG. The software supports export to over 40 file formats. This setup allows the user to select only the formats that they use, thus reducing the complexity of selecting a file format for export.

The list below is an example from an Export panel in the software. Listed are JPEG, TIF 24, and Windows BMP 24 formats. All of the other formats are still available, and can be added to the list with the **Setup Export File Formats** menu item.

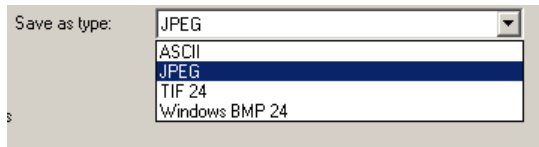

Selecting **Setup Export File Formats** displays a panel similar to the following:

Select the formats that you want to use from the list on the left. Click **Select All** to select all of the file formats; click **Remove All** to de-select all of the file formats.

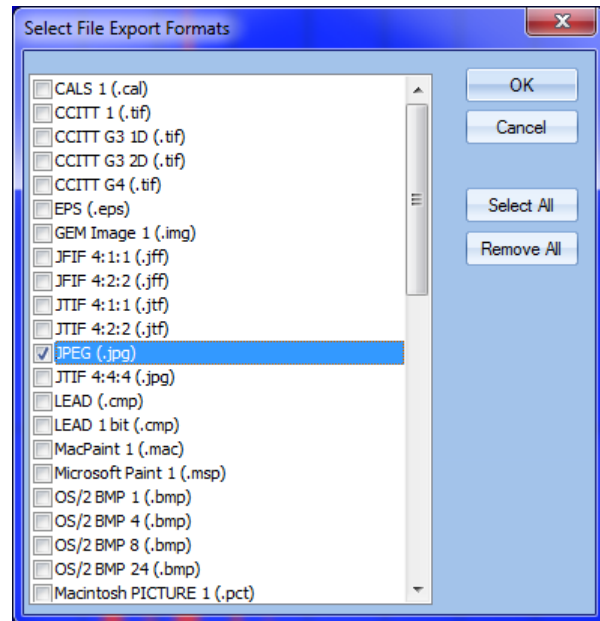


3.4.8 Close

Closes the active window.


3.4.9 Close All

Closes all windows.

This menu item has the same function as the toolbar button .

Select the windows that you wish to close from the list. The **Action** column shows the close action that will be done for each window. By default, any window that has been acquired and not saved will be saved automatically before closing. The data will be saved in the **Current Folder**.

Note in the example, that Spectrum1 action is **No Action Required**. This is because Spectrum1 has already been saved, and does not require saving before closing. The other data shown (FastMap1, FastLinescan1, etc) have not been saved, and the default action (**Save Automatic**) will be applied.

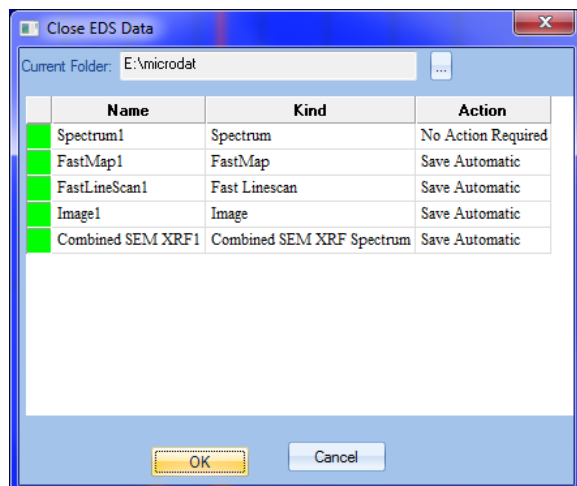

The actions are:

- Save Automatic. Saves the data in the Current Folder using the Name given.
- Save As. Displays a Save dialog for the data, allowing you to select a different name and folder for the data.
- Don't Save. This will close the data without saving it. The previously acquired data will be lost.
- No Action Required. This is the default setting for data that has already been saved. It is equivalent to **Don't Save**.

3.4.10 Save

Saves the contents of the active window using the name in the application TitleBar.

3.4.11 Save As

Saves the contents of the active window, allowing you to change the name of the file.

3.4.12 Export

Saves the active window in an image format. Many graphic image file formats are available including TIFF, JPEG, and Windows Bitmap.

3.4.13 Print

Prints the active window.

3.4.14 Print Preview

Displays the active window as it will be printed. This can be used to preview the printed data prior to actually printing it.

3.4.15 Print Setup

Provides Windows standard printer setup. A selection of printer and printer options is provided.


3.4.16 Exit

Closes all active windows and exits the EDS application.

3.4.17 Create Word Report

Displays a panel similar to the following. Word documents can be created and saved using this panel. All presently opened images, spectra, x-ray maps, and x-ray linescans can be inserted into the document as well as analyses generated from the data.

Note: this requires prior installation of Microsoft Word 2000 or newer software on the computer that is running our EDS software.

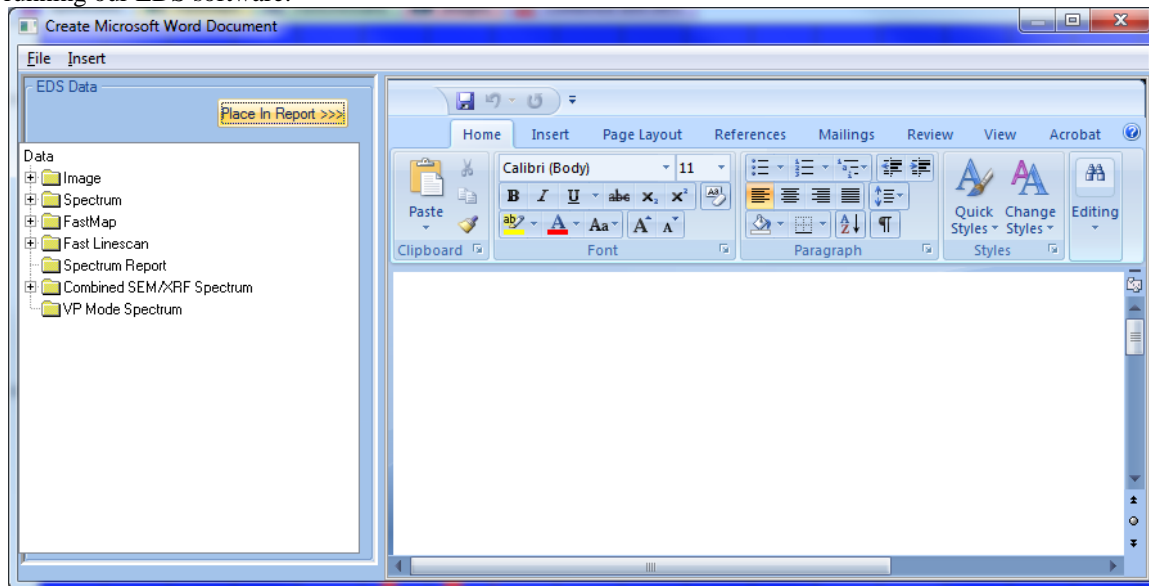

The tree on the left side of the panel displays all of the opened data. The panel on the right is the Word document. The controls on the toolbar on the right side can be used to directly edit the Word file.

Place In Report will take the selected data from the tree on the left side and insert it into the Word file.

From the **File** menu are the following features:

Save As. Saves the Word document

Open. Opens a Word document. This clears the present Word document and then loads the selected Word file. See **Insert** below if you wish to add an existing Word document.


From the **Insert** menu is the following feature:


Word File. This inserts a selected Word file at the end of the Word document (right side of panel).

3.5 View Menu

3.5.1 Interactive Help

The Interactive Help panel is normally displayed on the left side of the application workspace, as shown.

This panel provides help for using the major functions of the application. Clicking on the highlighted text or icon provides detailed, guided help for working with spectra, images, x-ray maps, and linescans. The panel can be displayed or hidden with the  button on the toolbar or with the menu item **View/Interactive Help**. You can switch from the Interactive Help panel to the Folders panel (see next section) by clicking the tabs at the bottom of the panel. The panels can be auto-hidden by clicking on the pushpin icon near the upper right corner of the panel (next to the “X” close icon). You can also change the behavior and view of the panels by right-clicking on “Interactive Help/Folders” the title bar and using the submenu.

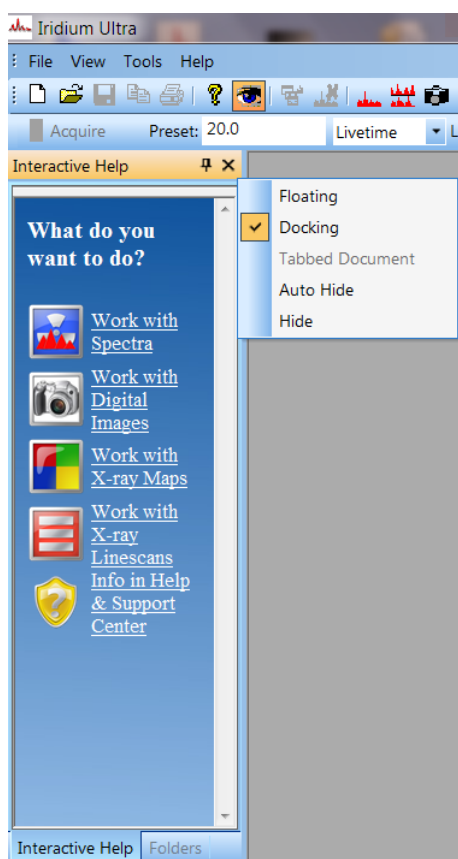

3.5.2 Folders Panel


The Folders panel is also displayed on the left side of the EDS application workspace, as shown.

This panel is used to navigate the file system and to open spectra, image, x-ray map, and linescan files. The panel can be displayed or hidden from the menu item **View/Folders**.

Operation of this panel is identical to that of the Windows Explorer.

Clicking on the + next to a drive or folder will expand the display, showing the files and folders within; clicking on the – will collapse the display.


Only EDS data files (spectra, images, x-ray maps, and linescans) are displayed in this panel. To open any of these files, double-click on the file.

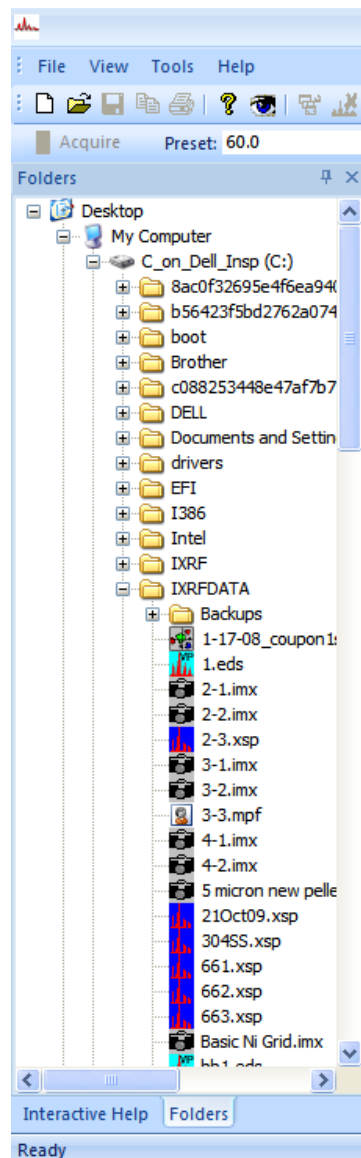

3.5.3 Application Look


The **Application Look** menu item is only shown when the EDS application is initially opened and there are no data displayed; where only a blank workspace is visible. This menu item can be used to change the application appearance to suit the user's preference.

Again, note there are no spectra, images, x-ray dot maps, or linescan profiles displayed.

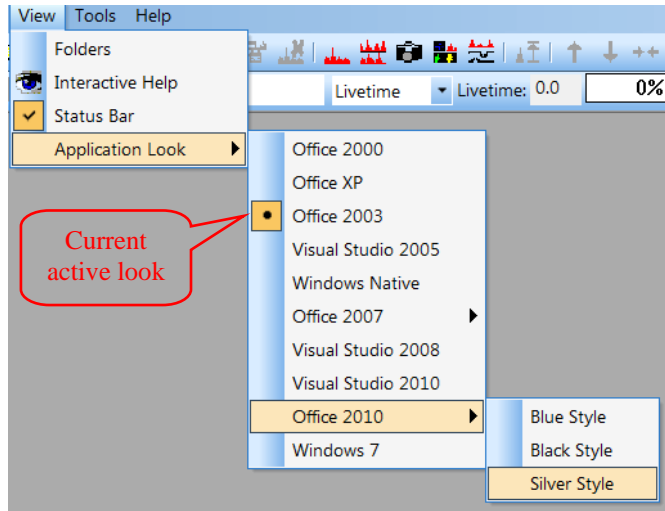


Below are some examples of different application looks:

Office 2010 Black

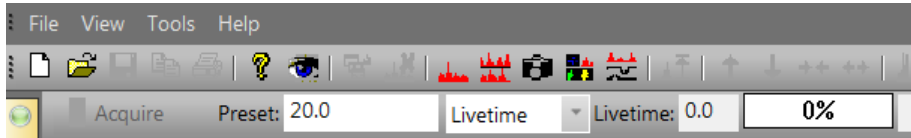


Office 2007 Aqua

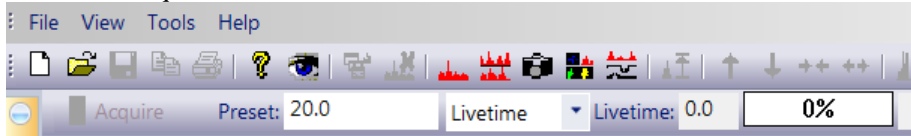


3.6 Tools Menu

The **Tools** menu is shown below. See Chapter 11 of this manual for RoboStage information and the separate PA.PDF manual for particle analysis information.

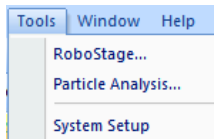

3.6.1 System Setup User Interface

Clicking the **Apply** button will save any changes you have made to this panel. Clicking the **OK** button will save any changes you have made to this panel as well as close the panel. Clicking the **Cancel** button will not save any changes you have made to this panel and close the panel.

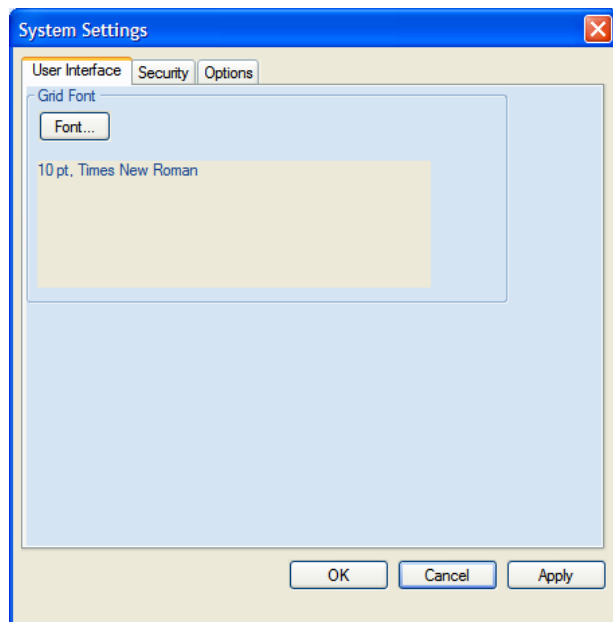

This tab contains all the user interface elements that are settable on a system wide scale, a picture is shown below.


Grid Font allows for the selection of a system-wide font to be used in the tables of the software. Click on the button **Font...** in order to select the font. Once a font has been selected a sample will be displayed below the button. You must click **Apply** or **OK** for any of your changes to be saved once the dialog is closed.

3.6.2 System Setup Security

This tab contains all security features of the software. The panel is shown to the right.

Password allows for the setting of a system wide password to be used for authentication in sensitive areas of the software. Fill in the text box with the desired password in order to set the password. You must click **Apply** or **OK** for any of your changes to be saved once the dialog is closed.

Protect allows for setting which areas of the software are password authenticated. Check the appropriate boxes in order to require users to enter a password in order to make changes to that area. You must click **Apply** or **OK** for any of your changes to be saved once the dialog is closed.

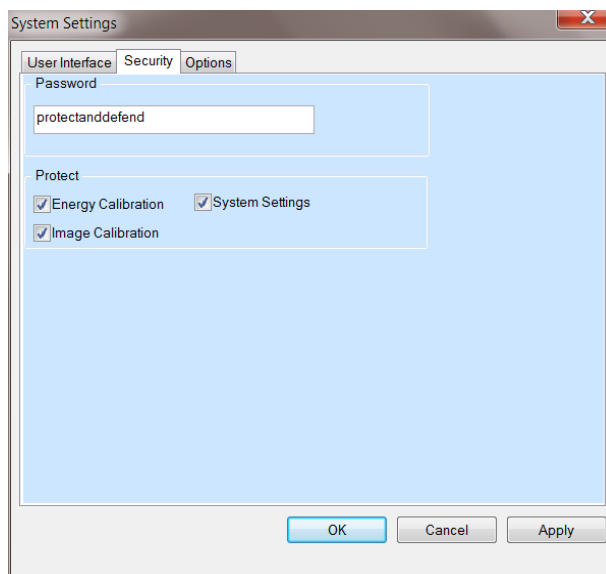

3.6.3 System Setup Options


This tab contains software options that can be enabled.

Enable VP Quantitation. For systems that have variable pressure columns, enabling this option will allow for the File/New menu item to display VP Mode Spectrum. Refer to the section **Working with VP Spectra** for details.

Enable XRF Software Options. For systems that have XRF sources installed, enabling this option will display the XRF-specific controls in the software.

Enable Remote Control of XRF Tube. For systems that have an XRF tube installed, a serial interface can be used to control the tube. This option enables the remote control of the tube.

Prompt to Save File when Closing Window. Selecting this will enable Data Protection when closing files. Refer to the section **Data Protection**

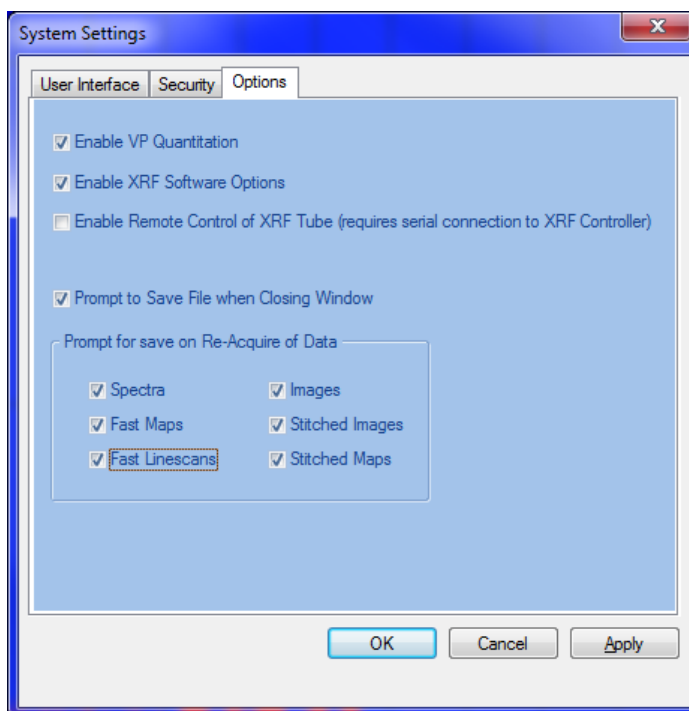


for details.

Prompt for save on Re-Acquire of Data. Each of these selections allows enabling of the Data Protection when acquiring data. Refer to the section **Data Protection** for details.

3.7 Window Menu

The **Window** menu is shown below. All of these menu items are common to Spectra, Images, X-ray Maps, and Linescans.

The menu items listed below **Arrange Icons** are special. These menu items are numbered 1, 2, 3, etc and have a name next to each of them. These are the windows that are presently opened in the EDS application. The active window has a check next to it. Selecting one of these will make it the active window.

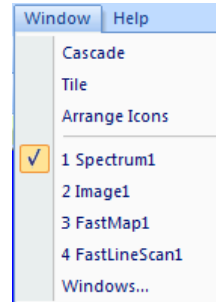

3.7.1 Cascade

Rearranges the windows in a cascading manner.

3.7.2 Tile


Rearranges the windows in a tiled manner. All windows are displayed in equal sized rectangles in the EDS application window.

3.7.3 Arrange Icons

Rearranges the windows that have been minimized on the bottom of the EDS application window.

3.8 Help Menu

The **Help** menu is shown below. All of these menu items are common to Spectra, Images, X-ray Maps, and Linescans.

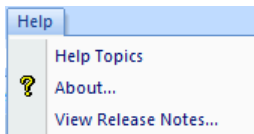

3.8.1 Help Topics

Displays a list of the Help Topics for the software.

3.8.2 About...

Displays information about the application version and the available, installed EDS options.


3.8.3 View Release Notes...

Opens the release notes file (.doc file) for the application.


3.9 Data Protection

Data Protection provides two mechanisms to ensure that acquired data is not mistakenly lost during normal operation of the software. These data protections are enabled by default, but can be disabled.


1. Whenever a window is closed and the data acquired in the window has not been saved, the user will be prompted to save the data.

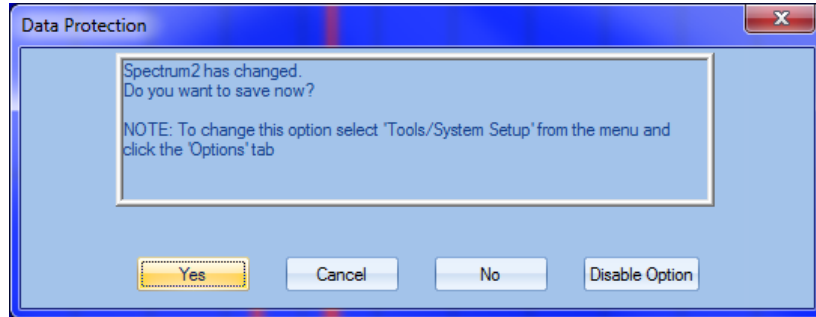


2. Whenever acquisition is started on a window that has previously acquired (and not saved) data, the user will be prompted to save the previously acquired data.

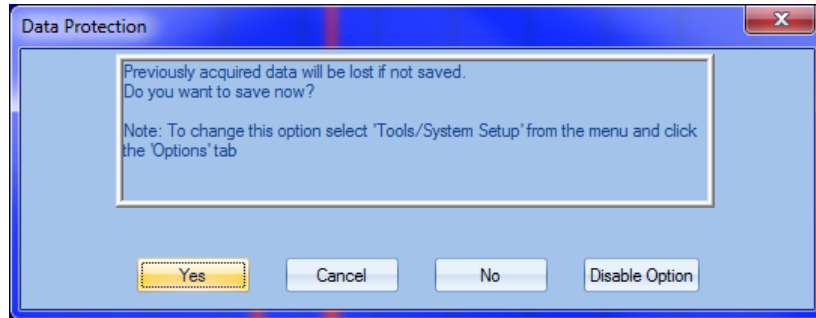

These data protections can be enabled or disabled from the **System Setup Options** panel. To access this panel select **Tools/System Setup**, then click on the **Options** tab. A panel similar to the following will appear.

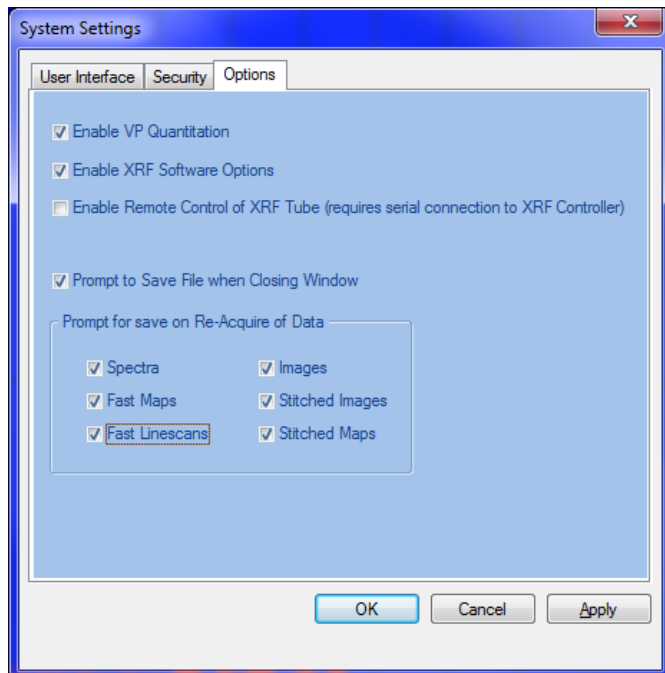

4. Working With Spectra

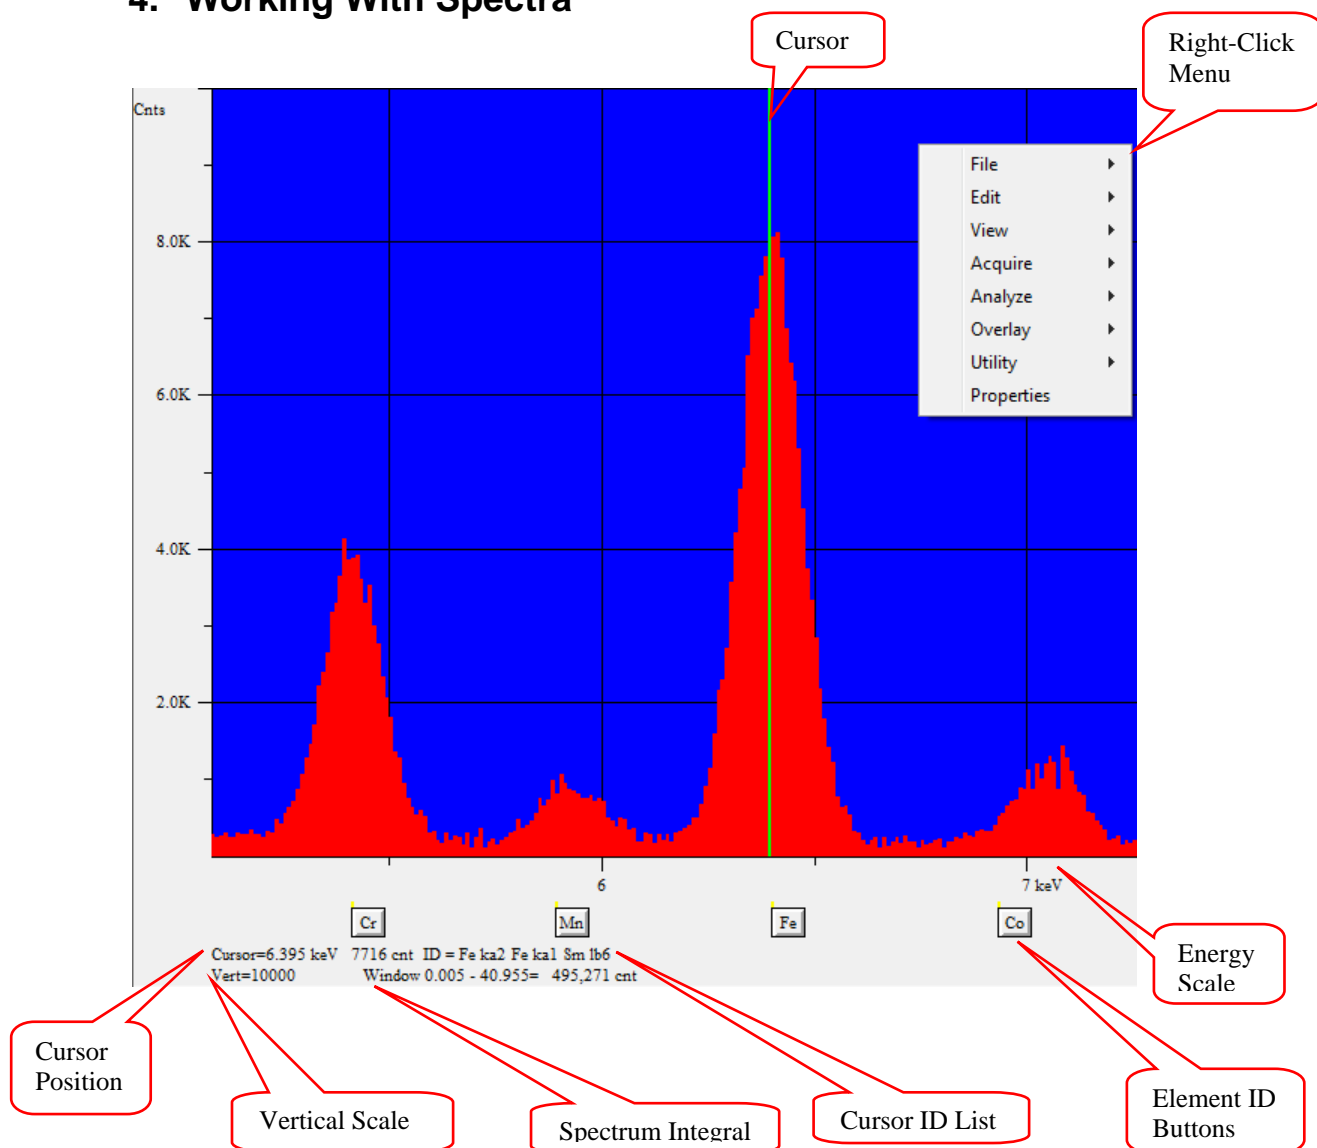


Shown above is a spectrum window. As with all EDS windows (e.g., Spectra, X-ray Maps), a menu is available by clicking the right mouse button when the cursor is positioned over the window. Shown above is the **Right-Click Menu** for the spectrum.

Below the spectrum data is an **Energy Scale**. This is used to interpret the energies of peaks in the spectrum. To examine the energies of the peaks more closely, a spectrum **Cursor** is displayed by clicking the left mouse button when the cursor is positioned over the spectrum. The Cursor is a vertical bar on the spectrum, as shown above.

The **Cursor Position** is displayed, which includes the energy of the cursor and the counts (number of x-rays) in the channel. In addition, a **Cursor ID List** is displayed, which identifies the closest matching x-ray lines near the Cursor Position.

Element ID Buttons are displayed below the Energy Scale. These buttons are located at the position of the $K\alpha$ peak for each element. Note there is a small bar (in the same color as that chosen for the markers) at the upper left corner of the buttons. This indicates the position of the K-line for each element. Clicking on these buttons will add the element to the list of identified elements in the spectrum and display the MLK

 
markers for the element. It is also possible to add elements by double clicking on an element on the Cursor ID List.

The **Vertical Scale** of the spectrum is displayed below the Cursor Position. To the right of this is the **Spectrum Integral**. The Spectrum integral normally shows the whole spectrum integral (typically 0 – 40 keV). It can optionally display a specific energy integral using the  ToolBar button.

4.1 Acquiring Spectra

Click on one of the Spectrum Acquisition buttons on the EDS ToolBar. This will create a new Spectrum window and start acquisition of the spectrum.

The Right-Click Menu for the spectrum has the following menu items related to acquisition:



Start. If the spectrum is not presently acquiring, this continues the spectrum acquisition. If the spectrum is acquiring a ☒ will appear next to this menu item. Selecting this again will stop acquisition.

Clear erases the spectrum.

Resume continues a previously stopped acquisition, or starts a new acquisition if no spectrum has been acquired. This can be useful if you wish to acquire for a longer time that originally set.

4.1.1 Returning to Acquisition Location


The microscope stage location is stored at the start of acquisition. To return the stage to the location of the previously acquired data, select **View/Go To Stage Location**. This will move the stage to the location where the data were acquired.

4.2 Viewing Tools


4.2.1 Expanding and Contracting views

The most common way to adjust the view of the spectrum is using the **Cursor**. To adjust the view of the spectrum, press the left mouse button down at a location on the spectrum that you would like to view at the center of the window. With the mouse button held down, dragging the mouse will have the following effects:


- **Drag Right** will expand the spectrum horizontally, displaying more detail in the spectrum around the Cursor location.

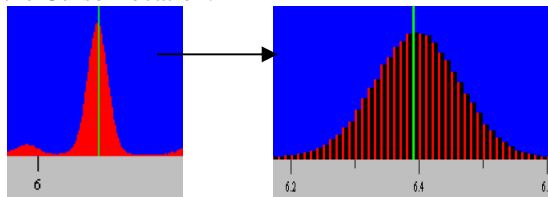


- **Drag Left** will compress the spectrum horizontally, displaying a larger range of energy in the spectrum window.

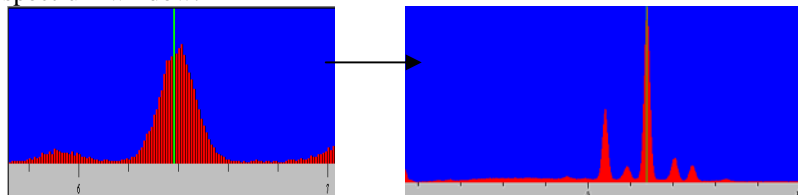

- **Drag Up** will expand the spectrum vertically, displaying more detail in the spectrum.

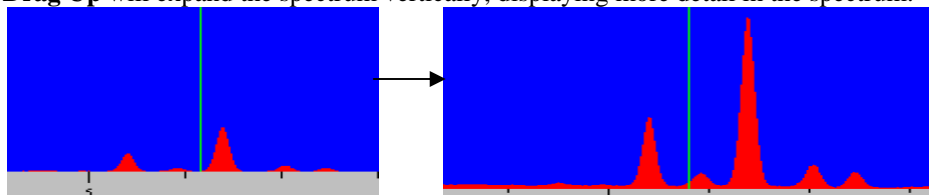


- **Drag Down** will compress the spectrum vertically.

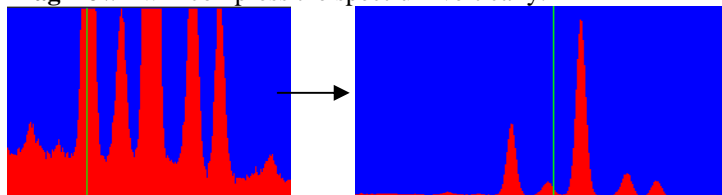



4.2.2 Auto Vertical Scale

Auto Vertical Scaling is available from the menu as **View/Auto Vertical Scale** and also as the ToolBar

button . When this feature is enabled, the spectrum is scaled vertically such that the tallest peak in the window scales to the top of the window.

4.2.3 Manual Setting of Displayed Energy

Double clicking on the Energy Scale displays a dialog to manually set the energy scale.

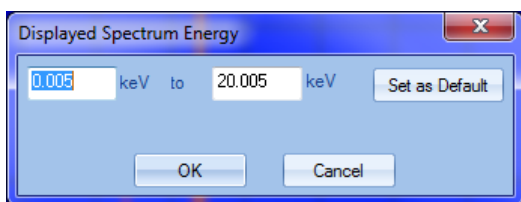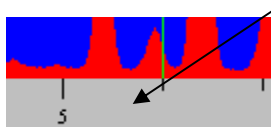


This allows for setting an exact energy range for the display of the spectrum. Often, when preparing to print a spectrum, it is necessary to adjust the displayed spectrum to show a specific energy range. This is sometimes difficult to achieve with the Cursor. Enter the energy range that you wish to display in the spectrum window.

This panel can also be used to set the default energy range used when displaying spectra. In some applications it is only necessary to view spectra from 0 - 20 keV. In cases like these, you can enter the energy range as 0 - 20 and then click on **Set as Default**. This will ensure that all subsequent spectra will have an initial display of 0 - 20 keV. It will still be possible to view the data above 20 keV, but the initial display will always be 0 - 20 keV.

4.2.4 Bipolar Display

Bipolar display of spectra shows both positive and negative channel data. Normally, a spectrum does not contain negative channel data. An exception to this is after spectrum processing, for example, background removal. It is sometimes useful to view the data after background removal, and it is recommended to view it using bipolar display so that any negative channels can be displayed. Below is an example of bipolar display after background removal.

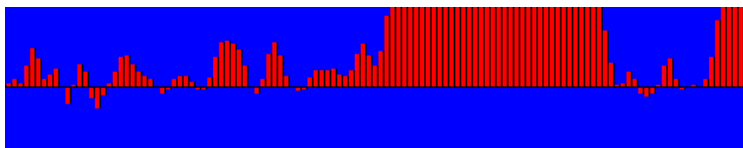

The baseline (0 counts) is shown as a horizontal line in the middle of the spectrum display. Some channels contain negative counts, and thus are shown below the baseline.


To view the spectrum in bipolar display, select **View/Bipolar** from the menu.

4.3 Overlaying Spectra

Spectra can be overlaid to inspect for similarities or differences. This is a useful visual tool. Up to three spectra may be overlaid.

There are three ways to overlay spectra:


1. Using the menu, select **Overlay/Spectrum**. A panel similar to the following will appear.

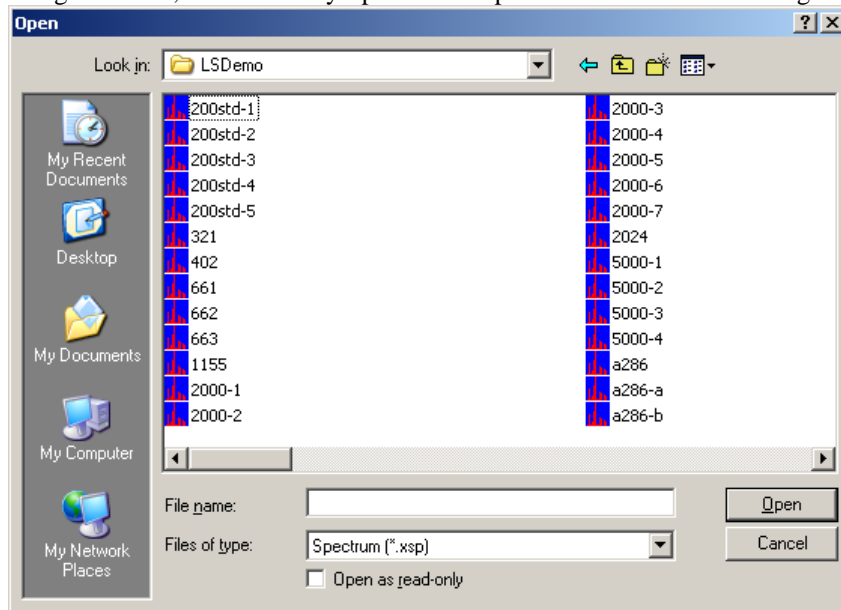


EDS spectrum files (*.xsp) and EMSA spectra files can be overlaid. Multiple spectra can be selected by pressing the Ctrl key and clicking on a spectrum.

2. Using the mouse, you can drag a spectrum over another spectrum to overlay it. Do the following: Move the cursor over the spectrum you wish to overlay. Hold down the Ctrl key and press the left button of the mouse. Drag the cursor, keeping the left mouse button down, until it is over the other spectrum. Release the left mouse button, then the Ctrl key. The spectrum will now be overlaid.
3. Select **Overlay/Copy** from the menu of the spectrum you wish to overlay, then select **Overlay/Paste** on the other spectrum. The spectrum will now be overlaid.

The overlaid spectra names are displayed in the upper-right corner of the spectrum, as shown below.

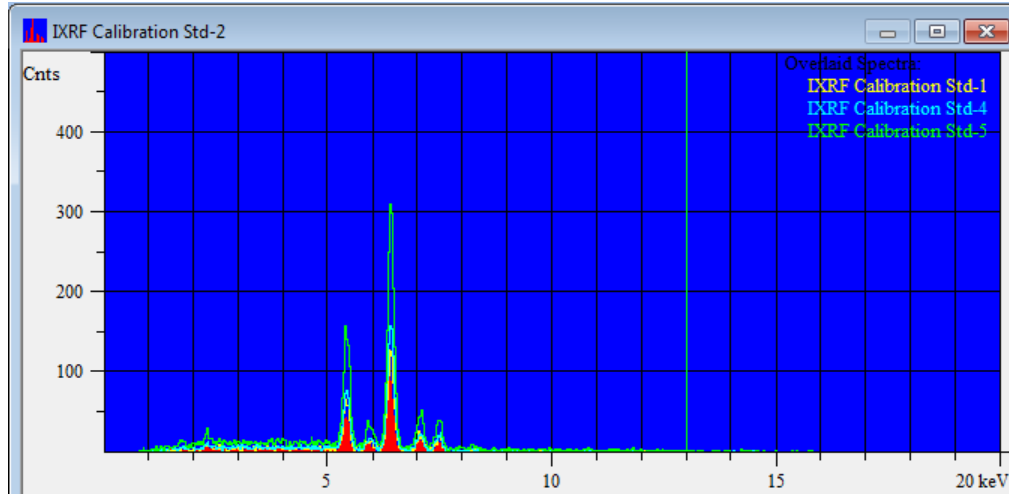

 Right-clicking over a name will display a menu.



Selecting **Color** allows changing of the overlaid spectrum color.


Selecting **Delete** will remove that overlaid spectrum.

4.4 Annotations and Notes

Spectrum annotations are text/shapes that are overlaid on the spectrum. The annotations are saved with the spectrum and can be printed, exported, or copied to the clipboard with the spectrum. Text, lines, arrows, free-floating text, rectangles, etc are available to annotate a spectrum... These tools are available by

selecting **Edit/Annotations** from the menu or by clicking on the **T** button on the ToolBar. For instructions on working with the annotations panel please refer to section 4.9 of the **Digital Imaging** manual.

Notes are a simple text-only overlay on the spectrum. To add notes to a spectrum, select **View/Notes** from the menu. A Notes panel will appear on the spectrum. To edit the notes, double click in the Notes panel. Below is an example of the Notes panel and its edit panel.

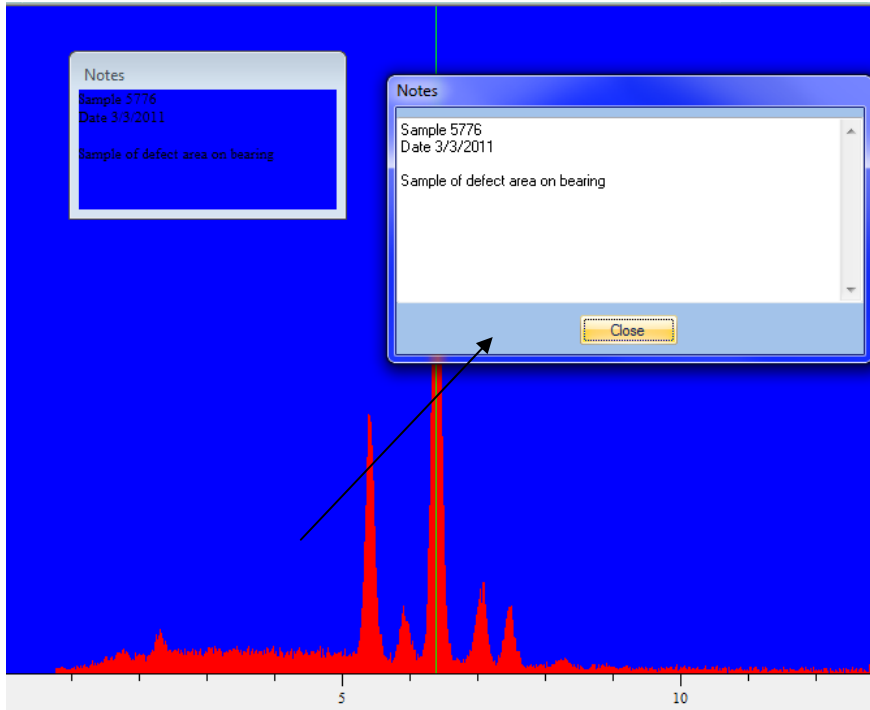




Text typed in **this window** is added as notes for the spectrum and are displayed in the window on the left. When you are finished editing the notes, click the Close button. The Notes window on the left will remain on the spectrum. You can move and size this window using the standard Windows mouse interface. The display of the notes can be toggled on/off by selecting View/Notes menu item. You can re-edit the notes by double-clicking the notes window.

Note: When entering text, after each line of text press Enter on the keyboard. This is especially important for the last line of text.

4.5 Customizing Display and Printing Colors

The colors used to display and print spectra can be customized to your personal preferences. Some color combinations work well on black and white printers, but are not suitable for color printers. Users may have color combinations that are preferred for displayed spectra and MLK markers. These colors can be adjusted and the preferences saved as default settings.

To access the color preferences, select **Properties** from the menu and click on the **Display** tab, as shown. Then click on the **Display and Print Settings** button. The **Spectrum Display** panel will appear as shown below.

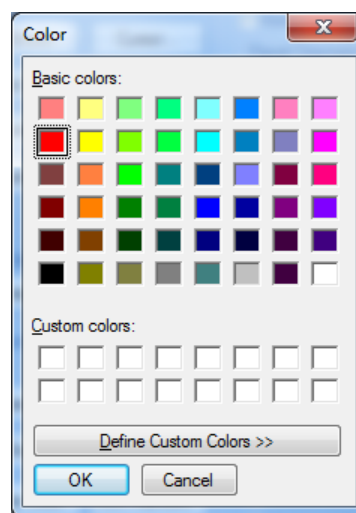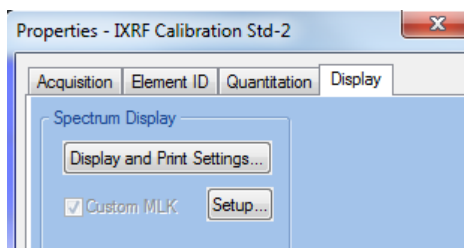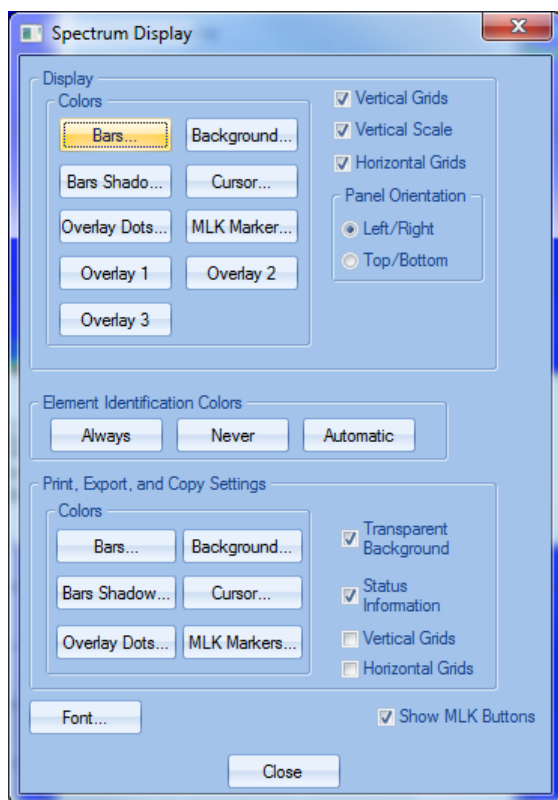

The **Display Colors** are for the screen, and the **Printing Colors** are for printing, exporting, and copying to the clipboard. Checking the **Transparent Background** box means that the background will be left blank during printing. Color selections in this dialog are done with the standard Windows color selection dialog as shown. The color can be selected from one of the basic colors, or a custom color can be defined and selected.

Status Information enables the printing of the cursor status information below the spectrum. When enabled, all of the cursor status information, as displayed on the screen, is printed. When disabled, this information is not printed.

Show MLK Buttons enables the display of the MLK buttons below the spectrum. When enabled, buttons appear under the spectrum at the location of the $K\alpha$ line for as many elements as is possible to fit on the screen.

Vertical and Horizontal Grids displays grid lines on the spectrum. This is selectable separately for the display and printing.


Vertical Scale displays a vertical scale in counts on the left edge of the spectrum.


Panel Orientation selects whether the Spectrum panel and Analysis panel will be displayed **left/right** or **top/bottom** aligned.

Fonts allows for selection of a font for the spectrum display and the Notes overlay on the spectrum. Click on the Font button and a standard Windows font selection panel appears. The font and font size can be selected.

4.6 Painting Windows

A window can be “painted” on the spectrum to specify a ROI (Region Of Interest). The ROI can be used

for simple integration of an area of the spectrum, using the ToolBar button . Window painting is also used when defining Background Model regions. Painting is done with the mouse buttons. Use the left mouse button to select a region by pressing down the left mouse button and then dragging it across the spectrum. As you drag the mouse the selected area of the spectrum will appear “painted” yellow. Lift the left mouse button after the desired area has been selected. The right mouse is used to remove (un-paint) parts of the ROI. Press the right mouse button down and drag it to erase.


Note: While Window Painting is active (e.g., during Background Model, or  use), the mouse can only be used to adjust the ROI of the spectrum.

4.7 Identifying Peaks

One of the first tasks in performing an analysis is identifying the peaks in a spectrum. For a qualitative analysis, identify the peaks by displaying the element symbols and MLK marker positions on the spectrum. For quantitative analysis, the elements that are to be quantified must be specified in the element list for the spectrum. Automatic and manual peak identification methods are provided. Manual peak identification can be done using any of these tools:


- Element ID Buttons
- Periodic Table
- Cursor Identification

4.7.1 Element ID Buttons

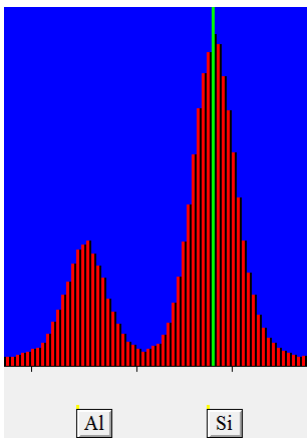


Element ID Buttons are displayed below the Energy Scale on a spectrum. These buttons are located at the position of the $K\alpha$ peak for each element. Clicking on these buttons will add the element to the list of identified elements in the spectrum and display the MLK markers for the element. At certain display resolutions, there may be a bar at the upper left corner of the element ID buttons in the same color chosen for the markers. This indicates the position of the K-line.

4.7.2 Periodic Table

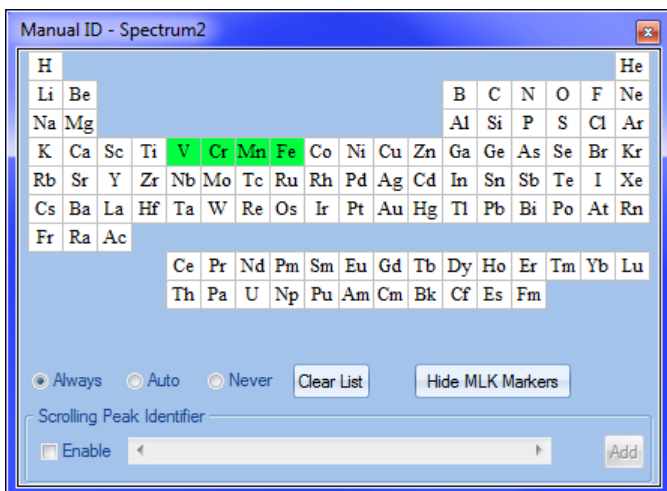


 A Periodic table can be displayed from the **View/Period Table** menu item, or from the

ToolBar button . To add elements manually to the element list, select **Always** at the bottom of the panel and then click on the buttons on the periodic chart to display the MLK markers for any element. Using the Periodic Table method is especially useful when identifying L and M series lines in the spectrum.


4.7.3 Scrolling Peak Identifier

It is possible to “scroll” through the periodic table using the **Scrolling Peak Identifier**. To use this functionality select **Enable** at the bottom of the dialog. Use the scroll bar provided to scroll through the atomic numbers. The present element is displayed to the right of the scroll bar, colored yellow on the periodic table, and marked on the spectrum. To add this element to the selected elements click the **Add** button. When you have finished adding the last element, be sure to uncheck Enable so that an unwanted element isn't accidentally labeled.

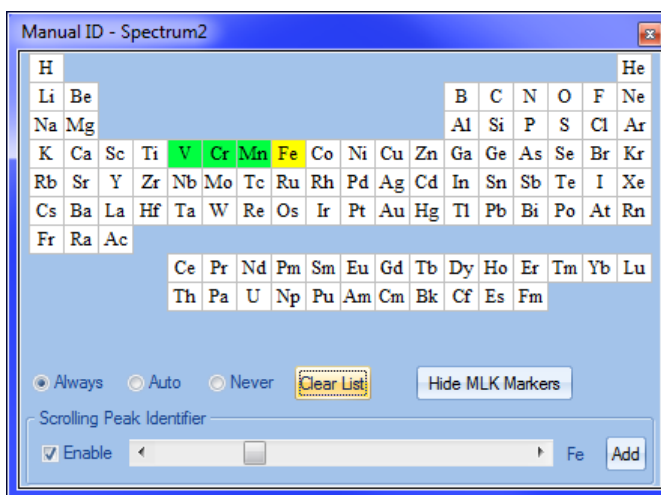

4.7.4 Cursor Identification

A list of the possible peaks at the Cursor energy is displayed below the spectrum. This is the Cursor ID list. Double clicking on an element on this list adds or removes the element from the manually identified element list.


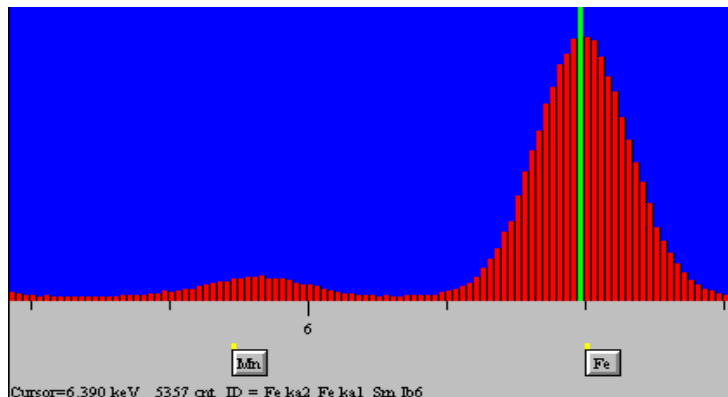


Double Click here to add **Fe** to the element list. When added, it will be displayed colored green. The element can be removed from the element list by double clicking it again.

4.7.5 Customizing Display of MLK markers

Customizing the MLK markers is done from the **Display** tab of the **Spectrum Properties** panel. Click on the **Setup** button on the **Display** tab, as shown below.

A panel similar to the following will appear.

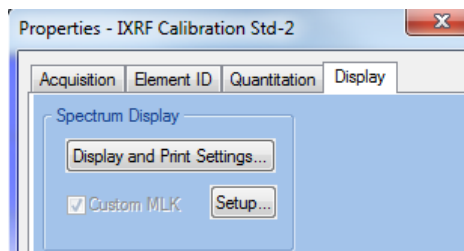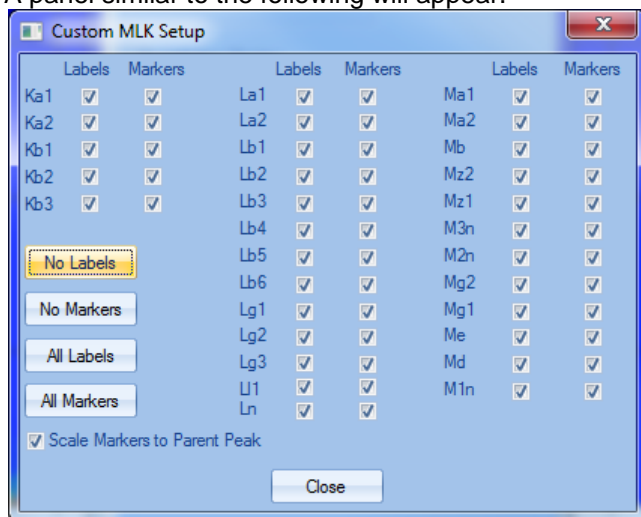


Each element has K, L, M, ..., x-ray line series that are unique in energy for each element. For some elements, these energies can be too low, or too high, to be in the spectrum. The line energy may be too low to be detected, or so high that they are either not excited by the electron beam, or are too high for the range of the spectrum (or both). For those line series that are excited, detected, and displayed, the pattern of lines in those series can be used to match to, or identify the peaks in the spectrum. If you think of each line series as a “fingerprint,” then these fingerprints can be manually selected and visually matched to the spectrum peaks. Of course, the lines are broadened by the detector response function, so one should align

the individual lines to the peak centroids making allowance for peak overlaps for adjacent lines. For example, most $K\alpha_1$ and $K\alpha_2$ lines are too close to be resolved by EDS detectors, so these will appear as one broad $K\alpha$ peak. The lines in any series all have different probabilities, so that there is significant variation in the relative heights of each line. The MLK markers are displayed on the spectrum at the energies of the lines. This visual aid is used to verify the presence of an element in the spectrum. Each line can be labeled with its element symbol (e.g., Fe), although displaying all of the markers and labels on a spectrum can create a very cluttered view. Using this dialog, each label and marker can be selected on or off. The markers can be scaled to the parent peak. This is the default selection. When selected, the marker for the parent peak of each line series (K, L, M) will be displayed at the height of the spectrum data in its channel. The markers for the remaining lines in each series will be scaled to the parent marker's height based upon the relative probability of the line in the series.

Selecting **Keep MLK for Next Spectrum** will copy all MLK markers from the present spectrum to any subsequent spectra acquired. This can be useful when taking several similar spectra on a sample. It is not necessary to label the peaks on subsequent spectra.


Below is an example of MLK markers displayed on a spectrum.

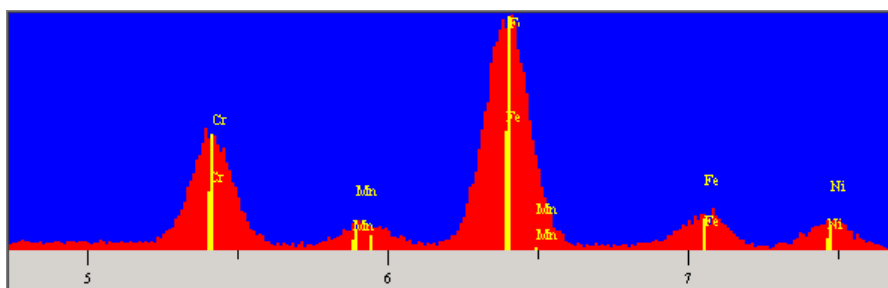

4.7.6 Automatic Element Identification


Automatic element identification (Auto ID) is a tool that automatically locates the peaks in a spectrum and associates the most likely elements with each of these peaks.

Automatic peak identification is invoked with the ToolBar

button . It can also be added to an analysis as an automatic step performed prior to the quantitation of a spectrum (see the Element ID tab below). Auto ID examines all the peaks, and all the identified lines, and attempts to predict the most likely combination of elements that qualitatively match the spectrum. For any given element, all possible peaks in the spectrum are considered when making the most likely estimate of elements present. Note that this procedure is unlikely to be completely accurate, and the analyst should either confirm the results manually, or severely constrain the list of likely elements to be present. Also, note that any shift in the peaks (mis-calibrated energies) will result in a less accurate ID analysis.

4.7.7 Configuring Automatic Identification

Automatic peak identification operates on the original spectrum and works best when it has been optimized. Automatic peak identification is configured on the **Element ID** tab of the Spectrum properties. Select **Properties** from the spectrum's menu and then click on the **Element ID** tab, as shown.

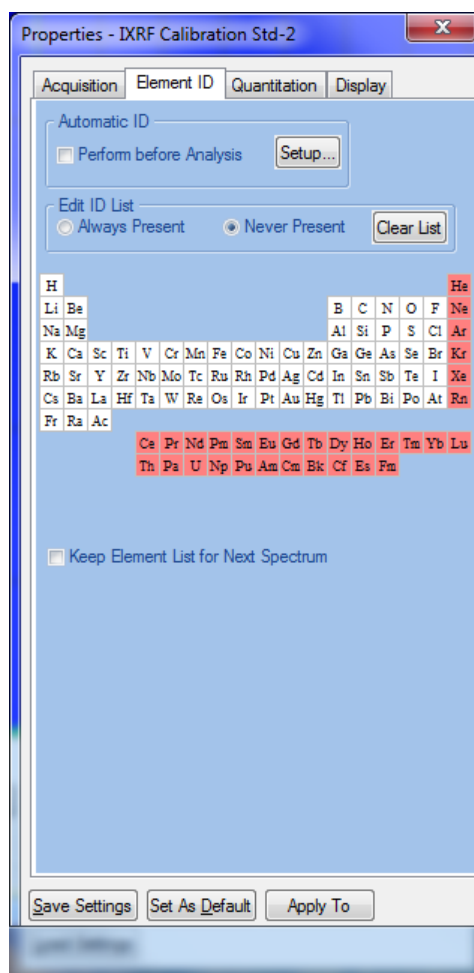

Click on the **Setup** button to configure automatic identification. A panel similar to the following will appear.

The parameters that are used to optimize the Automatic peak identification are:

Peak Sensitivity

During the first part of automatic element identification, peaks in the spectrum are located. Increasing values make the automatic identification more “sensitive”, including smaller peaks in the identification process. The default is 2.

Search Width

After the peaks in the spectrum have been located, element lines are associated with each peak. For a line to be associated with a peak, the line energy must be close to the peak's centroid. The Search Width property defines how close the line must be to the peak centroid. The value is given in percent of FWHM (Full Width at Half Maximum). Since FWHM increases with energy, lines at higher energies are not required to be as close to the peak centroid as those with lower energies. Selecting a larger value for this property will increase the number of element lines that will be associated with a given peak. This number should be kept as small as possible. Keep in mind that when peaks from different elements overlap, the apparent peak centroid may be located a considerable distance from the individual lines. Under these conditions, a wide value would be necessary in order to correctly identify the elements. However, this can result in other elements “identified” that are not actually present. Values in the range of 10% - 35% are typical. The default is 12%.

Always Present



Select this to add and delete elements in the **Always Present** element list. Select this and then click on elements in the periodic chart. The elements are color-coded. The color-coding is described in the Periodic Table dialog. Elements in this list are considered to be in every spectrum collected and will automatically be included in the analysis.

Never Present


Select this to add and delete elements in the **Never Present** element list. Select this and then click on elements in the periodic chart. The elements are color-coded. The color-coding is described in the Periodic Chart dialog. Elements in this list are considered to never be present in a spectrum. This list is useful for automatic element identification in that it helps to restrict the possibilities for identification of elements in each peak. All elements that are known to never be in a spectrum should be added to this list to improve the reliability of the Auto ID.

4.8 Customizing Spectrum Rendering for Printing, Exporting, and Clipboard

Spectrum rendering can be customized using the **Spectrum Options** setup. Access to the **Spectrum Options** setup is available on the spectrum Print panel (as shown below), and also on the Export and Export to Word panels.

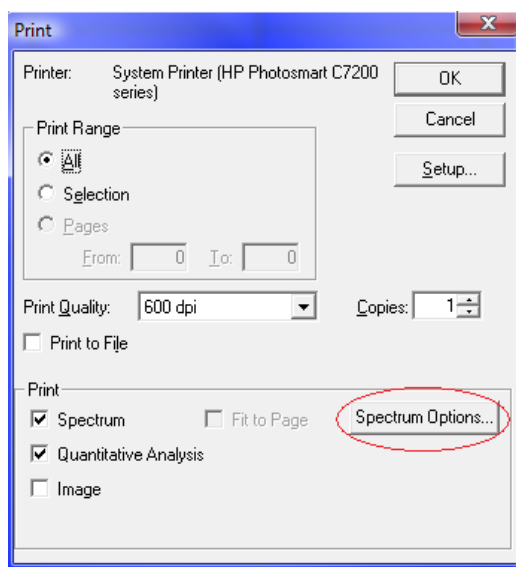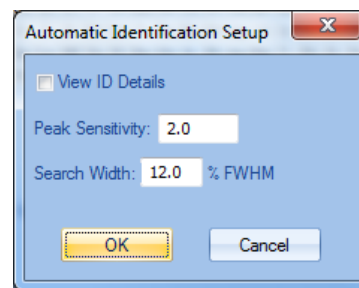

Clicking the Spectrum Options button displays a panel similar to the following:

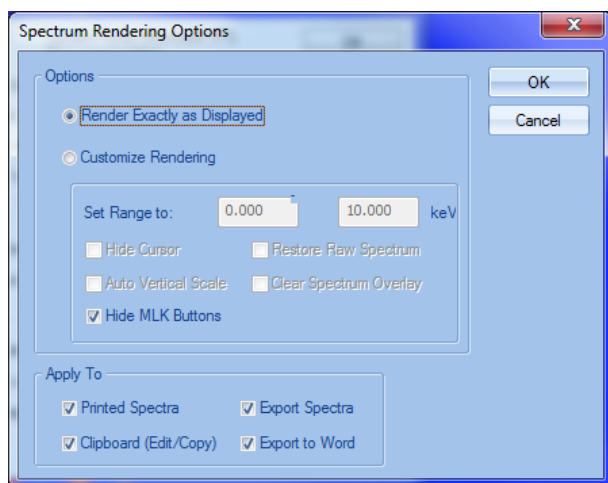

There are two primary settings for the spectrum rendering

- **Render Exactly as Displayed.** The rendering will render the spectrum as closely as possible to what is displayed on the screen. This will include the energy range, cursor marker, etc.
- **Customize Rendering.** Selecting this option allows for setting the energy range for the spectrum, and other customizations described below.

The rendering options can be selectively applied to Printing, Exporting, and Clipboard output. The selection is done in the **Apply To** section of this panel.

The spectrum rendering customizations are:

- **Set Range to.** Enter the energy range that you desire for the spectrum rendering.
- **Hide Cursor.** The vertical cursor can be useful during qualitative analysis of the spectrum, but may be a distraction in the rendered output. This option allows hiding of the cursor in the rendered spectrum.
- **Auto Vertical Scale.** Select this option to have the spectrum scaled automatically during rendering.
- **Restore Raw Spectrum.** After quantitation, the spectrum displayed is normally the processed (e.g. background removed) spectrum. It is common to want to output the raw spectrum (non-processed) in reports. This option will automatically render the raw spectrum.
- **Clear Spectrum Overlay.** After quantitation, an overlay of the fitted peaks is typically displayed. Select this option to remove the overlay from the rendered spectrum.
- **Hide MLK Buttons.** The MLK buttons below the spectrum are useful for peak identification, but are not necessary for printed reports. Selecting this option will hide these buttons.

4.9 Exporting Files

Spectrum data files can be exported to a variety of file formats, including TIFF, BMP, JPEG, Microsoft Word, and EMSA. The export file options can be found on the File/Export menu.

Also note that the File/Save panel has an option to export as well as save the data file. This can be very helpful if you both save and export spectra, saving the added step of exporting after saving.

Below are the Export options.

4.9.1 File/Export/Spectrum

Exports the spectrum to a graphics file format (e.g., TIFF, JPEG), and also ASCII data formats such as EMSA.

4.9.2 File/Export/Analysis

Exports the analysis of the spectrum in a graphics file format or ASCII text format.

4.9.3 File/Export/Multi-Spectrum Export

Exports all open Spectra to a graphics or ASCII data file.

4.9.4 File/Export/Export to Word

Exports the spectrum, and optionally the Quantitative analysis and Image associated with the spectrum, to a Microsoft Word file. Separate heading and footer files can be used to customize the document file. These can be used for Company Logo, and other documentation purposes.

The Report Options allows for customization of the output.

Clicking on the **Report Options** button displays the Word Report Setup panel, as shown below.

Text Font. Clicking on this button allows for the selection of the font and font size used in the report. Please note that the report title will be 2 points larger than the Text Font Size.

Image Height. Sets the height of the image in inches.



Spectrum Height. Sets the height of the spectrum in inches.

Fit to 1 page. When selected, this option will format the report to fit on one page, within the limits set (see below). If the initial settings of font, image and spectrum height result in a document which is larger than one page, the font and heights are reduced so as to fit the report to one page. The font and heights will only be reduced in size to the minimum limits given below. The heights are reduced in increments of 1/2 inch. The font is reduced by 1/2 point size for every 1 inch that the heights are reduced.

Fit Minimum Sizes

These are the minimum values allowed in the document when the **Fit to 1 page** option is selected.

- **Text Font Size.** Sets the smallest font that will be allowed in the document.
- **Image Height.** Sets the shortest height that will be allowed for the image in the document.
- **Spectrum Height.** Sets the shortest height that will be allowed for the spectrum in the document.

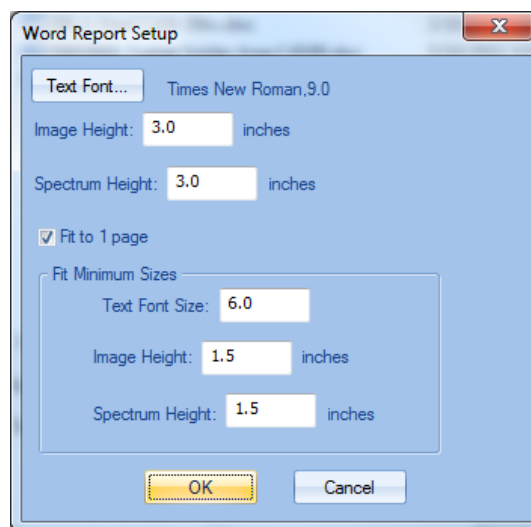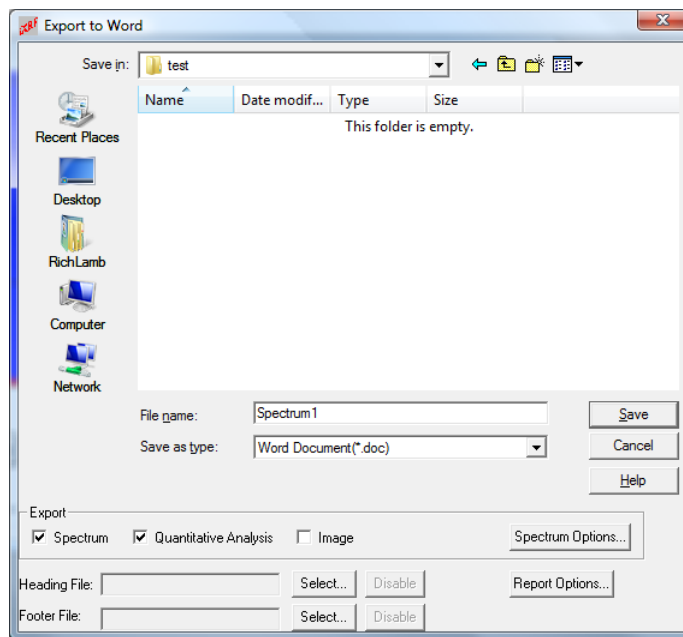


4.10 Quantitative Analysis of Spectra


Quantitative analysis performs spectrum processing, net peak extraction (deconvolution), and quantitation (e.g., ZAF, Match). The steps in the analysis of the spectrum can be customized for particular kinds of samples and stored in Settings Files. These settings files can easily be loaded when needed, to provide the specific analysis necessary on each kind of sample.

Automatic element identification can be performed as part of the quantitative analysis (see previous section), eliminating the need to manually identify peaks in the spectrum prior to quantitation.

Complete quantitative analysis can be performed by:

- Clicking on the ToolBar button 
- Selecting **Analyze** from the menu
- Setting the **Always Quantitate after Acquire** option on the Quantitation tab of the spectrum Properties. When acquisition of the spectrum has completed, the quantitative analysis will be performed automatically.


The following flow chart shows all the possible steps, in order, for a complete spectrum analysis. Manual step-wise quantitative analysis can be performed using the **Utility** menu item **Manual Processing**. This is described later in this chapter.

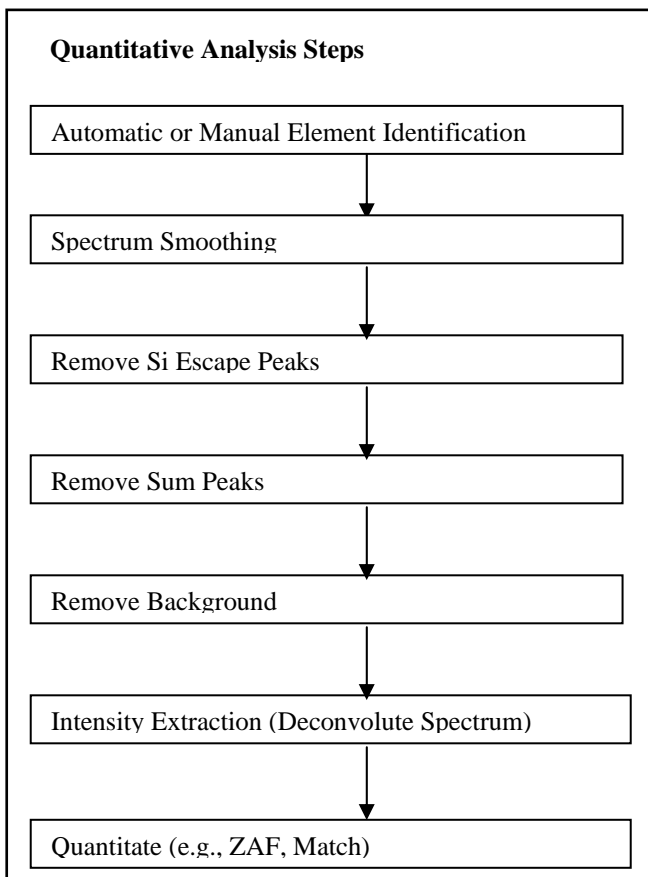

Some of these steps are optional (smoothing, escape and sum peak removal), and others are mandatory (Auto or Manual Element ID, background removal, intensity extraction and quantitation).

4.10.1 Analysis Settings

The quantitative analysis steps are set up in the **Quantitation** tab of the spectrum Properties. To access this, select **Properties** from the menu and then click on the **Quantitation** tab. A dialog similar to the following will appear:

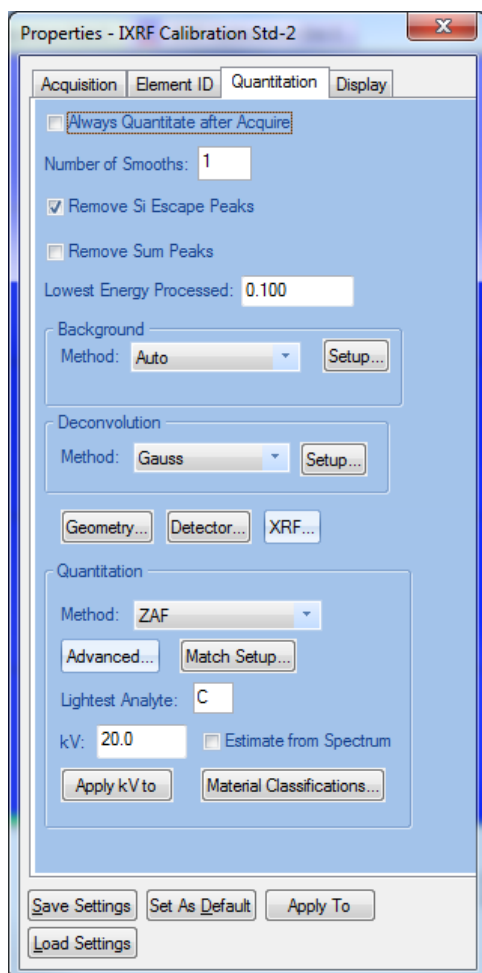

Automatic element identification can be performed prior to quantitation. To activate this, select the **Perform Before Analysis** option on the **Element ID** tab of the spectrum properties. Otherwise a manual element ID is necessary.

Quantitation can be performed automatically at the end of spectrum acquisition. To enable this option select **Always Quantify after Acquire**.

Smoothing of the spectrum is recommended as a first step in spectral processing. This performs a Gaussian (1:2:1) smooth of each channel in the spectrum, for the specified number of times. A value of 2 is recommended for **Number of Smooths**. For noisy spectra, larger values can be specified. For spectra with good statistics this step can be left out.

It is also recommended that Si Escape peaks be removed. To enable this, select **Remove Si Escape Peaks**. This method accurately removes the escape peaks from the spectrum, and adds the equivalent “original” x-ray event at the parent peak’s energy.


Remove Sum Peaks is only recommended for spectra where a high deadtime was present. It is a relatively time-consuming process and is not normally required if the deadtime is maintained below about 25%, except for low-energy (< 1keV) x-rays, where the pulse pileup discriminator is not effective, and even modest total count rates can result in peak pileup (sum peaks). This correction is not as accurate as the escape peak removal, and may

leave some residual sum peaks in the spectrum.

Background removal is typically the next spectrum-processing step. The most commonly used **Background Method** is automatic. Other background removal methods are described later in this chapter. The automatic method determines the background using a proprietary technique and then subtracts it from the spectrum. Although the exact details of the automatic background removal method are proprietary, the method is based on general signal-processing techniques that seek to distinguish fast-changing regions of the spectrum (i.e., peaks) from slowly changing regions (i.e., background). This is relatively simple for large peaks on small and flat backgrounds, but often the situation is not that simple. For example, in electron-beam microanalysis (EDS) there are regions of the background that have relatively high curvature, and there are often small noisy peaks superimposed on high backgrounds. The background curvature arises from several effects, including the deceleration effects of electrons in bulk solids, which produce the characteristic bremsstrahlung x-ray continuum, whose shape depends on the sample mean atomic number and the incident electron energy (microscope voltage, in kV). Superimposed upon this continuum are the absorption edges of both elements in the sample, and in the detector and window. The latter result in the steep low-energy fall off typical in most EDS spectra. These absorption edges are not visible as discrete “steps” in the spectrum, because they are convoluted with the detector response function, which results in the smearing of these steps. The basis of the automatic background, therefore, is to “filter” the spectrum in such a way as to remove the sharper peaks, leaves the smooth background, which is subsequently subtracting from the original spectrum.

Automatic Background Setup

Clicking on the **Setup** button in the Background section displays a panel similar to the following.

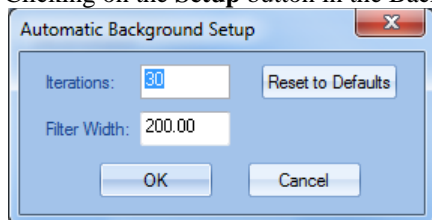

The automatic background setup parameter **Filter Width** controls this filter width that distinguishes the peaks – a larger width parameter would be more suitable for wider peaks. **Iterations** controls the number of repeated operations – too low a number may result in an over estimate of the background.

Reset to Defaults will restore the values of Iterations and Filter Width to factory settings.

After the preliminary spectrum processing is complete, the net peak intensities must be calculated. In the software this step is referred to as **Deconvolution**, because of the need to correct for peak overlaps. Two methods are provided for “deconvolution:” Gaussian and Integral. Gaussian is the most common method. This method fits theoretical Gaussian shaped peaks for each specified line in the spectrum, which takes into account peak overlaps such as Ti K α with Ba L α . A complete discussion of Gaussian deconvolution is given later in this chapter. The Integral method of “deconvolution” merely calculates the sum of the counts in the peak regions of interest (ROIs) in the spectrum. This method works well if there are no peak overlaps in the spectrum. However, since the Gaussian method works well in all cases, it is preferred.

Lowest Energy Processed is used by Background removal and Deconvolution to limit these processes to spectral data above a given energy. **Lightest Analyte** is used by Deconvolution and Quantitation to limit processing of spectral data in these steps to elements with higher Z than a given element. Elements below the given Z are processed using any stoichiometric information given in the components for the quantitation.

After deconvolution, the **Quantitation** is performed (e.g., ZAF, Match), which produces the composition analysis of the spectrum. Select a method from the Quantitation **Method** list. For standardless ZAF analysis, no further setup is required. For ZAF with standards or Match analysis, an additional setup and/or calibration step is required. These methods are discussed in separate chapters in this manual.

The output of the quantitation is displayed typically as element concentrations, however the composition can also be reported using stoichiometric compounds (e.g., oxide or carbonate). Stoichiometry is discussed later in this chapter.


The **Excitation kV** is displayed and can be modified. It can also be **estimated** from the background in the spectrum. The Duane-Hunt method is used to estimate the kV if this is selected. It can be especially useful if a sample is charging. For charging samples, the kV of the microscope may be considerably higher than the effective kV on the sample.

Apply kV to is used to change the kV of other opened spectra to the Excitation kV. This can be useful if several opened spectra need to the same kV modification.


Material Classifications can be applied to the spectrum after quantitation. This is described in section 4.16.

4.10.2 Using Stoichiometry (Oxides, etc)

If the desired output is to use the stoichiometry formulae for the analysis of the sample, you must enter the compound stoichiometries prior to the analysis. This is done in the **Advanced** dialog for Quantitation. To do this, access the Analysis Settings as described earlier in this chapter, and click on the **Advanced** button in the Quantitation section of the dialog.

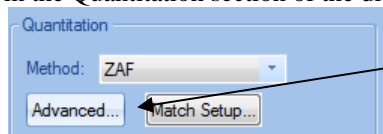

A dialog similar to the following will appear.

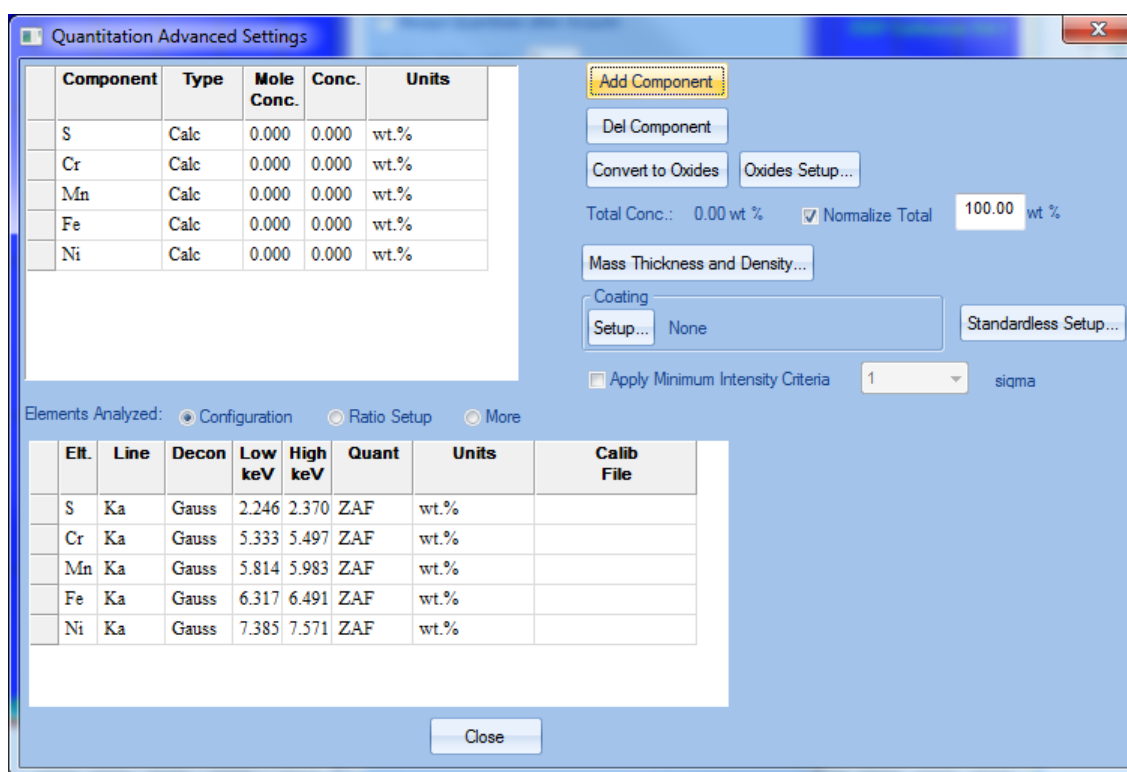

The stoichiometry of the sample is entered in the table at the top of the dialog. Notice that the table shows the elements in a column labeled **Component**. It is in this column that you enter the stoichiometry. For example, if you wish to calculate Mn as an oxide, change the text in the column for Mn from “Mn” to “MnO2.” Each of the elements in the table can be changed to oxides, if desired. As another example, “Fe” could be entered as “Fe2O3.” Some components must be entered with a space between single-character elements in order to avoid ambiguity. An example of this is “CaC O3.” In this case, if a space had not been used between “C” and “O”, it would have been assumed to be “Co” (cobalt). Care should be taken in entering components, to avoid such ambiguous entries.

In the above examples of components, if O was not already on the element list, it would have been added automatically. Please check to ensure that the deconvolution and quantitation parameters for any added elements analyzed (e.g. C, O), are correct. For light-element detectors, these low-energy peaks can be analyzed, and it is important that the deconvolution and quantitation parameters are set properly. Elements that are below the **Lowest Z Analyzed** (see **Quantitation** tab) must be determined by stoichiometry. To change the deconvolution, click on the **Decon** method for the element in the **Elements Analyzed** table.

Then select the desired deconvolution method. Do the same for the quantitation by clicking on the **Quant** for the element and selecting the desired quantitative method.

For an easier method of dealing with oxides, refer to the section 4.10.2.1 below.

A **Type** can be set for each component. These are:

- **Calc.** This is the most common type of component (default). This kind of component has its concentration calculated directly from the net peak intensities.
- **Fixed.** These types of components have a pre-determined concentration. The concentration is entered in the Conc column. During quantitation, these component concentrations are fixed. This can be useful if part of the composition of the sample is known (e.g., H₂O in CaSO₄ 2H₂O).
- **Diff.** This type of component assigns all of the remaining composition of the analysis to this component. The total composition is the value specified in the **Normalize Total** (default is 100%), even though normalization cannot be done. This type of component can only be used with ZAF with standards or Match. There can only be one diff(ference) component in the table, and normalization cannot be used.


Once the components have been entered, click the Close button to complete the editing of the stoichiometry information.

Display and printing of the Component calculations is discussed in the section on Customizing Report Output. By default, only element calculations are displayed and printed. These settings can be modified.

At this time you may wish to save these Analysis Settings for use in the future. Use the **Save Settings** option of the spectrum Properties to store these settings.

4.10.2.1 Convert Elements to Oxides

A convenient method is provided to convert elements automatically into oxides. Clicking on **Convert to Oxides** will automatically convert the elements to their defined oxide forms. Pressing this button will display a panel similar to the following.

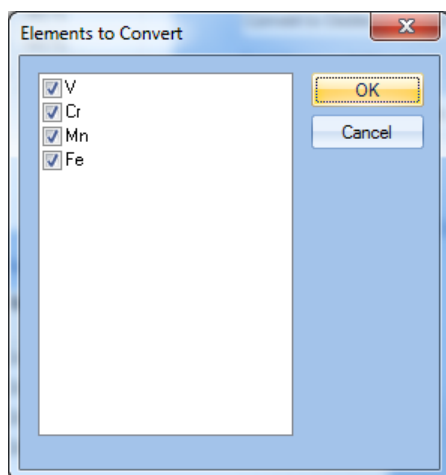


Select the elements that you wish to have converted to oxides and click OK. The elements will be converted to the default oxide forms. These default oxides are defined by clicking on the **Define Oxides** button. This is described below.

4.10.2.2 Setup Oxides Panel

Use this panel to enter different oxides for each element. Type into the Oxide column to change the oxide for an element. The Oxide is restricted to the element + oxygen.


The **Reset** selects the default oxides for the selected element. The **Reset All** button restores all elements to their default settings.

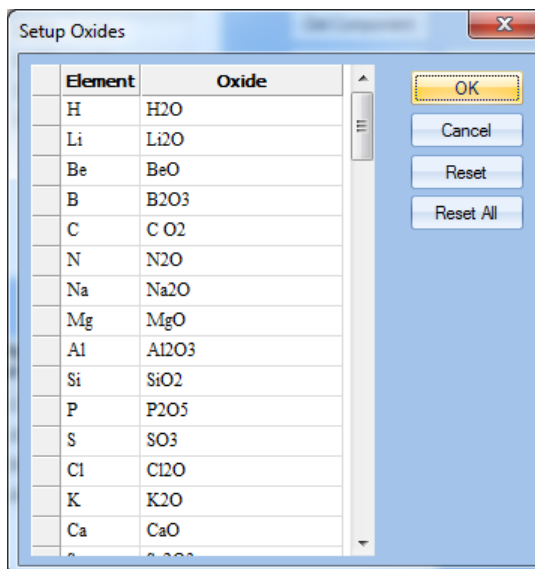

4.10.3 Minimum Intensity Criteria


Minimum Intensity criteria can be used to eliminate those elements from the quantitation whose intensity is less than a given number of standard deviations of the error in the intensity. This can be useful when the presence of an element is not known prior to quantitation. This is especially useful when standardless ZAF corrections are being used.

 This option is found on the **Advanced** quantitation panel. From the spectrum **Properties** panel, click on the **Quantitation** tab, then click on the **Advanced** button. On the Advanced settings panel select Apply Minimum Intensity Criteria, as shown below.




After the deconvolution processing, the intensity for each element will be tested. Elements whose intensity is less than the allowable value will not be included in the quantitative analysis.

 4.10.4 Sample Coating and Thickness.



Provision for including a sample coating is provided. This can be useful in improving ZAF quantitation. To define the sample coating, select Setup in the Coating section of the Advanced Quantitation settings of a spectrum. A panel similar to the following will appear.

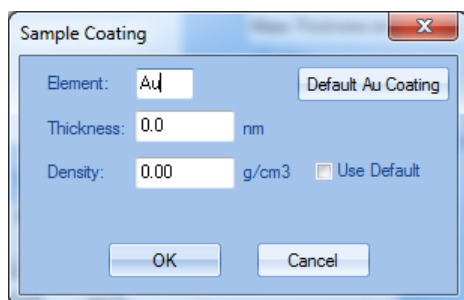


The coating **element** can be entered, or a **default Au coating** can be used (Au 20nm thick). The density of the coating can be entered, or the **Use Default** option can be selected to always set the density to an internally generated value.

This coating information, once entered, will be used for the next ZAF analysis of the spectrum.

4.10.5 Customizing Report Output


The displayed and printed output from quantitative analysis can be customized. This is done with the **Display** tab of the Spectrum Properties. To access this, select **Properties** from the menu and then click on the **Display** tab. A dialog similar to the following will appear:

Mass Thickness and **Material Classification** control whether these values are displayed. Material Classification is discussed in a separate chapter in this manual. Selecting **Pie Chart** will enable display of a chart of the analysis. There are 3 primary tables of values which can be printed; **Components Table**, **Elements Table**, and **Conditions Table**. Clicking on these buttons displays the dialogs shown below, which allow you to select the values that you wish to display.

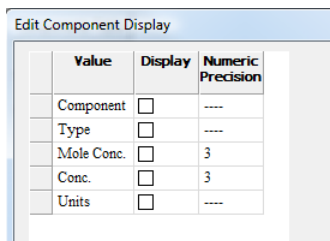


The **Components Table Setup** is normally used only if you wish to display the composition of the spectrum


in stoichiometric form. Normally only the elemental composition is displayed, as setup in the **Element Table Setup** below. When stoichiometry has been setup for the analysis, it is common to select **Component**, **Concentration**, and **Units**. **Numeric Precision** is used to adjust the output of values. For example, by default, concentration displays with 3 digits (i.e. 45.127). Changing the Numeric Precision to 1 for concentration will display 45.1.

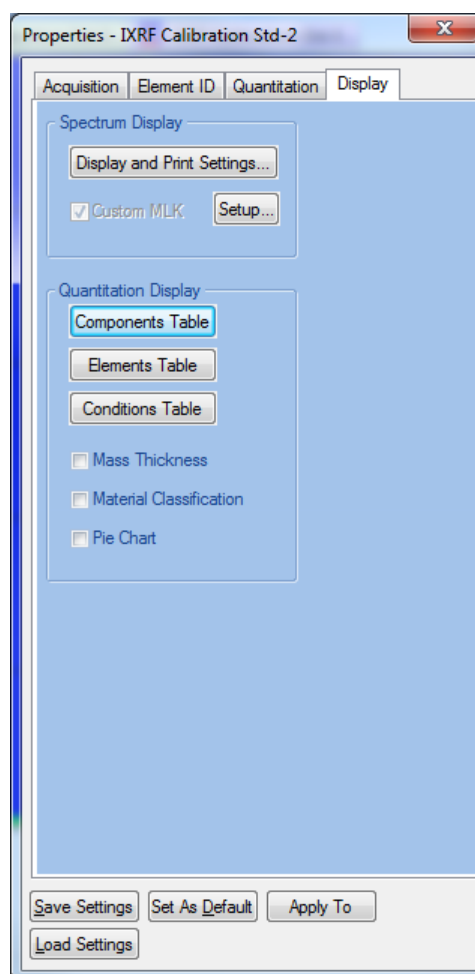

The **Mole Concentration** expresses the composition in terms of a molecular basis, where each "molecule" corresponds to the compound molecular formula. This is analogous to atomic concentration (see below).

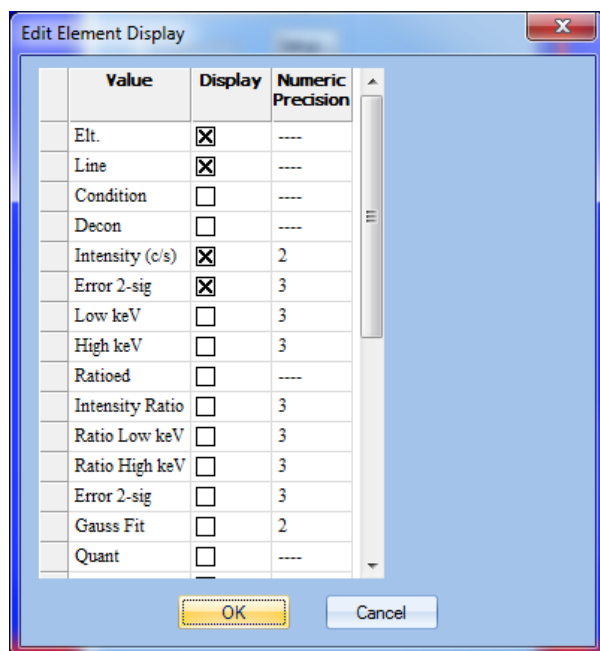

The **Element Table Setup** allows for selection of the values displayed for each of the elements. Typical selections are shown which display the element, line, intensity, concentration, and units for the concentration. Detailed reports can be displayed which contain estimates of background intensities, calculated MDL (minimum detection limits), etc. Note that Numeric Precision can also be modified, as described for the Component Table above.

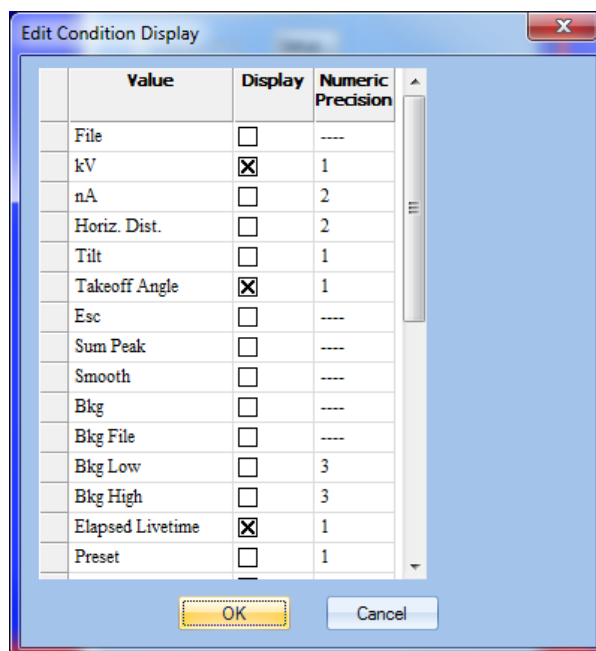


The **Condition Table Setup** allows for display of acquisition, processing, and match analysis values. For ZAF quantitation, kV is typically selected along with the spectrum processing parameters, and the livetime. For Match quantitation, Best Match Spectrum and ALL Matching Spectra are typically selected. Note that Numeric Precision can also be modified, as described for the Component Table above.

The **Quantitation Display** settings are stored in settings files, just as the **Quantitation** settings are stored. At this time you may wish to save these settings for use in the future. Use the **Save Settings** option of the spectrum Properties to store these settings.

4.10.6 Using the Manual Processing Tool

The Manual Processing Tool allows the user to step through the spectrum processing, viewing the effects of each step on the spectrum. To access the tool, select **Utility/Manual Processing** from the menu. A dialog similar the following will appear:

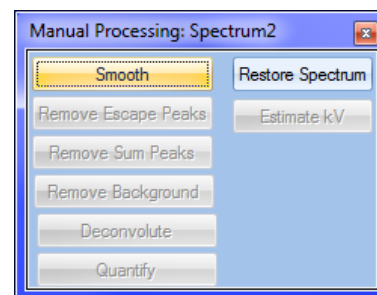


Each of the spectrum processing steps is assigned to a button on the left side of the dialog. To step through the spectrum processing, click on the buttons as they are enabled. Only buttons that are enabled (not grayed out) are active. In the example shown below, only **Smooth**, **Restore Spectrum** and **Estimate kV** are enabled. All other buttons are disabled. Clicking on the **Smooth** button will perform that step and display the modified spectrum. After clicking on the **Smooth** button, the next processing button will be enabled and the **Smooth** button will be disabled. In most cases this will be the **Remove Escape Peaks** button. Only the steps that have been selected on the Quantitation tab of the Spectrum Properties will be allowed. For example, the Sum Peak removal may not be selected. In this case, the button for Remove Sum Peaks will not be enabled after Remove Escape Peaks. Instead it will be the Remove Background button.

4.10.7 Background Modeling


As an alternative to the automatic background removal, the background can be removed from a spectrum by “modeling” the background from specific regions of the spectrum that contain only background (no peaks). These regions of the spectrum are selected by the user, and can be stored in a file for use in processing the background of other spectra.

To access background modeling; select **Utility/Model Background...** from the menu.

A dialog similar to the following will appear.

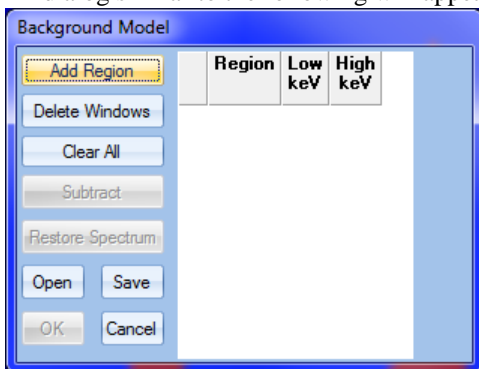


In modeling a background, the spectrum is broken up into discrete regions within which a linear or quadratic curve fit is done to model the background in that region. Painting one or more windows on the spectrum creates a region in the background. Use the spectrum window painting to define a region. One would typically do this from left to right

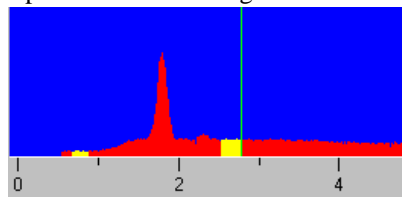


in the spectrum, starting with a low-energy region. If you are

unfamiliar with painting windows on the spectrum, refer to the section on window painting in the chapter Working With Spectra. This is an example of a region that has three windows painted.


After painting the windows, press the **Add Region** button. This will insert the painted windows into the list of windows. A polynomial will be fitted to all the window channels within this region, resulting in a model of the background.

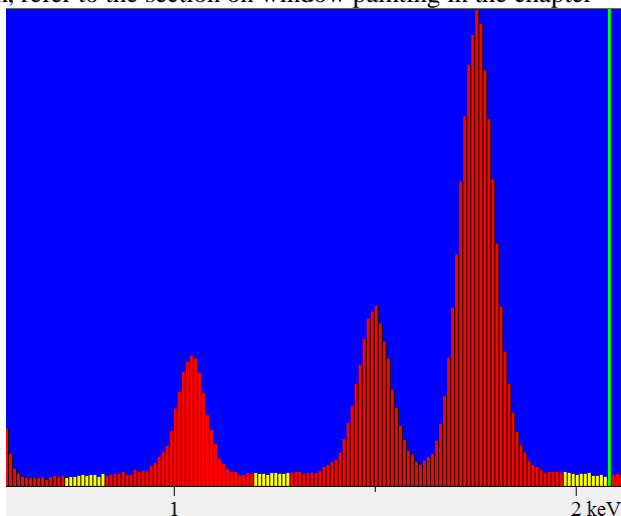


Below is the result after pressing the **Add Region** button. The background has been fit between the windows painted, and these windows have been added to the list as Region 0. There are 3 windows in this region, therefore a quadratic will be fit to the region. The energies (in keV) of each of the painted windows of the region are displayed in the table as the columns labeled Low and High.

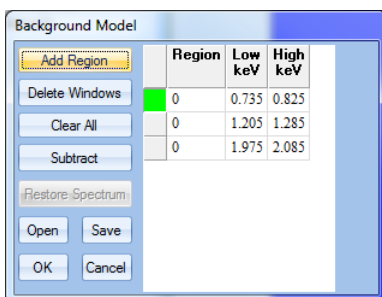

Another background region can be defined and added to the model by repeating the above steps of painting background windows and pressing **Add Region**. This is an example of this. A new region has been added just below the previous region. This new region is overlapped on the previous region. This overlapping will ensure a continuous and smooth background model.


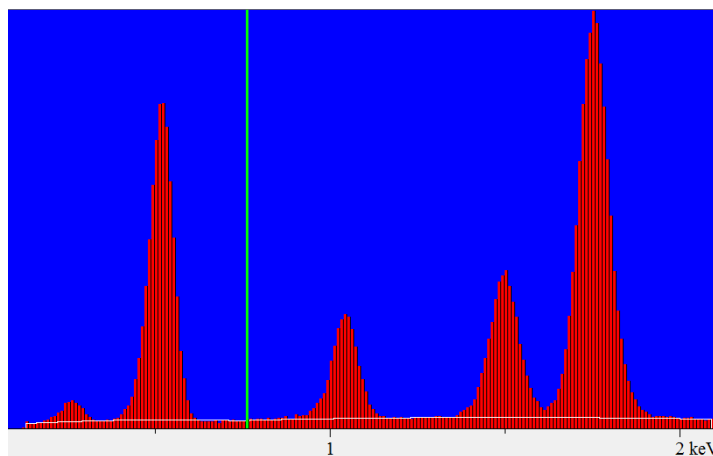


Here is the result after pressing the **Add Region** button. Notice that there are now two regions in the list:

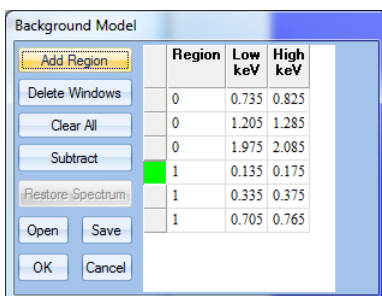

This process can be repeated until a complete model of the background has been made (for the whole spectrum).

Now you can save the model (as a *.win file). This can then be used to specify the background model for Quantitation. To do this, select the Background Method as Model on the spectrum Properties Quantitation tab, as shown. Then click on the Setup button.

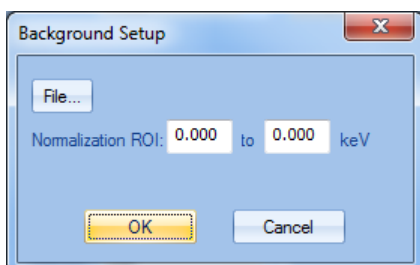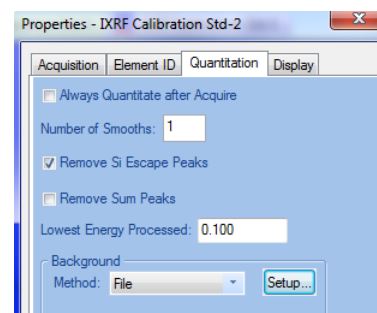

Click on the **File** button and select the model file.


4.10.8 Background File

The Background File method uses a stored spectrum file as a means of estimating and removing the background. This spectrum file should have the same general shape as the background in the sample spectrum, which implies that the sample should be similar in composition, and the excitation kV should be the same. Since the stored spectrum could have peaks as well as background, the technique can also be used as a peak “stripping” method.

Prior to subtracting the background, the stored spectrum should be normalized to the spectrum. A region of interest (ROI) in the spectrum must be specified for normalization in the Quantitation settings. Values of “0” for the low and high channels of the Normalization ROI will normalize using the complete spectrum. To the right is an example of Background File used, normalizing to the whole spectrum.

When used to strip a peak (or peaks), with or without a background present, specify an ROI that defines that peak.

Click on the **Setup** button to setup the background file. A panel similar to the following will appear.


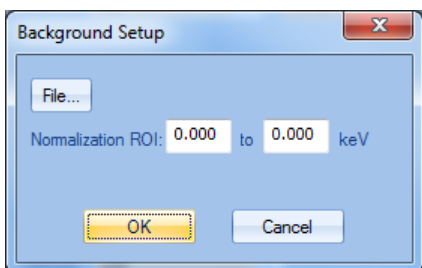



Click on the **File** button to select the file. Enter the **Normalization ROI** as described above.

4.10.9 Selection of Element Analysis Lines

When elements are added to the element list for analysis, a specific line must be selected, which is to be used for quantitative analysis. It is this line whose net peak intensity is calculated and used in subsequent analysis (e.g., ZAF, Match). The user can alter the default selection of lines. This can be done in two ways. First, the default line list can be modified. To do this, select Setup from the **Deconvolution** section of the **Quantitation** tab of the **Spectrum Properties**, as shown here. A dialog similar to the adjacent will appear.

Click on the Element Lines button. A dialog similar to the following will appear.

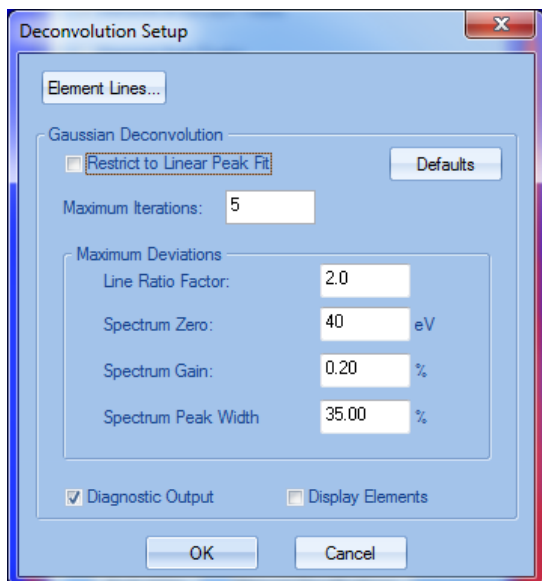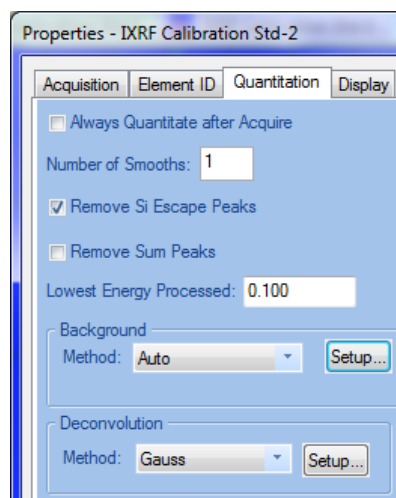

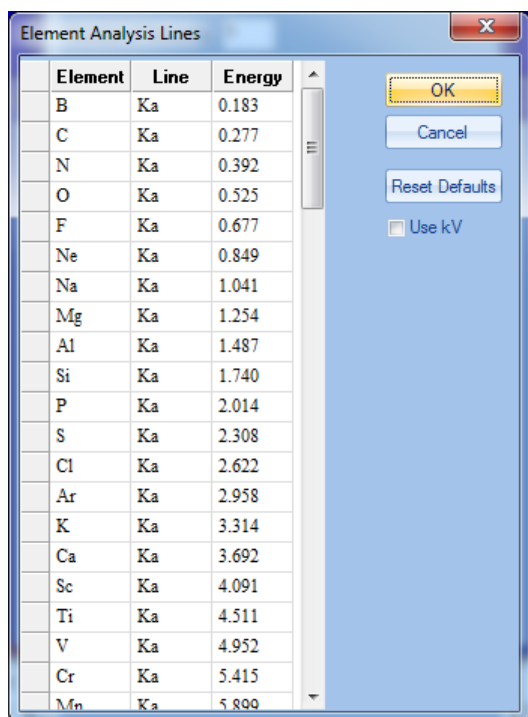

This dialog is used to determine the default lines that will be selected for elements added to the element list. In this table, there are two methods that can be used to select the element line.


- Use kV. This method determines the best line automatically from the kV of the spectrum. The user has no choice for overriding the automatic selection. To use this method select the **Use kV** check box. Automatic line selection uses the kV of the microscope. The line selected is the line whose absorption edge is below the kV.
- From the Table. This method takes the line from the table (shown on the left side of the dialog above). To use this method *unselect* **Use kV**.

When using the Table method, you can select the lines individually for each element. If, for example, you wish to use the $M\alpha$ line for W analysis (instead of the default, which is $L\alpha$) do the following:


Element	Line	Energy
Ta	La	8.146
W	La	8.398

Find W in the Table. Select Ma from the list of lines.

The second method to select the line for analysis, works on an individual spectrum, or for a specific Settings File. This method uses the Advanced dialog on the Quantitation tab of the Spectrum Properties, as shown here:

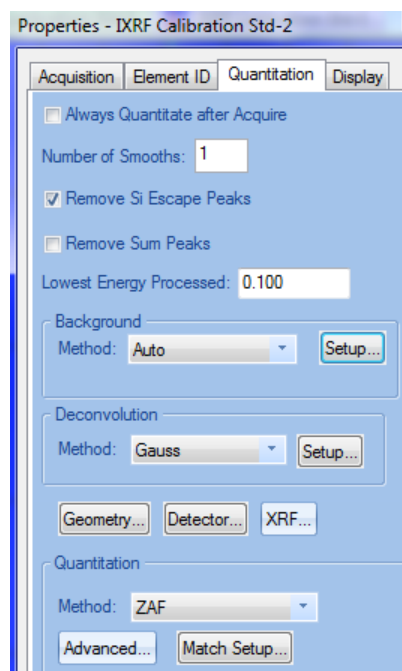

Click on the **Advanced** button in the Quantitation section and a dialog similar to the following will appear:

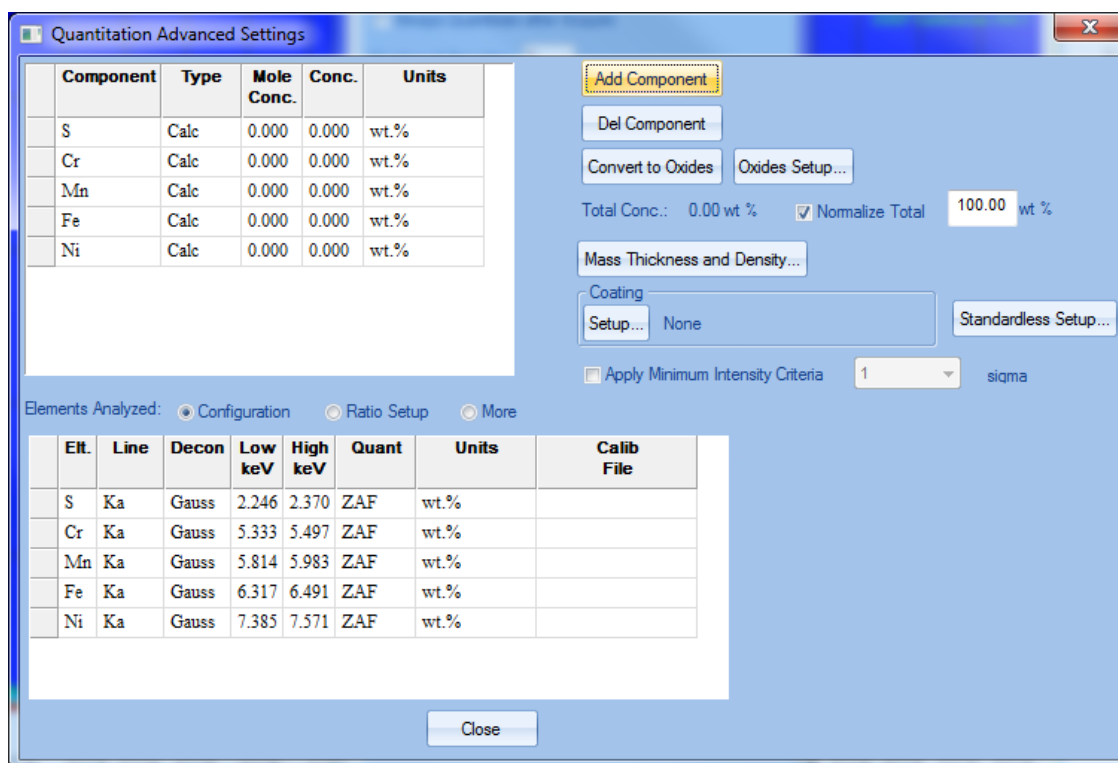

Select a line from the list of lines for the element (in the following example, Cr), in the lower of the two tables.

Elt.	Line	Decon.	Low keV
Cr	Ka	Gauss	5.350
Mn	Ka	Gauss	5.832
Fe	Kb	Gauss	6.334
Co	La	Gauss	6.859
Ni	Lb	Gauss	7.404

After selecting the lines desired for the analysis, these settings can be saved by selecting **Save Settings** on the **Spectrum Properties**.

Note: these settings revert to the default lines if the element is removed from the element list and then subsequently added. To re-apply the settings to a spectrum, use the Load Settings button.

4.10.10 Gaussian Deconvolution

Gaussian deconvolution fits gaussian-shaped peaks to the spectrum as a means of determining net peak intensities from the spectrum. All peaks for all relevant lines, for all elements on the element list, are fit to the spectrum. The kV of the spectrum will limit which lines (K, L, M) are actually used. For example, if the spectrum was acquired at 5 kV and Fe is on the element list, only the L-series lines for Fe will be fit, because the K-series lines for Fe are above 5 kV. More specifically, it is the line-series edge (e.g., K or L-III) that must be below the excitation kV. Usually a margin (about 1 kV) is added to this; otherwise the ionization probability would be too low to be useful. Thus it is very important that the kV be entered correctly for the spectrum. If you are unsure of the kV of the spectrum, you can view it by selecting **Spectrum Info** from the **View** menu. Another check on the kV is to observe the high end of the spectrum (background), which should end just above the kV value (because of detector broadening).


Two kinds of fits are provided

- **Restrict to Linear Peak Fit.** This allows only the peak height to be adjusted during the fitting. Usually this kind of fit is adequate. It is, however, important that the spectrum energy calibration is correct and the FWHM be set correctly. Relative peak heights within a series (e.g., $K\alpha_1$, $K\alpha$, $K\beta_1$, $K\beta_2$ for the K-series) are taken from tabulated values and are not allowed to vary during the fitting. This means that if there are large absorption or enhancement effects in the sample, this kind of fit will not perform as well as the non-linear fit.
- **Non-Linear Fit.** This fits the peak heights, positions, and widths to the spectrum. This is a non-linear fitting process, because these variables are not directly solvable by standard linear least-squares fitting. Standard non-linear algorithms are employed (such as the Marquardt-Levenberg method), which allow the three parameters for each peak to be adjusted independently. However, in order to make this method work well for x-ray spectra, it is mandatory to include constraints in the fitting process. The obvious constraints are: (1) the relative line ratios for each line series that is fit, (2) the expected allowable deviations of peak widths, and (3) the expected or allowable deviations of peak positions. The relative line ratios are reasonably well known, but they can change depending upon the following factors: (a) the overvoltage (kV), (b) the sample thickness and take-off angle, and (c) the composition of the sample. In the latter case, these may be absorption edges of other elements, between the major lines, that will cause some lines (i.e., the ones above the edge) to be preferentially absorbed. Therefore it is advantageous to allow these ratios to change, depending upon the sample spectrum. However, if the ratios were allowed to be completely ignored, non-linear fitting will often produce completely erroneous peak fitting, where the fitting error (χ^2) is small, but the solution is completely bogus (even negative peak heights may result). To avoid these kinds of solutions, we only allow the line ratios to change by certain factors (with respect to the most dominant line). The default factor is 2.0, which means, for example, that the $K\beta:K\alpha$ ratio could change up or down by a maximum of a factor of 2.0, from the default line ratio stored in the software. So, if the $K\beta:K\alpha$ ratio started at 0.1, the maximum allowed would be 0.2, and minimum would be 0.05. This is known as constrained fitting. Similar constraints are applied to the fitting of the peak widths and position (centroid) locations. X-ray peak resolutions are a well-known function of both the peak energy and the “system” resolution (typically for the Mn- $K\alpha$ peak). So, again, the fitted peak widths are constrained to conform to this equation, within certain limits. The default variation, for each peak, is 35%. For example, if the peak had an initial predicted resolution of 200 eV, the maximum allowable width, for this peak, would be 270 eV, and the minimum would be 130 eV. Similarly for the peak positions, there is a well-characterized equation that relates peak position (energy) to the spectrometer zero offset and gain (eV/channel). Both these are allowed to vary independently, but the calculated must be within both the values defined in the deconvolution setup (default zero = ± 40 eV, and default gain = $\pm 0.2\%$).

This technique is much slower than the linear method, especially when analyzing many elements, but it may be necessary for some samples.

To select the kind of Gaussian deconvolution, click on the **Setup** button in the **Deconvolution** area on the **Quantitation** tab of the **Spectrum Properties**, as shown to the right.

A dialog similar to the following will appear.

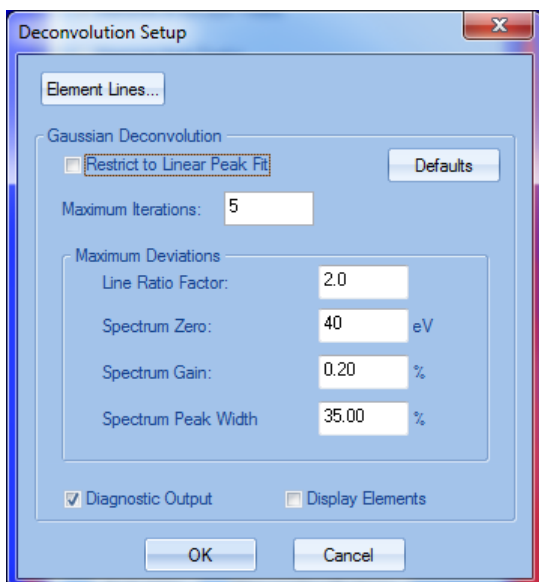

Selection of Restrict to Linear Peak Fit

determines which kind of Gaussian deconvolution is to be used.

Selecting **Diagnostic Output** will display the fit spectrum overlaid on spectrum. This can be useful in evaluating the quality of the deconvolution. When using the linear peak fitting, you can visually examine the fit to determine if the FWHM requires adjustment (if the fitted peaks are wider or narrower than the spectrum peaks), and also the energy calibration (where the fitted peak positions line up with the spectrum peaks). The system FWHM can be adjusted in the Acquisition tab of the spectrum properties. A value for

FWHM is stored for each pulse processor time constant in the system. The spectrum calibration can only be changed by recalibrating the electronics. The display can also be used to evaluate the merits of using the linear vs. the non-linear deconvolution on the spectrum by examining well how each of the methods fit the spectrum. And finally, if an element is missing in the element list, a spectrum peak that has not been fitted will appear in the spectrum but not in the fitted spectrum.

If **Restrict to Linear Peak Fit** is selected, no information in the Maximum Deviations frame needs to be adjusted.

If **Restrict to Linear Peak Fit** is not selected, the non-linear fitting will be performed. In this case there are several adjustments that can be made which will affect the non-linear fitting. These adjustments are:

Maximum Iterations

Maximum number of iterations for Non-Linear Gaussian deconvolution. Since this method is iterative, this parameter is used to limit the number of iterations. If the deconvolution does not converge after this number of iterations, the best-fit parameters from the last iteration are used.

Line Ratio Factor

The line ratios are allowed to change (by up to this factor) in order to improve the fit during the iterative portion of the Non-Linear Gaussian Deconvolution. For example, the $K\alpha_2$ line is usually about 50% of the $K\alpha_1$ parent line. In the linear fit the ratio of the $K\alpha_2 / K\alpha_1$ will be fixed to 0.5 (in this example). For the Non-Linear fit, assuming a factor of 2 for the Line Ratio Factor, this ratio will be allowed to vary from $0.5/2 = 0.25$ up to $0.5 * 2 = 1$ (i.e., same height as the parent $K\alpha_1$).


Spectrum Zero

The positions of the peaks are allowed to shift in order to improve the fit. This is the maximum shift (in eV) that is allowed.

Spectrum Gain

The gain (eV/channel) of the spectrum is allowed to change in order to improve the fit. This is the percent of change that is allowed.

Spectrum Peak Width

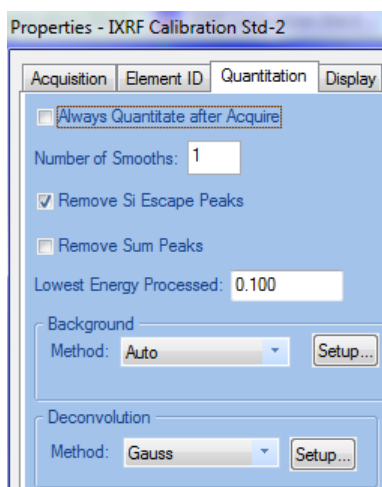

The width of each peak is allowed to change in order to improve the fit. This is the percent of change that is allowed. As an example, if the Mn-K α FWHM is 150 eV, and the Spectrum Peak Width maximum deviation is 50%, the width would be allowed to vary from $0.5 * 150 = 75$ to $1.5 * 150 = 225$ eV for Mn-K α .

4.11 Detector Geometry

The geometry of the EDS detector is critical information required for ZAF quantitation. It is important to have the correct information entered in the system in order to get good quantitation analysis. The set of geometry parameters describe the spatial relationship of the EDS detector with respect to the electron beam and the sample.

To setup the detector geometry, click on the Geometry Setup button on the spectrum Quantitation panel, as shown below.

For many detectors, there is a very simple set of parameters required for describing the geometry. These detectors are known as on-axis detectors. An on-axis detector is one in which the detector is not a "chisel nose." The setup of these detectors only requires entry of Tilt, Detector Axis Angle, and Azimuthal Angle. Refer to the section 4.11.1 for a description of these parameters.


For off-axis detectors, the full set of geometry parameters must be defined. Any information from the detector manufacturer regarding the geometry will be very useful in defining these parameters. Refer to section 4.11.2 for a description of these parameters.



The diagram below describes the geometry of the EDS detection system in an electron microscope. The geometry is conceived as a eucentric stage pivoting about the impact point of the electron beam on the sample.

Tilt1 and **Tilt2** are orthogonal axes of tilt, and **Theta** is the number of degrees of rotation. The **Azimuthal** angle is the degrees of rotation of the detector axis about the **Tilt 1** axis, and the **Elevation** is the angle between the sample plane and a line that intersects the center of the front of the detector. The **Detector Axis Angle** is the angle between the detector axis line and the horizontal plane.

The **Working Distances** (in mm) is the distance between the analysis point and the detector crystal. The **Horizontal Distance** is the horizontal distance between the front of the detector and the analysis point, and the **Working Distance** is the vertical distance between the pole piece and the analysis point, and the **Fixed Distance** is the vertical distance from the pole piece to the horizontal plane which intersects the center of the front of the detector. The vertical working distance (computed) is the difference of the last two measurements, and is the vertical distance from the front of the detector to the analysis position.

Derived from this geometry is the **Incidence Angle** of the electron beam with respect to the sample plane, and the **Take-Off Angle** of the analyzed x-ray beam, again with respect to the sample plane. **Alpha** is the angle between this line and the detector axis line. The **Elevation Angle** is the angle between the line through the detector axis and the horizontal plane.

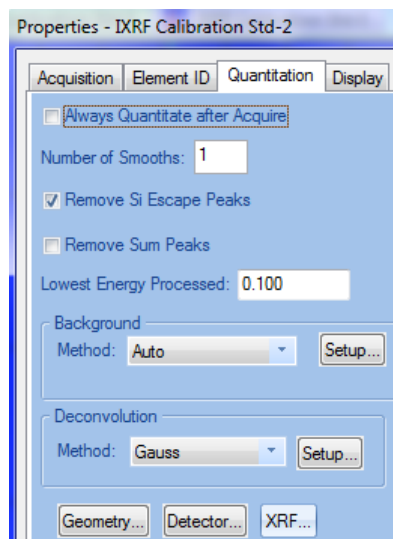

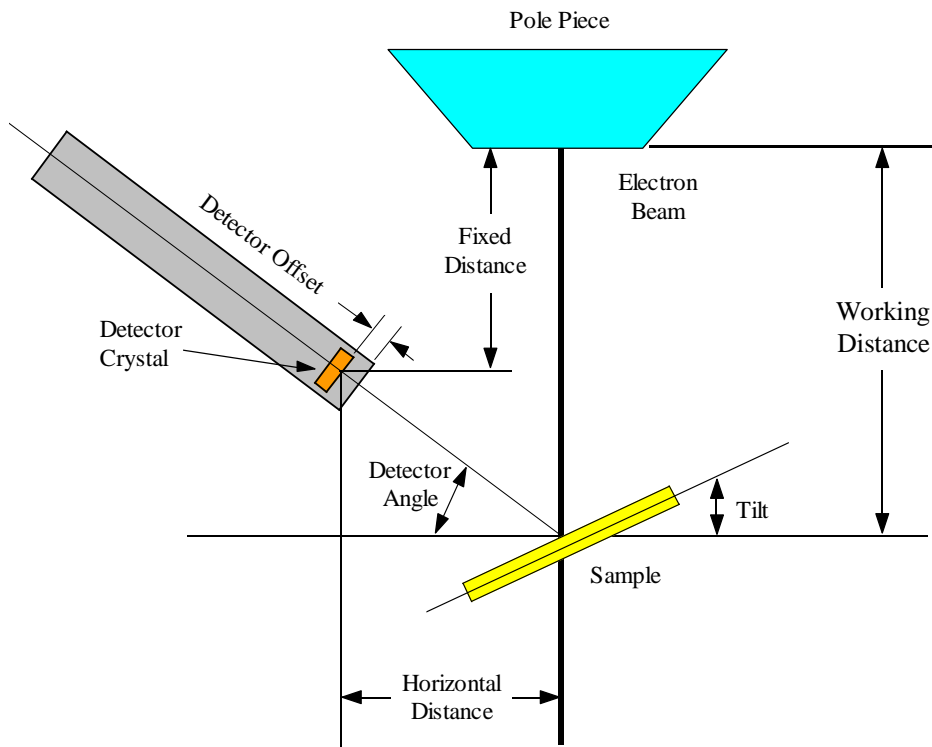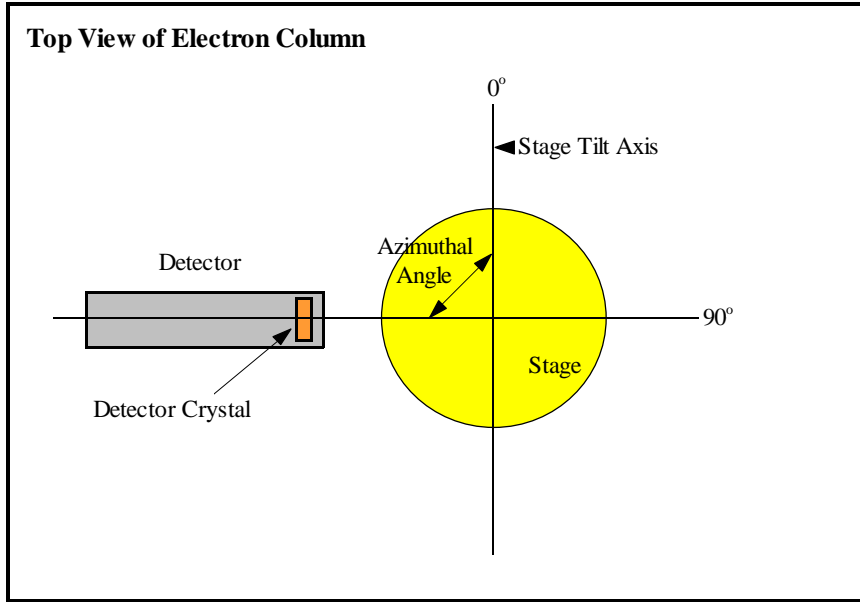

18

4.11.1 On-Axis Detector Setup

This panel is used to define the detector geometry for systems that have an on-axis detector. For a complete discussion of these parameters, including diagrams of the relationships of the parameters, refer to the section 4.11 above.

Tilt1**Tilt2**

These are the angle between the sample plane and the horizontal.

Detector Axis Angle

This is the angle between the axis normal to the detector and the horizontal. Click on the **Change...** button to modify this parameter.

Azimuthal Angle

This is the angle between a horizontal projection of the sample-detector axis and a horizontal line defining the direction of tilt.. Click on the **Change...** button to modify this parameter.

Incidence Angle


This is the angle of the electron beam with respect to the sample plane. This is computed by the software.

Take-off Angle

This is the angle of the analyzed x-ray beam with respect to the sample plane. This is computed by the software.

Detector is on- axis

This allows for changing the detector from on-axis to off-axis. For a description of these terms refer to Detector Geometry.

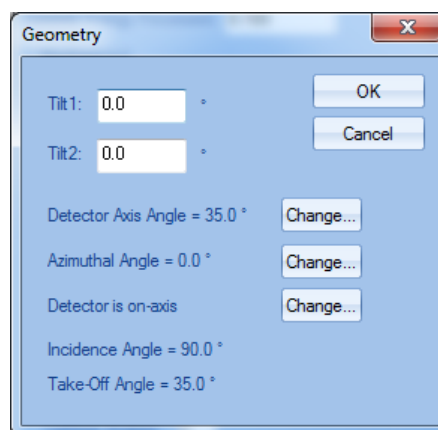

4.11.2 Off-Axis Detector Geometry

This panel is used to define the detector geometry for systems that do not have an on-axis detector. This panel allows you to set all parameters that describe the geometry. For a complete discussion of these parameters, including diagrams of the relationships of the parameters, refer to section 4.11.

Horizontal Distance

This is the distance between the sample and the face of the detector window.

Working Distance

This is the distance between the bottom of the objective lens pole piece and the sample.

Fixed Distance

This is the vertical distance between the bottom of the pole piece and the center of the detector surface.

Tilt1**Tilt2**

These are the angle between the sample plane and the horizontal.

Azimuthal Angle

This is the angle between a horizontal projection of the sample-detector axis and a horizontal line defining the direction of tilt.

Detector Axis Angle


This is the angle between the axis normal to the detector and the horizontal.

Detector Offset

This is the distance between the detector window and the detector crystal, measured along the axis of the detector.

Detector Active Area

This is the active area of the detector in square millimeters.

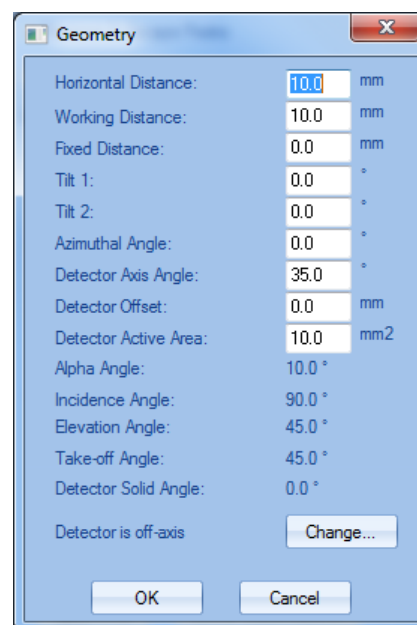Alpha Angle

This is the angle between the Take-Off angle and the detector axis. This parameter is calculated by the software.

Incidence Angle

This is the angle of the electron beam with respect to the sample plane. This parameter is calculated by the software.

Elevation Angle

This is the angle between the detector axis and the horizontal plane. This parameter is calculated by the software.

Take-off Angle

This is the angle of the analyzed x-ray beam with respect to the sample plane. This parameter is calculated by the software.

Detector Solid Angle

This is the angle subtended by the detector with the sample at the origin. It is given in steradians. This parameter is calculated by the software.

Detector is off- axis

This allows for changing the detector from off-axis to on-axis. For a description of these terms refer to section 4.11 above.

4.12 Detector Setup

The panel has two sections, Detector and Window Parameters. The **Reset to Defaults** buttons in each of these sections will set the default values for the detector based upon the setting for Type in the Window Parameters section. Both buttons must be pressed to complete the setup of defaults for a given type. It is important that these parameters be set correctly to obtain good quality standardless analysis, especially for light elements in the sample, or any element with line energies below about 1-2 keV. This information should have been provided by your detector supplier, who is the best source for this information.

4.12.1 Window Parameters

Type

This defines the type of window. The selections available include common windows from the major manufactures for new, as well as older, detectors. This list is updated as new information is made

available. If your window type is not listed here, please contact us for information on a compatible window material. Many windows are complex structures with added grids and coatings (see below).

Window Thickness

This is the detector window thickness (in microns).

Window Coating Material

Many windows are coated with a thin layer of some element to prevent light from entering the detector, which would result in large amounts of noise in the spectrum (and poor resolution). For Be windows, no coating is required, but ultra-thin windows almost all require some kind of exterior (& sometimes interior) coating. The default window-coating element is aluminum. If no coating exists, just set the thickness to zero, and the window material (element) will be ignored.

Window Coating Thickness

This is the thickness (in nanometers) of the window coating.

Carbon Contamination

Often, after extensive use, or a leaky vacuum system, diffusion pump oil may be deposited on detector windows, as this is often the coldest part of the vacuum system. The carbon contamination parameter is an estimate of the thickness of this oily contamination layer, to help obtain reasonable standardless analysis under these circumstances. This oily layer should be removed (carefully!) by a qualified service technician.

Support Grid Thickness

Many windows are too thin to be supported across the width of the detector opening. In these cases, a grid is used under the window to provide the support with a pressure differential from air to vacuum. The grid material is usually implicitly specified as part of the window type (see above), and may or may not be the same as the window material. The grids are of various designs, which can affect the absorption of x rays on their way to the detector crystal. Input the correct value of the support grid thickness (in microns), as this is used by standardless analysis. Windows that use grids include the Quantum and Moxtek windows. Certain windows use 2 grids (e.g., the MET4 and Moxtek AP3.3 windows) – see further parameters described below for the second grid.

Grid Area Fraction

This is the fractional area (0 – 1.0) of a grid (see above) used to support the detector window. This defines the fraction of x rays that pass through the grid verses those that do not.

Grid 2 Element

This is the element used for a second grid that is employed by some window assemblies. The MET4 window uses a W second grid. The Moxtek window uses a second grid made from BH, but this is NOT user definable – it is defined internally by the software.

Grid 2 Thickness

This is the thickness of the second grid (in microns) used by some windows (see above).

Grid 2 Area Fraction

This is the fractional area (0 – 1.0) of the second grid (see above) used by some windows.

Reset to Defaults

Once a window **Type** has been selected, using this button will reset all other window parameters to the default values for this Type. This is useful in getting a reasonable set of starting parameters for the window, although you should refer to the parameters supplied by your detector vendor (see above).

4.12.2 Detector Parameters

Detector Type

This is the type of detector installed on the system. There are three types: **User Defined**, **SDD**, and **Si(Li)**. The **SDD** and **Si(Li)** selections are pre-defined “typical” detector settings. **User Defined** does not have any definite settings; the user must enter all pertinent settings.

Detector Element

This is the material (element) from which the detector crystal is made. It is normally Si for the standard Si{Li} detectors (the Li concentration is negligible).

Detector Area

This is the active area (in square mm) of the detector crystal. Note that the active area maybe less than the area of the whole crystal, which is usually collimated to only accept x rays in the center area, where the peak resolution is usually the best.

Detector Collimator

This is the diameter (in mm) of the collimator placed in front of the detector crystal (as described above).

Detector Thickness

This is the average “effective” thickness (in mm) of the detector crystal, within the active area. For Si{Li} detectors, this value is almost the same as the actual physical thickness, but for some thin detectors (e.g., Si drift or pin-diode detectors) it may be significantly less, because a significant fraction of the detector is not fully active.

Dead Layer Thickness

During the processing of detectors (e.g., the manufacture of Si{Li} detectors by the so-called Li-drifting process), there is often a thin layer at the front of the detector crystal that is inactive. This inactive, or “dead,” layer cannot generate the usual charge cloud from the absorption of an x ray, and effectively acts as an x-ray filter to incoming x rays as a result. Again it is important to enter this dead-layer thickness (in microns), as it can affect the quality of standardless analysis. This value should be provided by the detector vendor and will vary depending upon the quality of the detector crystal manufacturing. Often this layer may increase slightly with time (years) as the Li ions slowly drift away from the front surface of the crystal.

Contact Material

This is the material (specified as an element) that is used for the front contact of the high voltage bias connection to the detector crystal. Sometimes this material is proprietary to the detector manufacturer. It used to be always a gold contact, but sometimes other elements, such as Ni, are used nowadays.

Contact Thickness

This is the thickness (in nanometers) of the front-contact layer.

Ice Contamination

As with the deposition of oil on some windows (see above), there is sometimes a buildup of ice on the front surface of the detector crystal. This is particularly the case if the detector is used in the windowless mode (not very common these days), or there is a small pinhole leak in the window material. Again, the detector crystal is often the coldest surface available, causing condensation of any water vapor present in the system. Sometimes this water vapor comes from the detector cryostat itself, as it starts to outgas, if there is a materials problem. In any case, a significant ice coating is usually a sign that the detector is in need of repair. If the ice is observed on the outside of the detector housing and/or window, then this almost certainly means that a detector repair is necessary. An estimate of the ice thickness can be entered (in nanometers) as a method for compensating for the absorption of x rays by the ice layer, to improve the accuracy of standardless analysis.

4.13 ZAF Quantitative Analysis using Standards

4.13.1 Standardless vs. Standards

ZAF quantitative analysis can be used with or without standards. The primary reason for using standards is to improve the accuracy of the composition analysis of the sample. Standardless analysis can achieve typical errors in concentration of less than 10% relative, but they can be as high as 50%. When calibrating with standards, errors of less than 5% relative are typical. There will be occasions, especially when mixing lines from different series (e.g., K and L), where much improvement can be made in the analysis by using standards. The downside to calibrating with standards is that the beam current should, ideally, be maintained at a constant level, for all standards and unknowns, something that is easy to achieve with many SEMs. If results are normalized to 100%, then the beam current for the unknown samples can vary, but still the beam current for all the standards must be the same. The geometry must also be the same (e.g., same working distance). Therefore, the user should make the trade-off between simplicity of use vs. potential accuracy of analysis.

4.13.2 Calibrations

ZAF quantitation using good quality pure-element, or “type” standards, will often yield more accurate results, but the user must take more precautions. As in any quantitative analysis, the quality of the standard is critical to getting reliable results. For SEM-EDS analysis, the surface condition is very important especially for light elements (i.e., low-energy x rays). At about 1 keV, the x-ray signals come from the top 1 micron of the sample, with a large fraction coming from the first tenth of a micron. Because of this surface sensitivity (that is even worse at lower energies), the specimens should be polished to a local flatness of < 0.1 micron (for x-ray energies at 10 keV, a 1-micron polish is sufficient). Of course, the specimen must be globally flat as well, over the complete surface area, but this can vary by several tens of microns without any serious problem. One of the advantages of ZAF (or other quantitative method) calibration, with standards, is that many of the primary fundamental x-ray parameters are eliminated from the calculations. In particular, the primary ionization effects and detector absorption factors are specifically eliminated. (The user should be aware that these values are still used in the software, for ZAF analysis, so one should not change them between calibration and quantitation). The reason this is done is so that “missing elements” can be analyzed by estimating their calibration coefficients from both adjacent elements in the periodic table, and from the use of these fundamental parameters).

Because many of these primary effects have some uncertainty, either from the basic physics knowledge or lack of knowledge about the experimental setup (e.g., detector parameters), the use of standards can eliminate many of these sources of error. Most ZAF techniques use pure-element standards, where the first step in the calculations involves the calculation of the k-ratio, i.e., the ratio of the element's intensity in the sample to that in the pure-element standard. This automatically removes many of the calculations used for standardless analysis. However, in the software, the calculations are done differently, so that any standard can be used. If available, there are many advantages in using a standard that is similar to the unknown sample. If all the elements are the same, a single “type” standard can be used to calibrate the system. In addition to compensating for the primary effects, described previously, these “type” standards can compensate for secondary inter-element uncertainties, as well as minor systematic errors in spectrum processing (e.g., background removal, and peak deconvolution). In addition to the normal modes of calibration, the software includes a powerful option to estimate calibration coefficients (the output from calibration) for elements that were not calibrated. These coefficients will be calculated “on-the-fly” for every element that was not previously calibrated. The software uses a mixture of fundamental-parameters calculations and knowledge about the coefficients of neighboring elements in the periodic table that have been calibrated for the same x-ray line (e.g., $K\alpha$).


The standards should be recalibrated routinely, at the same SEM settings as the unknown samples, to avoid errors from beam-current drift and detector/geometry variations. One method to “correct” for beam current drift is to normalize the composition to 100% (the same is done for standardless analysis). Normalization is selected on the **Quantitation** tab of the **Spectrum Properties**. All of the geometry setup is important for accurate quantitative analysis. For example, the tilt angle must be included into the geometry setup in order for the software to calculate the correct incidence and take-off angles. This is accomplished automatically when the tilt angle is entered in the Geometry setup on the Quantitation tab of the Spectrum Properties.

To use standards with ZAF the following must be done:

- Create a ZAF calibration file. This process is detailed later in this chapter.
- Select the calibration file in the **Elements Analyzed** table of the **Advanced** dialog selected from the **Quantitation** tab of the **Spectrum Properties**. Once selected, this will be saved in an Analysis Settings file for use in subsequent ZAF with standards analysis.

4.13.3 Creating a ZAF Calibration File

The ZAF calibration file contains the information (primarily calibration coefficients, and the critical analysis parameters) used by ZAF with standards for analysis. Acquiring a spectrum from a standard, and processing it with ZAF calibration, writes the information to the file. The steps are shown below and described in detail.

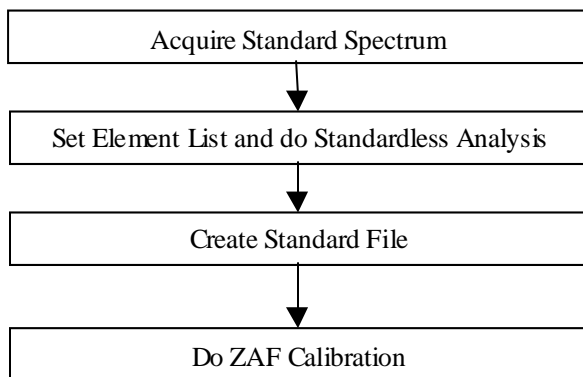

Acquire Standard Spectrum

With the standard in the SEM, acquire a spectrum. Note the excitation and geometry parameters.

Set Element List and do Standardless Analysis

The net peak intensities for the elements in the standard are needed for ZAF calibration. This is why we recommend performing a standardless analysis, as this is the easiest way to create the necessary data. Ensure that all elements to be calibrated are entered, and that the correct lines have been specified. On the Quantitation tab of the Spectrum Properties, ensure that the spectrum processing (Smoothing, Si Escape Peak Removal, Background Removal, and Deconvolution) is set properly.

To verify the analysis lines, click on the **Advanced** button on the **Quantitation** tab of the Spectrum Properties. A dialog similar to the following will appear:

Quantitation Advanced Settings

Component	Type	Mole Conc.	Conc.	Units
S	Calc	0.000	0.000	wt.%
Cr	Calc	0.000	0.000	wt.%
Mn	Calc	0.000	0.000	wt.%
Fe	Calc	0.000	0.000	wt.%
Ni	Calc	0.000	0.000	wt.%

Buttons: Add Component, Del Component, Convert to Oxides, Oxides Setup...

Total Conc.: 0.00 wt % ☒ Normalize Total 100.00 wt %

Mass Thickness and Density...

Coating Setup... None Standardless Setup...

☐ Apply Minimum Intensity Criteria 1 sigma


Elements Analyzed: ☒ Configuration ☐ Ratio Setup ☐ More

El.	Line	Decon	Low keV	High keV	Quant	Units	Calib File
S	Ka	Gauss	2.246	2.370	ZAF	wt.%	
Cr	Ka	Gauss	5.333	5.497	ZAF	wt.%	
Mn	Ka	Gauss	5.814	5.983	ZAF	wt.%	
Fe	Ka	Gauss	6.317	6.491	ZAF	wt.%	
Ni	Ka	Gauss	7.385	7.571	ZAF	wt.%	

Close

Strictly speaking, it is not necessary to perform the ZAF analysis – only the net peak intensities are required. To disable the ZAF analysis, you may change the **Quantitation Method** (on the Quantitation tab of the Spectrum properties) to **None**. Once the analysis settings have been checked, do a quantitative analysis on the spectrum.

Quantitative analysis can be performed by:

- Clicking on the ToolBar button 
- Selecting **Analyze** from the menu
- Setting the **Always Quantitate after Acquire** option on the Quantitation tab of the spectrum Properties. When acquisition of the spectrum has completed, the quantitative analysis will be performed automatically.

You may wish to save the Analysis Settings at this time, so that you can duplicate the quantitative analysis on future samples. This will ensure that the analysis of future samples will be consistent with this analysis of the standard. Select **Save Settings** from **Spectrum Properties**.


Create Standard File

After performing the standardless analysis, select **Utility/Create Standard** from the menu. A dialog similar to the following will appear.

The **Component** concentrations are those from the standardless analysis. Ensure that the complete description of the standard is entered into the component table. You can start with the default list produced by the standardless analysis, but you must make sure to enter any other elements present in the standard, though they may not be selected for calibration. This is extremely important! To generate the correct values for calibration coefficients, the complete sample composition must be specified, otherwise incorrect calibration coefficients will be generated. It is also possible to enter compounds directly in standard (e.g., oxides or carbonates). In these cases the unanalyzed elements (e.g., H or C) will be determined by stoichiometry.

As you enter the assay values in the component table, they will appear in the **Element** table at the bottom of the dialog.

When you have completed the entry of the assay values, click on the **Save** button to save the standard file. The same name as the spectrum should be chosen for later use in the calibration step.

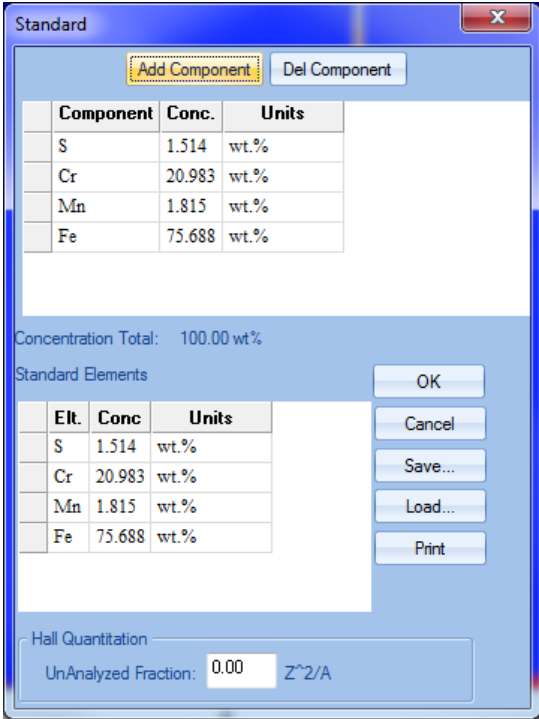

The Standard dialog box contains the following information:

Component	Conc.	Units
S	1.514	wt.%
Cr	20.983	wt.%
Mn	1.815	wt.%
Fe	75.688	wt.%


Concentration Total: 100.00 wt%

Elt.	Conc	Units
S	1.514	wt.%
Cr	20.983	wt.%
Mn	1.815	wt.%
Fe	75.688	wt.%

Buttons: Add Component, Del Component, OK, Cancel, Save..., Load..., Print

Hall Quantitation: UnAnalyzed Fraction: 0.00 Z^2/A

Do ZAF Calibration

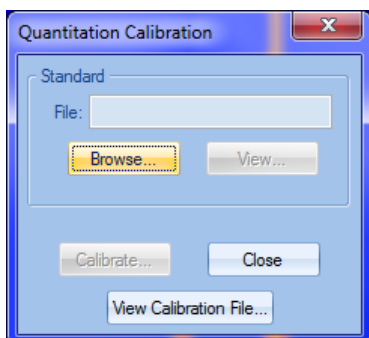

The Quantitation Calibration dialog box contains the following fields and buttons:


Standard File:

Buttons: Browse..., View..., Calibrate..., Close, View Calibration File...

Select **Utility/Quantitation Calibration** from the menu. A dialog similar to the following will appear:

If the Standard file name that you wish to use is not listed in the field to the right of File, click on the **Browse** button and select the standard file. Once the standard file has been selected, you can use the **View** button to examine and modify the file as desired.


Click on the **Calibrate** button to perform the ZAF calibration. When the calibration is complete, a dialog similar to this will appear:

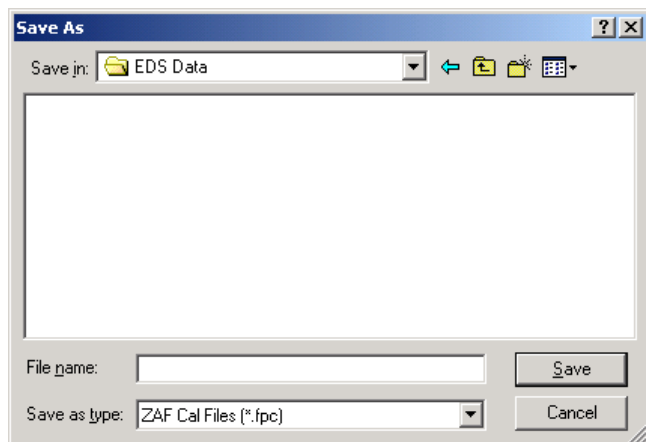

Enter a name for the ZAF calibration file, and click the Save button to write the coefficient file (with .fpc extension) to disk. The ZAF Calibration is now completed.


This procedure can be repeated for other standards and the coefficients can be stored in separate calibration files (one for each standard), or merged into a single calibration file. If you choose to merge the calibration coefficients into a single file, begin by selecting an existing calibration file for storing the calibration coefficients.

The dialog shown below will appear.

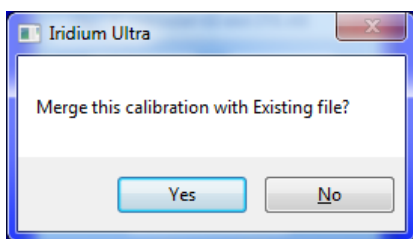


Selecting **Yes** will confirm that you wish to merge the present calibration into an existing calibration file. Selecting **No** will proceed to replace the existing calibration file with the present calibration.

If you are merging calibrations, and there are any elements in the present calibration that are also in the existing calibration file, a dialog will be presented to allow you to select which calibration value to use, as shown below. After completing the calibration, the Calibration File Viewer will display the contents of the calibration file. Below is an example of a calibration file.

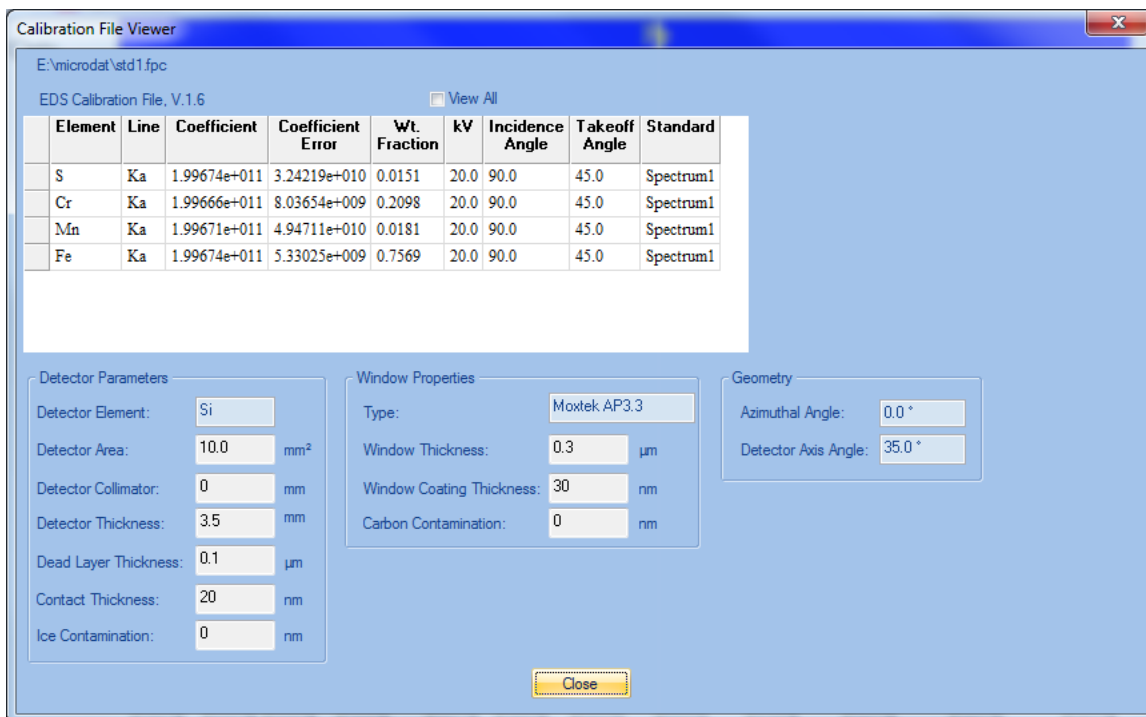


It is important to verify the detector, geometry, and kV displayed. It is a common mistake to have incorrect data in these fields. This will lead to incorrect calibrations, and poor quantitation using this calibration file. Also, note that this viewer can be invoked from the ZAF calibration panel using the **View Calibration File** button as shown below.

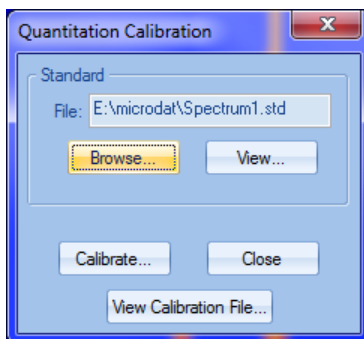

4.13.4 Performing ZAF Quantitation with Standards

After doing ZAF calibration, quantitative analysis can now be performed using this calibration file. If you saved the Analysis Settings from the ZAF calibration, these can also be used as a good starting point for setting up the analysis. From the **Spectrum Properties** dialog, click on the **Load Settings** button and select the Analysis Settings file that you saved from the ZAF calibration. Now, from the **Quantitation** tab of the **Spectrum Properties**, click on the **Advanced** button. A dialog similar to the following will appear:

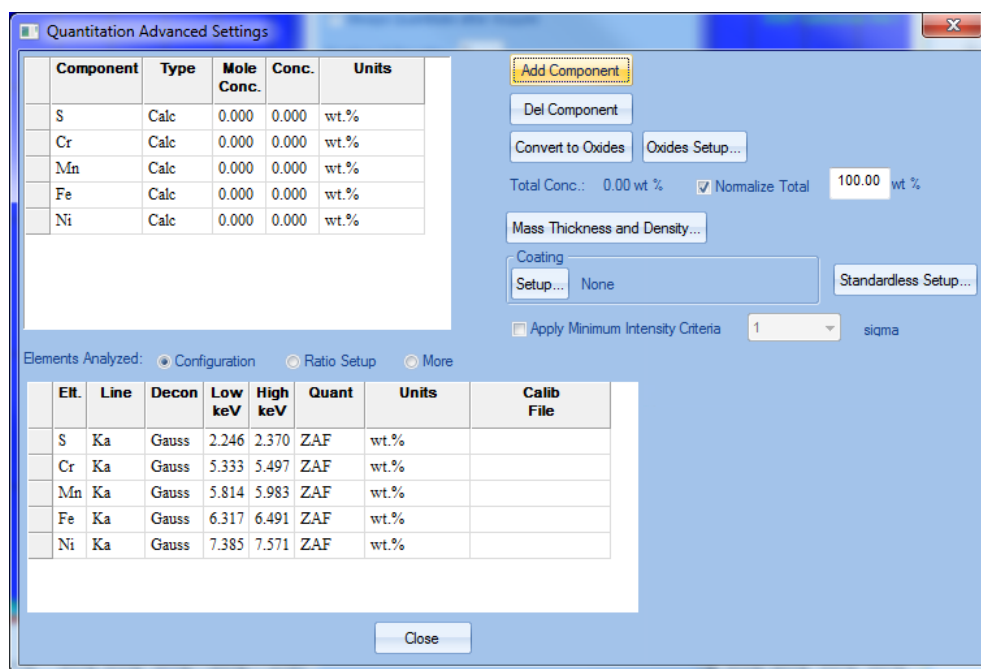


Select the elements from the **Elements Analyzed** table that you wish to quantify with the ZAF calibration file. Normally this will be all of the elements. To select all elements in the table do the following:

- Click on the gray select button to the left of an element name (e.g., Cr). This selects a single element, in the following example it is Cr:

	El.	Line	Decon.	Low keV	High keV	Quant	Units	Calib File
<input checked="" type="checkbox"/>	Cr	Ka	Gauss	5.336	5.494	None	wt. %	
<input type="checkbox"/>	Mn	Ka	Gauss	5.818	5.980	None	wt. %	

- Further elements can be added by selecting their individual select buttons.
- To select all elements in the table, press Ctrl + A on the keyboard.
- Click on the Calib File cell of the table on one of the selected rows (e.g., Cr). A dialog similar to the following will appear which will allow you to select a ZAF calibration file.


	El.	Line	Decon.	Low keV	High keV	Quant	Units	Calib File
<input checked="" type="checkbox"/>	Cr	Ka	Gauss	5.336	5.494	None	wt. %	
<input checked="" type="checkbox"/>	Mn	Ka	Gauss	5.818	5.980	None	wt. %	
<input checked="" type="checkbox"/>	Fe	Ka	Gauss	6.321	6.487	None	wt. %	
<input checked="" type="checkbox"/>	Co	Ka	Gauss	6.845	7.015	None	wt. %	
<input checked="" type="checkbox"/>	Ni	Ka	Gauss	7.391	7.565	None	wt. %	

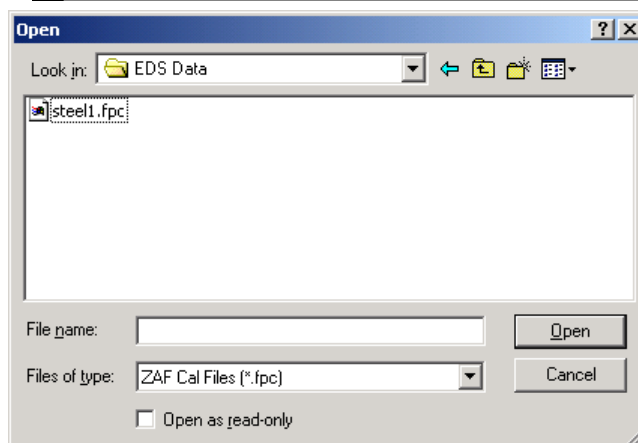

Select a calibration file. The file name will now appear for all of the selected elements, as shown here.

- To unselect the complete table, now press Ctrl + E on the keyboard. Note that each element may be quantified by a different calibration file, e.g., if each one had a separate pure-element calibration file.

	El.	Line	Decon.	Low keV	High keV	Quant	Units	Calib File
<input checked="" type="checkbox"/>	Cr	Ka	Gauss	5.350	5.479	ZAF	wt. %	Steel1.fpc
<input checked="" type="checkbox"/>	Mn	Ka	Gauss	5.832	5.966	ZAF	wt. %	Steel1.fpc
<input checked="" type="checkbox"/>	Fe	Ka	Gauss	6.334	6.473	ZAF	wt. %	Steel1.fpc
<input checked="" type="checkbox"/>	Co	Ka	Gauss	6.859	7.002	ZAF	wt. %	Steel1.fpc
<input checked="" type="checkbox"/>	Ni	Ka	Gauss	7.404	7.552	ZAF	wt. %	Steel1.fpc

At this point quantitative analysis with these settings will now use the ZAF calibration file. It is a good idea to save these Analysis Settings so that they can be used to analyze samples in the future using ZAF with standards. Once saved, these settings can be set as the default settings by selecting **Set As Default** on the **Spectrum Properties** dialog or by selecting them from the  button on the ToolBar. They can be loaded at any time with the **Load Settings** button on the **Spectrum Properties**.

4.13.5 ZAF Warnings and Errors

After a ZAF analysis, any warning or errors detected during the quantitation are displayed at the bottom of the analysis. The text always begins with the following line:

*****Warnings and Errors*****

Below is an example of an analysis with two warnings displayed.

El.	Line	Intensity (c/s)	Error 2-sig	Conc	
Cr	Ka	1138.30	55.256	17.701	wt. %
Mn	Ka	67.62	21.580	1.171	wt. %
Fe	Ka	2709.01	82.610	69.172	wt. %
Ni	Ka	309.59	30.878	11.956	wt. %
				100.000	wt. % Total
kV 20.0					
Takeoff Angle 35.0°					
Warnings and Errors					
Warning: No Calibration File for Mn					
Warning: Elements not in specified Calibration File: Ni					

The following are the possible error messages and a description of each message.

Error: ZAF not enabled or missing from software

The ZAF software is either not enabled with the HASP plug or has failed to load with the application.

Warning: The following element calibrations are > 5kV from this spectrum

A list of elements will follow on the next line on the screen. The elements listed were calibrated at a kV significantly different from the present spectrum. The calibration file may not be appropriate for this analysis.

Warning: The following element calibrations are for different lines than this spectrum

A list of elements will follow on the next line on the screen. The elements listed were calibrated with a different analysis line (e.g., K α instead of L α) than that of the calibration file.

Warning: No Calibration File for Cr, Fe

A list of elements (shown Cr and Fe in this example) is displayed of all the elements that do not have a calibration file specified. These elements will use an interpolated calibration value derived from the calibrated elements' values.

Warning: Elements not in specified Calibration File: Cr, Fe

A list of elements (shown as Cr and Fe in this example) is displayed of elements which are not in the calibration file specified. In this example, a calibration file was specified for both Cr and Fe, but the calibration file does not have these elements.

4.14 Match Analysis

Match can be used to perform Quantitative or Qualitative analysis. When used for qualitative analysis, the spectrum being analyzed is compared with spectra stored on disk. The best matching spectra (using a chi-square criteria) are displayed.

When used for quantitative analysis, the spectrum being analyzed is compared with spectra stored on disk that also have accompanying standard files, which define the composition of the standard spectra. As with the qualitative analysis, the best matching spectra are displayed. After this display, the best matching spectrum is used, with its standard file, to perform quantitative analysis of the spectrum. Both spectra are processed (Escape Peaks, Background Removal, Deconvolution), and the quantitative analysis of the spectrum is based upon a simple ratio formula given below:

$$\text{ConcSpectrum} = \text{ConcBestMatch} * \text{IntensitySpectrum} / \text{IntensityBestMatch}$$

Where:

ConcBestMatch is the concentration for an element in the best matching spectrum's standard file,

IntensitySpectrum is the element net peak intensity from the spectrum,

IntensityBestMatch is the element net peak intensity from the best matching standard spectrum,

ConcSpectrum is the calculated element concentration in the spectrum.

The spectrum comparison process is as given below. The spectrum being processed will be referred to as the sample spectrum.


1. A standard spectrum is loaded from disk. This will be referred to as the match spectrum.
2. The match spectrum is normalized to the sample spectrum using the Normalization Region defined in the Match Setup. The match spectrum and the sample spectrum are integrated over the Normalization Region. The ratio of the integrals is used as a scaling factor that is applied to all the channels of the match spectrum.
3. A channel-by-channel chi-square fit is calculated over the Fit Region as defined in the Match Setup.
4. The chi-square fit is kept in an ordered list of "best matching" spectra. The 10 best matching (smallest chi-square) are kept for later viewing.

4.14.1 Qualitative Match Analysis

To setup an analysis using qualitative match the following steps need to be done:

- Acquire and save spectra from the materials for which you will be doing the match analysis. These spectra should be stored in a unique directory, apart from all other spectra. The reason for this is that the match analysis will compare all match spectra in the specified directories (see Match Setup below) against the sample spectrum. For example, if you have a set of steel spectra that you wish to use for match analysis, it would be appropriate to create a new directory on your computer named STEELS and store these spectra in this directory. This directory should only be used to store steel spectra that you wish to compare sample spectra against.
- Setup an Analysis Settings file with the Quantitative method set to **Match**. This is done by setting the quantitative method for all elements to be **Match**, select **Match** as the quantitative method on

the **Quantitation** tab of the **Spectrum Properties** dialog as shown below:

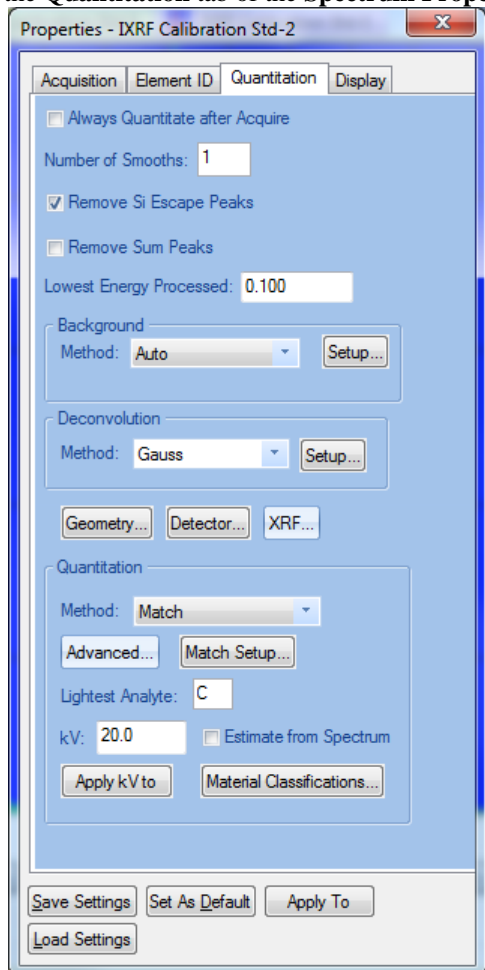


- Fill in the Match Setup as described below
- Save the Analysis Settings so that they can be used on future spectra acquired.
- Quantitative analysis of a spectrum using these settings will now perform qualitative Match analysis.

Match Setup

As a minimum, Match needs to know the location of the match spectra directories, and whether to perform quantitative or qualitative analysis. To specify this information, and more, click on the **Match Setup** button on the **Quantitation** tab of the **Spectrum Properties** dialog. A dialog similar to the following will appear.

One or more directories must be selected. Click on the **Add** button to insert a directory into the list of selected directories. To take a directory out of the list, select it by clicking on it and then click the **Remove** button.

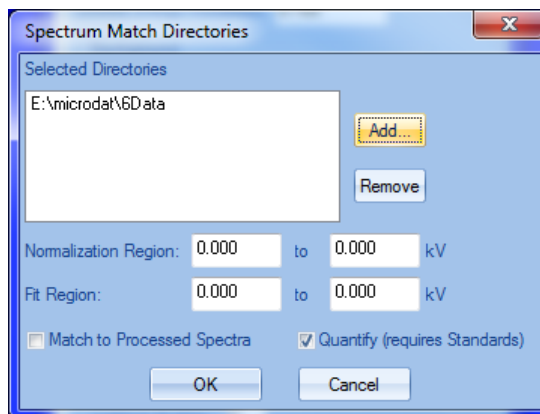

Be sure that the setting for **Quantify** is set to your specific needs. If you wish to produce **quantitative analysis** (i.e., elemental composition), you will need to select **Quantify**. Of course, this also will mean that you will need to create standard files for each spectrum you wish to match against. For qualitative analysis, **Quantify** should *not be selected*.

There are two regions of the spectrum that can be used to control the matching process:

- **Normalization Region.** This defines the region of the spectrum that will be used for normalization during the spectrum comparison. The default is the whole spectrum (0 – 0 kV).
- **Fit Region.** This defines the region of the spectrum that will be used for comparison. The default region (ROI) is the whole spectrum (0 – 0 kV). In some cases, only a selected region of the spectrum should be used for comparison, excluding all other channels. For example, if match is to consider only the fitting of the peaks for Cr, Mn, Fe, and Ni, a ROI of 5.0 – 9.0 kV would be appropriate. This would indicate that any peaks above or below this ROI would not be considered in the comparison.

4.14.2 Quantitative Match Analysis

To setup an analysis using quantitative match the following need to be done:

- Proceed as per the Qualitative Match analysis (see above), and then create a standard file for each of the above spectra. To create a standard file, select **Utility/Create Standard** from the menu. A dialog similar to the following will appear.

The Component concentrations are those from any analysis that has been previously done on the spectrum. Components can be added to the standard using the **Add Component** button. A new row will appear in the Component table. Enter the Component (e.g. Fe₂O₃). Components can be removed from the table by selecting them with the mouse and then clicking on the **Del Component** button. Enter the standard concentrations in the column labeled **Conc.** As you enter the assay values, they will also appear in the **Element** table at the bottom of the dialog. When you have completed entry of the assay values, click on the **Save** button to save the standard file.

Component	Conc.	Units
S	1.514	wt.%
Cr	20.983	wt.%
Mn	1.815	wt.%
Fe	75.688	wt.%


Concentration Total: 100.00 wt%

Elt.	Conc	Units
S	1.514	wt.%
Cr	20.983	wt.%
Mn	1.815	wt.%
Fe	75.688	wt.%

UnAnalyzed Fraction: 0.00 Z²/A

- Setup an Analysis Settings file with the Quantitative method set to Match. This is done by setting the quantitative method for all elements to be Match, select Match as the quantitative method on the **Quantitation** tab of the **Spectrum**

Properties dialog as shown below:

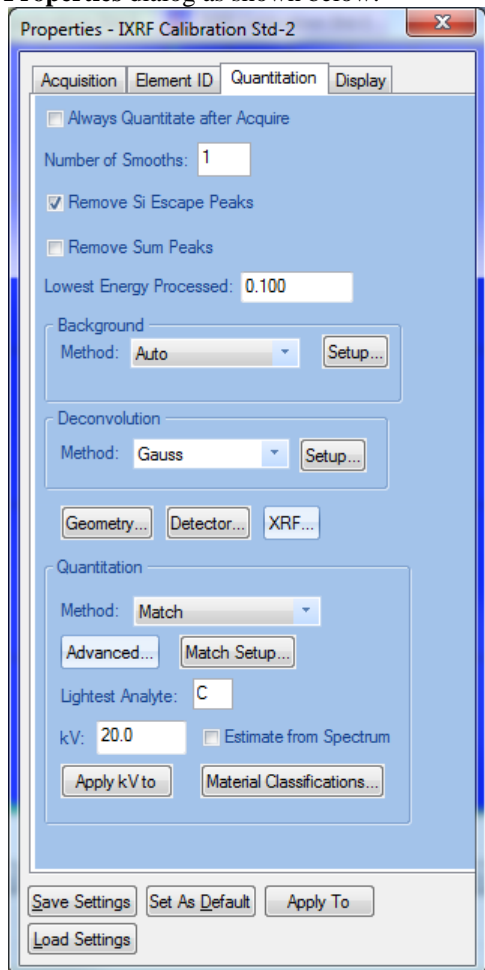


- Fill in the Match Setup as described in the description of **Qualitative Match Analysis**.
- Save the Analysis Settings so that they can be used on future spectra acquired.
- Quantitative analysis of a spectrum using these settings will now perform quantitative Match analysis.


4.14.3 Viewing Match Results

After performing analysis with Match, two additional menu items are available for viewing the best matching spectrum and for viewing a graph of the 10 best matching spectra.

View/Match displays a graph showing the 10 best matching spectra, as shown below.

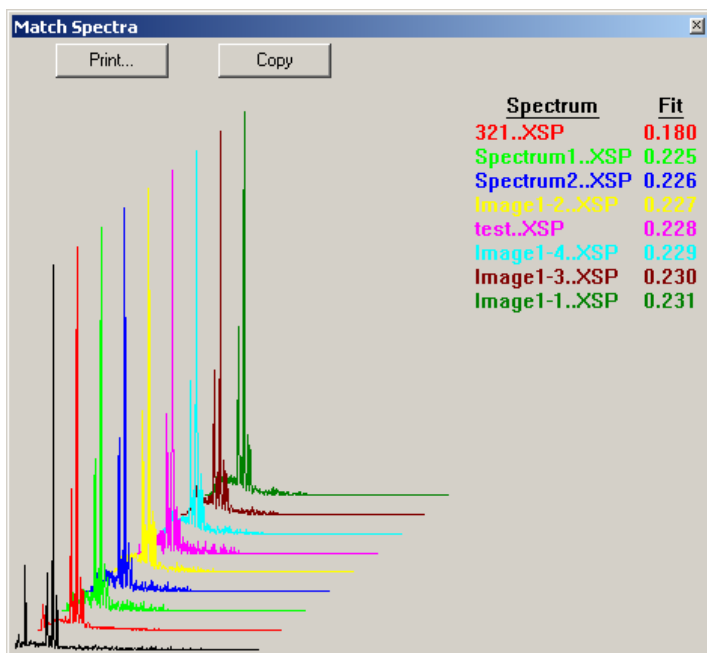

View/Match Spectrum... displays the best matching spectrum, as shown below.

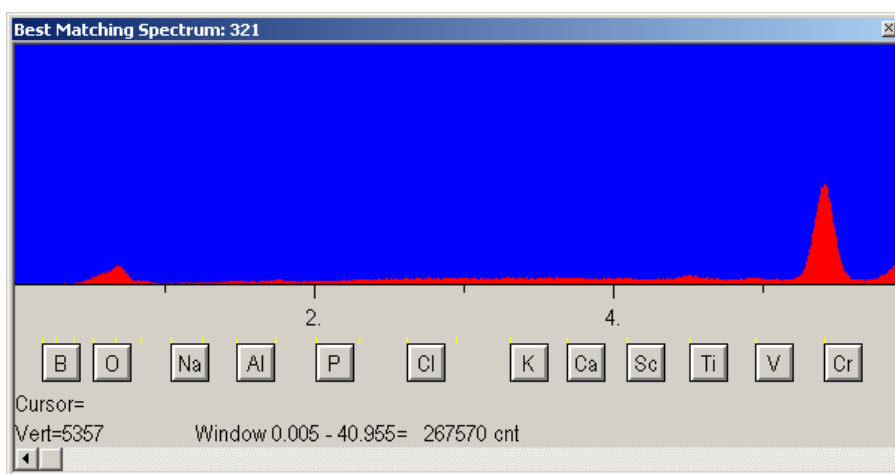


4.15 Least-Squares quantitation method

Least-Squares (LS) quantitation method uses a set of EDS standards to define the relationship between element intensities and concentrations. Similar to ZAF with standards, LS requires that the user acquire a set of EDS standard spectra and to also create EDS Standard files. The LS calibration is then used to calculate a “best fit” curve using the intensities from the standard spectra and the concentrations from the standards files.


This technique can be useful with samples that have very low concentrations or when ZAF quantitation does not perform adequately (i.e. carbon).

4.15.1 Creating the calibration file


Select **File/New** from the menu and then select **Least Squares Calibration**, as shown below.

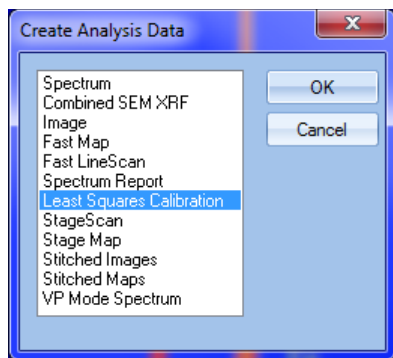

A panel similar to the following will appear.

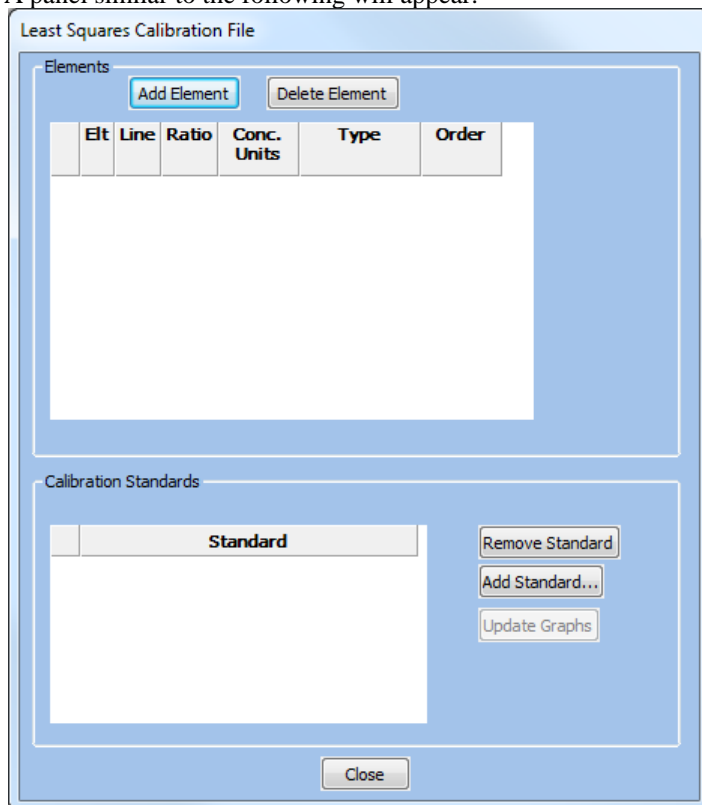


We must first add some standards to the calibration. Click on Add Standard to do this. A panel similar to the following will appear.

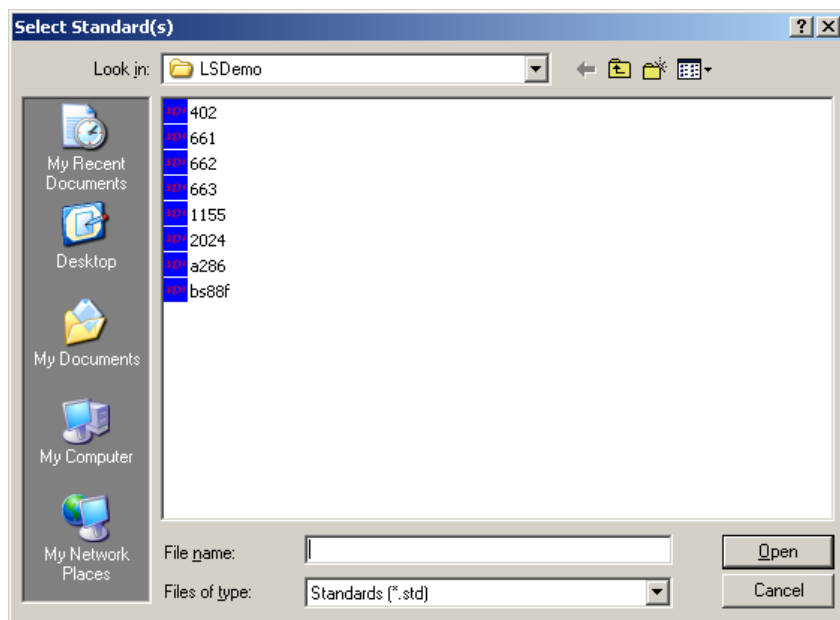

Select one or more of the standards displayed and click **Open** to add them to the calibration. You may notice that some of your standard files (*.std) are not listed in the panel. This is because there is not a spectrum file (*.xsp) for the standard file in this folder. Standard and standard spectrum files must have the same name and be stored in the same folder in order to be used with LS calibration.

After selecting the standard files, the calibration is immediately performed and graphs of the curve fits for each element are displayed. The calibration includes all elements that are in the calibration standards.


Below is an example with 3 standards selected from the panel above.

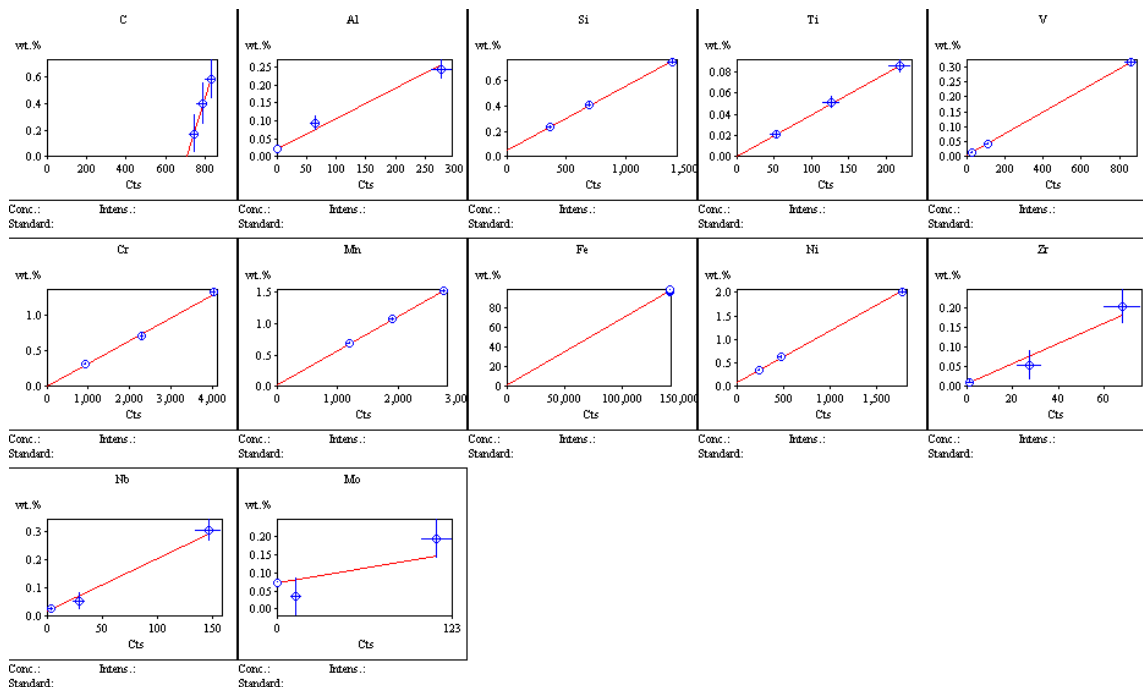

The graphs are displayed with concentration on the vertical axis and intensity on the horizontal axis. The intensities have been taken from the standard spectrum files, from the last quantitation of each spectrum. The concentrations are taken from the standard files. The pairs of intensity and concentration are displayed as points on each graph.


As you can see, some of the graphs show the curve fit passing through (or very close) to all of the points. C, Si, Ti, V, Cr, Mn, and Ni are examples of these good fits. Other curves have points that are above or below the curve. Examples of these are Al, Zr, and Mo of fits that are not as good.

The points that are used for the curve fit are colored blue. Points that have been removed from the curve fit are colored gray.

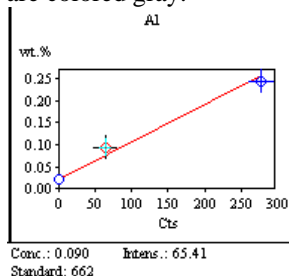


Clicking on an individual point on a graph will display the standard name, concentration, and intensity for the point.

If you want to remove a point from the curve fit for a particular element, right-click over the point in the graph. A menu will appear. Select the menu item **Remove X**, where **X** is the standard name. Below is an example.

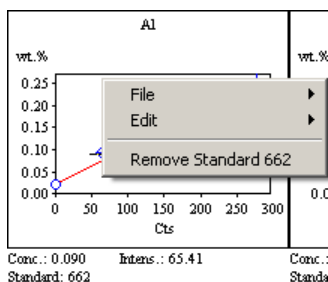

After removing 662 from the fit, this is how the graph is displayed. Notice the grayed point. This is the standard 662, which is no longer included in the curve fit for aluminum.

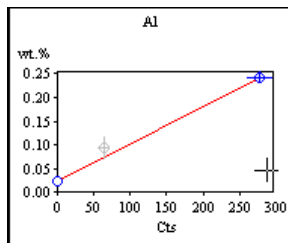

To add the standard back into the curve fit, right-click over the point, as before, and select **Add X** from the menu, where **X** is the standard name.

4.15.1.1 Editing the Calibration

The attributes of the curve fit are mostly set with the editing panel, shown below.

Least Squares Calibration File

Elements

Add Element Delete Element

Elt	Line	Ratio	Conc. Units	Type	Order
C	Ka	<input checked="" type="checkbox"/>	wt. %	linear	2
Al	Ka	<input checked="" type="checkbox"/>	wt. %	linear	2
Ti	Ka	<input checked="" type="checkbox"/>	wt. %	linear	2
V	Ka	<input checked="" type="checkbox"/>	wt. %	linear	2
Cr	Ka	<input checked="" type="checkbox"/>	wt. %	linear	2
Mn	Ka	<input checked="" type="checkbox"/>	wt. %	linear	2
Fe	Ka	<input checked="" type="checkbox"/>	wt. %	linear	2
Ni	Ka	<input checked="" type="checkbox"/>	wt. %	linear	2

Calibration Standards

Standard
E:\microdat\LSDemo\661.xsp
E:\microdat\LSDemo\662.xsp
E:\microdat\LSDemo\663.xsp


Remove Standard
Add Standard...
Update Graphs

Close


The table at the top of the panel displays the list of elements in the calibration file. Elements can be removed from the calibration by selecting them in the table and clicking on **Delete Element**. Elements can be added to the calibration by clicking **Add Element**. Only elements that are specified in the standard file can be added.

The table at the bottom of the panel displays the standards. A standard can be removed from the calibration by selecting it in the table and clicking **Remove Standard**. Standards can be added to the calibration by clicking on **Add Standard**.

Each element has a **Type**. **Type** allows you to specify if the fit will be forced to include 0 or not. Selecting linear type will not force the fit through 0; selecting linear0 will. Below is the carbon calibration with both linear and linear0 types.

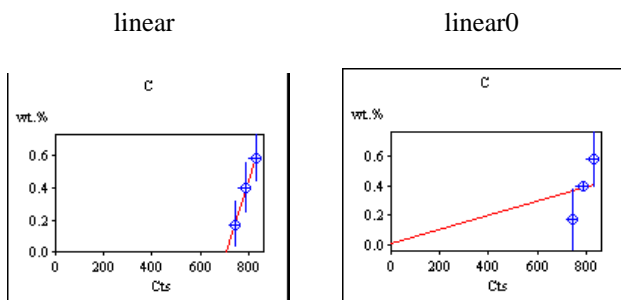

Each element has an **Order**. **Order** defines the linear order of the curve fit. Order 2 fit is a straight line. Order 3 fit is a parabolic fit. An order 2 will fit any two points to a straight line. If there are more than 2 points (standards), then a straight line may not exactly fit the points. An order 3 fit will fit any 3 points to a parabolic curve. Below are examples of an order 2 and order 3 fits for Zr.

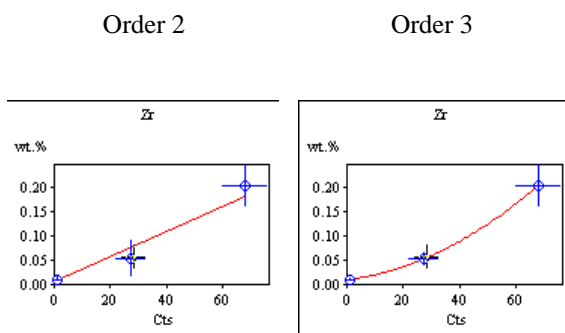

An order 3 fit requires at least 3 points. Zero can be one of these points, so a linear fit with 2 standards is valid.

Each element can fit either the intensity or intensity **Ratio**. By selecting **Ratio** for an element, the least squares curve fit will use the intensity Ratio for the element, rather than the intensity. It is important that the Ratio settings in the standard spectra are also set. The intensity ratios calculated during the quantitation of the standard spectra, prior to the least squares calibration, will be used for the curve fit. Below illustrates the ratio setup. This can be found in the spectrum properties quantitation panel, by clicking on the **Advanced** button.

Component	Type	Mole Conc.	Conc.	Units
Cr	Calc	0.000	0.000	wt. %
Mn	Calc	0.000	0.000	wt. %
Fe	Calc	0.000	0.000	wt. %

Elements Analyzed: ☐ Configuration ☒ **Ratio Setup** ☐ More


El.	Line	Ratioed	Ratio Low keV	Ratio High keV
Cr	Ka	<input type="checkbox"/>	0.000	0.000
Mn	Ka	<input type="checkbox"/>	0.000	0.000
Fe	Ka	<input type="checkbox"/>	0.000	0.000

To setup the calculation of intensity ratios, select **Ratio** for each element, and then enter the energy range to use for the ratio (Low and High). The intensity ratio is then calculated during quantitation as the ratio of the net peak intensity for the element divided by the counts in the ratio region.


4.15.2 Quantifying with Least Squares

To use Least Squares for quantitation, you must select LS as the quantitation method and an appropriate LS calibration file for the desired elements.

LS quantitation selected from the **Quantitation** tab of the spectrum **Properties** panel, as shown below.

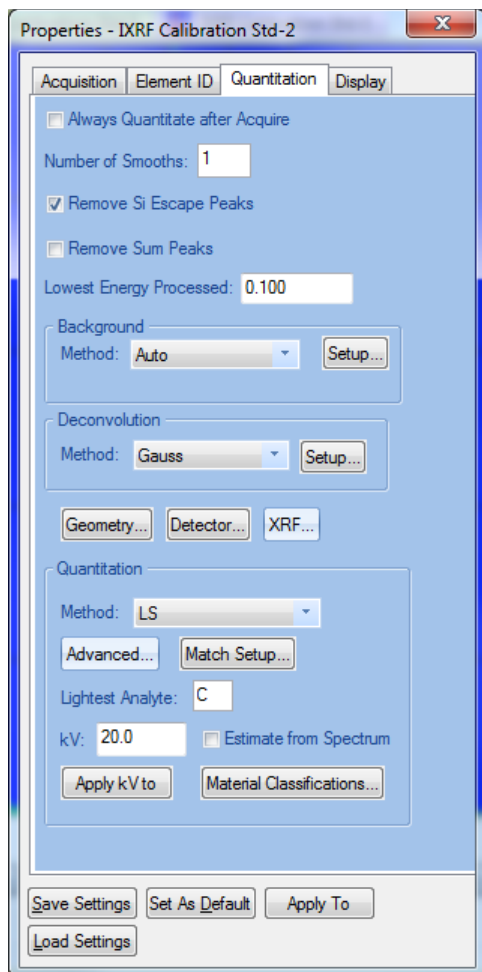

Click on the **Advanced** button in the Quantitation section. A panel similar to the following will appear.

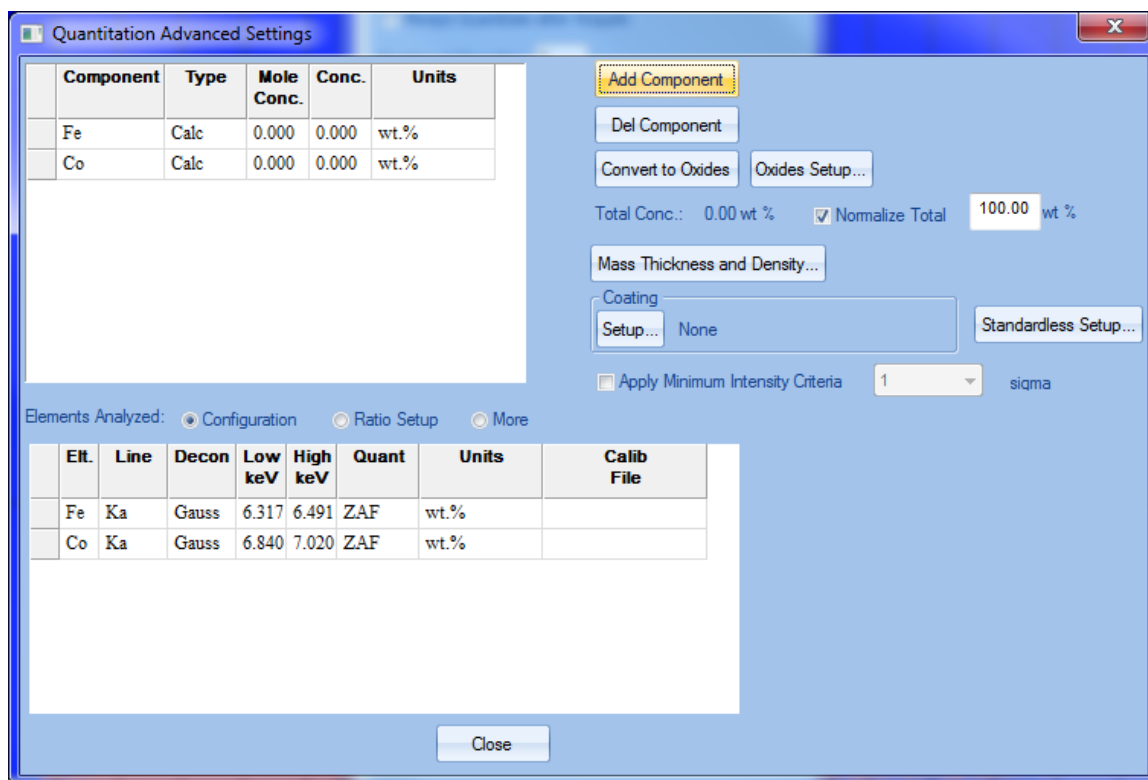

The dialog box is titled "Quantitation Advanced Settings". It contains two main tables and several control options.

Top Table:

Component	Type	Mole Conc.	Conc.	Units
Fe	Calc	0.000	0.000	wt. %
Co	Calc	0.000	0.000	wt. %

Right Panel Controls:

- Buttons: Add Component, Del Component, Convert to Oxides, Oxides Setup...
- Total Conc.: 0.00 wt % ☒ Normalize Total 100.00 wt %
- Mass Thickness and Density...
- Coating Setup... None Standardless Setup...
- ☐ Apply Minimum Intensity Criteria 1 sigma

Bottom Section:

Elements Analyzed: ☒ Configuration ☐ Ratio Setup ☐ More

Elt.	Line	Decon	Low keV	High keV	Quant	Units	Calib File
Fe	Ka	Gauss	6.317	6.491	ZAF	wt. %	
Co	Ka	Gauss	6.840	7.020	ZAF	wt. %	


Close

Select the elements that you want to analyze with LS. Change the **Quant** method to LS by selecting LS from the list of quantitation methods as shown below.

Elt.	Line	Decon	Low keV	High keV	Quant
Fe	Ka	Gauss	6.331	6.477	None
Co	Ka	Gauss	6.855	7.005	Match


A dropdown menu is open for the 'Quant' column of the second row (Co), showing the following options: None, Match, ZAF, Foil, Hall, Small, MTF, FP, and LS. 'LS' is selected.

Then, click on the **Calib File** column for the element. A panel similar to the following will appear for selection of the calibration file.

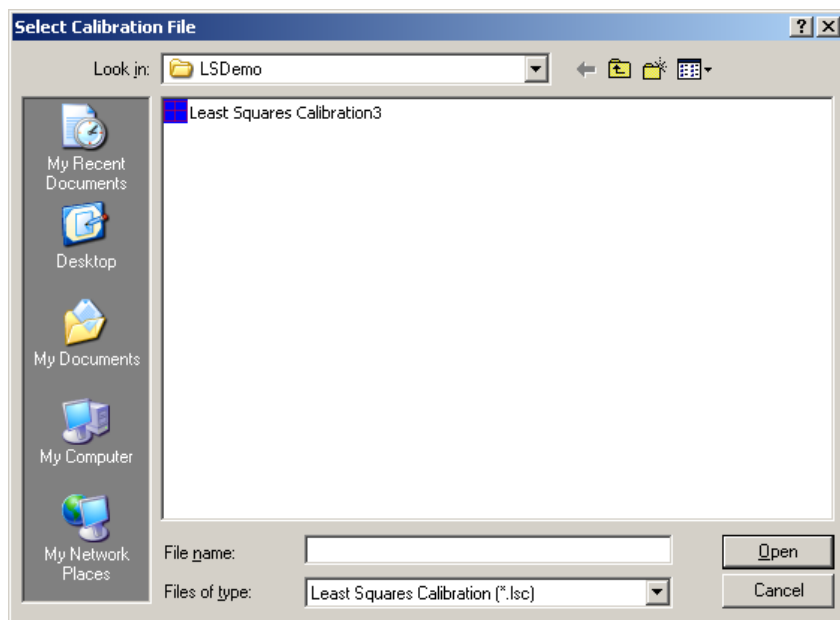

Select the calibration file and click **Open**.

The spectrum is now setup to quantify using Least Squares. You can save these settings for use with other similar samples by selecting Save Settings from the spectrum properties panel, as shown below.

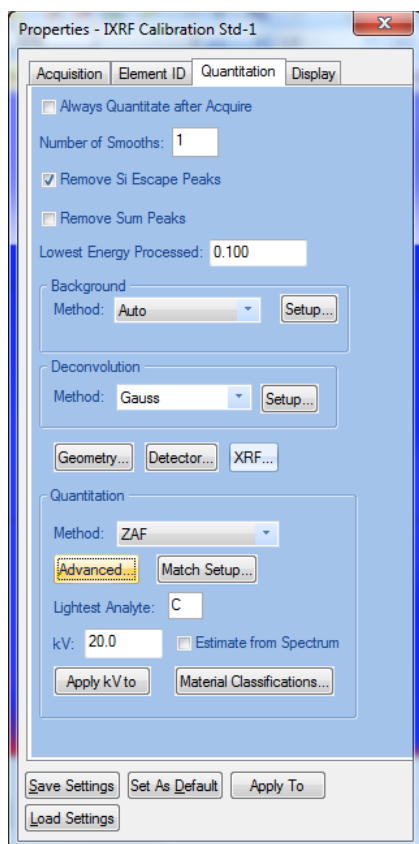


4.16 Material Classification

After quantitation, the element concentrations can be compared against a given set of materials specifications, known as a **Materials Classification**. This is similar to Match procedure except that composition is used instead of spectra.

The setup of Material Classification is done from the spectrum **Properties Quantitation** tab, shown on the right.

The Materials Classifications are stored in the Input Database. An example of a Materials Classification is the following set of Materials Specifications:

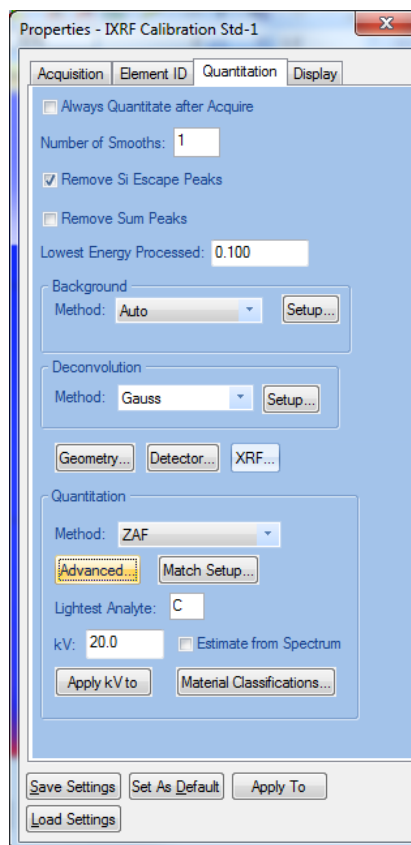


Material	Fe	Fe	Cr	Cr
	Min Wt %	Max Wt%	Min Wt%	Max Wt%
316	55	62	1.2	2.5
302	55	65	3.1	4.3
313	60	68	0.5	1

These are the names of 3 materials. Each of these materials has a specification defining the allowed range of the elemental compositions. This is a partial description of the elemental composition of the three materials. Only the concentrations for Fe and Cr are given. Each of the concentrations is given as an acceptable range (minimum and maximum). When a sample is classified after being quantified, its concentrations are compared against the Materials Specifications in the selected Materials Classification. If the element concentrations are within the range of acceptable values for a Material Specification, then it is considered to be matching that material. After this classification process the sample may have zero or more matches with materials in the Materials Classification. The name of the best matching material (based upon computed chi-square fit) is stored in the Output Database.

To begin setting up the Materials Classification, select the **Material Classification** properties from the **Spectrum Properties** panel as shown below. To access the **Spectrum Properties**, select **Properties** from any spectrum's menu or from the menu on the EDS Toolbar.


The **Material Classification** properties define the set of materials from which the classification of the spectrum will be made. The **Material Classification** are stored in a Microsoft Access database file. The first step in defining the **Material Classification** is to select a database file. If no database files exist, a new database file can be created. Once a database file has been selected, a materials class can be selected from the database. A single database can store many materials classes. A materials class is a set of material specifications. These specifications will be used to classify each sample analysis.

Below are the steps to setting up Materials Classification:

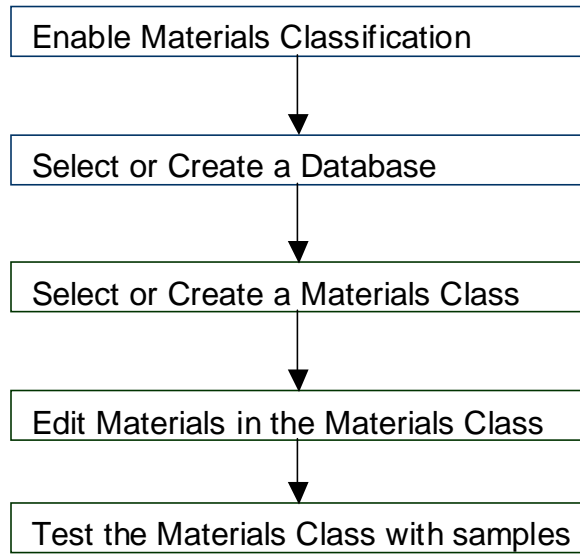

4.16.1 Enable Materials Classification

To begin using **Material Classification** it must first be enabled in the spectrum **Properties Quantitation** tab. Click on the **Materials Classification** button and a panel similar to the following will appear.

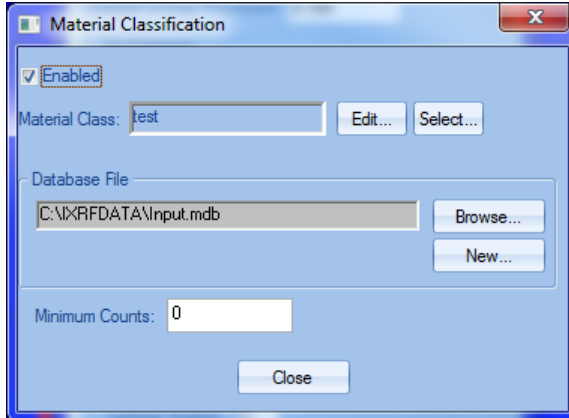

Click the **Enable** checkbox as shown above.

4.16.2 Select or Create a Database

The **Material Classification** (material specifications) is stored in an input database file. This is a Microsoft Access database file that contains specific tables designed for storage of the **Material Classification** data.


When the software is installed an empty input database named input.mdb is created. This can be used, or a new database can be created. To select an existing database file, click on the **Browse** button. To create a new database file click on the **New** button.




4.16.3 Select or Create a Materials Class



A **Material Class** or **Material Classification** is as described at the beginning of this chapter. It contains one or more material composition specifications. To select or create a Material Class, click on the **Select** button. A dialog similar to this will appear.

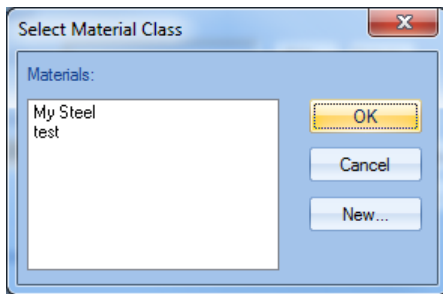


The Materials Classes that exist in the database will be displayed. If none exist, or you wish to create a new Materials Class, click on the **New** button. A dialog similar to the following will appear:

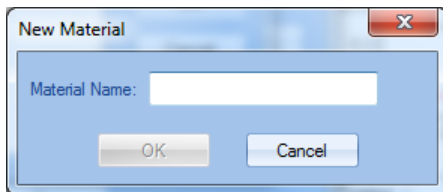

Enter a name for the new Materials Class and click **OK**. After creating a new Material Class, it can be selected in the **Select Material Class** dialog above.

4.16.4 Edit Materials in Materials Class

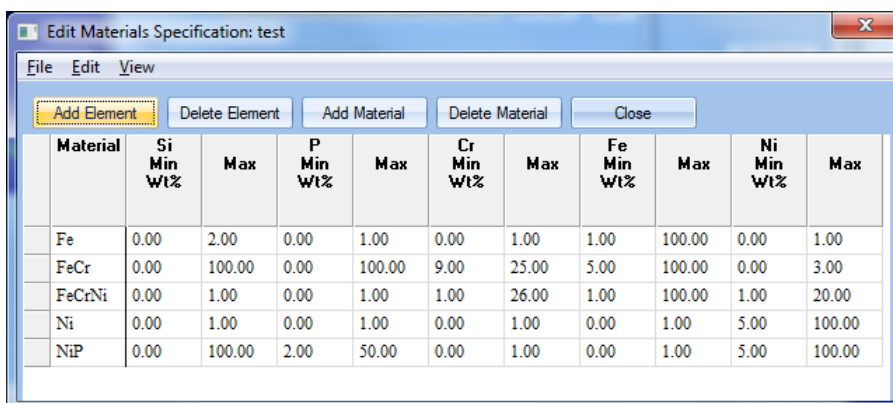

After selecting a Materials Classification, it may be necessary to edit it to add or modify the materials specified. Click on the **Edit** button. A dialog similar to the following will appear:

The table displays the material names in the left-most column, and the elemental composition in the columns to the right. The ranges of elemental concentrations for the materials can be entered (minimum and maximum values for each element), and elements can be added or removed from the specification.

Element concentrations are entered as a range (minimum and maximum). To specify that a given element is not significant in a material enter the values of 0 for minimum and 100 for maximum. This will result in any possible value of concentration for that element to be acceptable. Note that when an element is added to the material, it is added to all materials and that the initial range setting is 0 to 0. A range of 0 to 0 indicates that the element is absent from the material. This may present problems in classifications. Using ZAF or any quantitative analysis method, there is always a possibility of a small concentration of an element detected even though the element is not present in the sample. This could be caused by incomplete background removal or in the peak deconvolution process. It is best to have a small value for the maximum for all elements, even though the elements may not be present in the sample.

Click on the **Add Material** button to add a new material to the Materials Classification. A prompt will appear to enter the name for the new material. Clicking the **Delete Material** button removes the selected material from the Materials Classification.


To add an element, click on the **Add Element** button. A dialog is presented for entry of the new element symbol. Note that after entering a new element to the materials specification that the range of concentrations for all materials in this Materials Class must be entered.

To delete an element, click on the **Delete Element** button. This removes an element from all materials in the Materials Classification.

4.16.5 Test the Materials Class with Samples


After entering the materials, it is important to verify the classification on some representative samples. Start by saving the Analysis Settings, which now include the enabling of the Materials Classification and the names of the Database and the Materials Class that are to be used.

Acquire spectra from the samples and perform quantitative analysis on them. At the bottom of the quantitative analysis will be displayed the material which matches the quantitative analysis. If nothing is displayed, check the setting in the spectrum **Properties Display** tab. Make sure that **Material Classification** is selected, as shown.

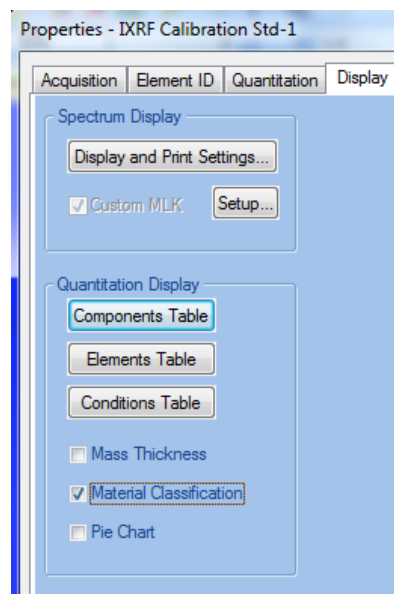

4.16.6 Setting Minimum Counts in Spectrum

It is possible to set a minimum threshold for counts in a spectrum. This eliminates a spectrum from classification if the total counts in the spectrum are below a minimum value. This is set in the **Material Classification** setup panel. The setting of 0 for Minimum Counts as shown will effectively not eliminate a spectrum from classification. Setting this to a value above 0 will impose that limitation.

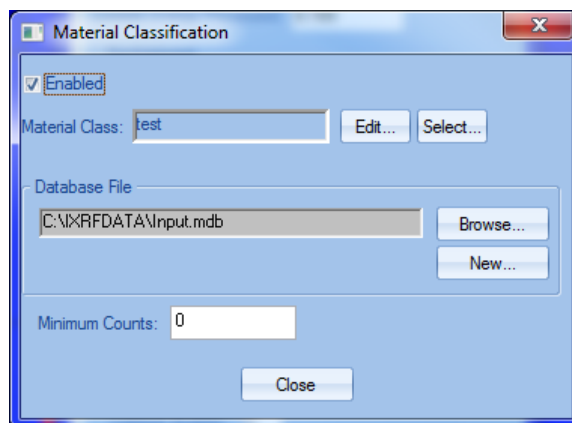


4.17 Spectrum Simulation

Spectrum Simulation allows you to generate a synthetic spectrum based upon a given sample composition and excitation conditions (kV). This is accessible from the spectrum menu **Utility/Simulate Spectrum**. A panel similar to the following will appear.

To simulate a spectrum:

1. Fill in the concentrations for the **Components**. The **Components**, as with Standard files, can be single elements or compounds (e.g., Fe or Fe₂O₃). Add components by clicking on **Add Component**. Remove components by first selecting them in the list and then clicking on **Del Component**.
If you want to simulate the spectrum from a previously stored standard file, select **Load Standard**. This will fill in the **Components** from the selected Standard file.
2. In the area labeled **Simulate In** selecting **Bars** will replace the spectrum presently displayed with the simulated spectrum. Selecting **Overlay** will simulate the spectrum in the overlay of the present spectrum. Thus, the simulated spectrum can be easily compared with the present spectrum.
3. Click on **Simulate Spectrum**. This generates the simulated spectrum.

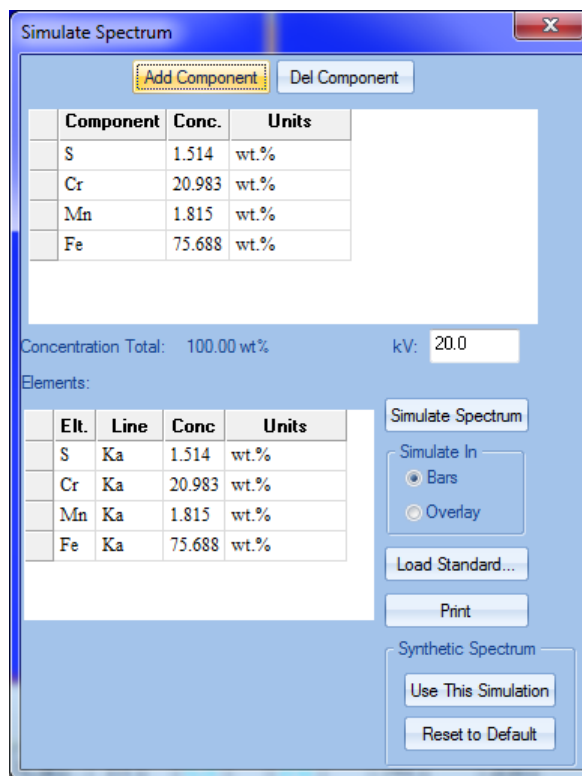


Clicking on **Print** to print the contents of this panel.

Synthetic Spectrum options are useful for those systems operating in virtual mode, primarily as demonstration systems. Normally, when the EDS software is operating in virtual mode, a synthetic spectrum is generated whenever data are acquired. Thus spectrum, x-ray maps, and x-ray linescans look somewhat realistic for demonstration purposes. The default spectrum is a steel spectrum. Clicking on **Use This Simulation** will store the current spectrum as the synthetic spectrum. Clicking on **Reset to Default** will restore the synthetic spectrum to the steel spectrum.



5. Working with Automatic Multiple Spectrum Acquisition


Using the **Multi-Spectrum** tool, it is possible to automate the acquisition and analysis of many spectra on a sample. This is useful when a sample has several distinct locations that need to be analyzed. To access the

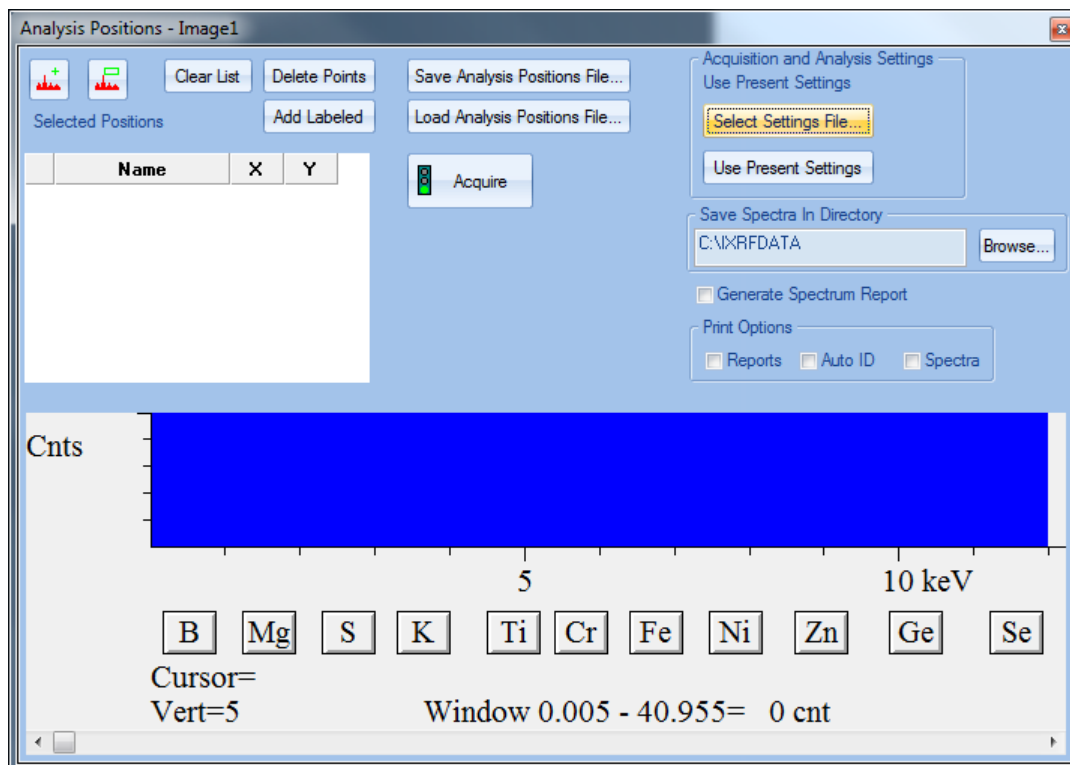Multi-Spectrum panel select **Setup/Analysis Positions...** from the image menu or select the  button from the integration toolbar. Below is the **Multi-Spectrum** panel that will display after your selection.



5.1 Selecting Locations

Select Spot Mode  or Raster Area  and select one or more locations on the sample that you wish to analyze. As the locations are selected, they will be labeled on the sample and entered into the list in the panel, as shown below.

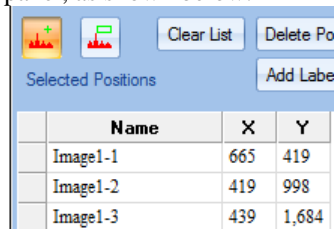



5.2 Adding Labeled Locations

On systems that have automatic particle analysis, the **Add Labeled** button will appear. Clicking this button will add all of the automatically located particles to the list.

5.3 Selecting Analysis Settings


The spectra will be acquired and analyzing using either the present default settings, or a selected settings file. The selection is displayed in the **Acquisition and Analysis Settings** section of the panel as shown at right.

In this example, the present selection is to **Use Present Settings**. To select a settings file, click on the **Select Settings File...** button, and select the settings file that you wish to use. Below, is an example of using a selected settings file (e:\microdat\oxides.def).

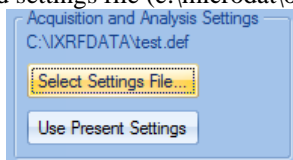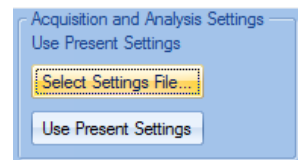


5.4 Selecting Location for File Storage

 The spectra data acquired are stored in the location selected here. To select a different folder for storage, click on the **Browse...** button.



5.5 Selecting Report Output Options

 Upon completion of the acquisition and analysis of the spectra, printed output and a **Spectrum Report** summarizing the elemental composition of all of the spectra can be generated. Below are the options for output.



Generate Spectrum Report tabulates the elemental composition from the spectra and calculates statistics on the elemental analysis (mean, minimum, maximum, standard deviation). This report can then be printed or copied into another application.

Printed output can be any of the following:

- ☐ **Reports.** This is the quantitative analysis report, as specified in the analysis settings. This may include component and/or elemental analysis.
- ☐ **Auto ID.** Prints the output of the automatic peak identification on the spectrum.
- ☐ **Spectra.** Prints the spectrum.

5.6 Starting the Analysis

Click on the **Acquire** button to begin the automatic acquisition and analysis of the locations on the sample. The **Start** button will be replaced with a **Stop** button. Click on this button to terminate the process. During acquisition, the spectrum data is displayed at the bottom of this panel.

Note: the application Acquire button does not stop the acquisition; use the Stop button in this panel to terminate the acquisition.

5.7 Saving and Loading Location Files

If you wish to use the same locations on several fields on an image, it is possible to save the locations using the **Save Analysis Positions File** button. These positions can then be loaded for use on another image with the **Load Analysis Positions File** button.

6. Working with Spectrum Reports

Spectrum Reports tabulate quantitative results from several spectra into a report format. The report displays the elemental concentrations from the spectra in a table and calculates statistics on the concentrations.

A Spectrum Report can be automatically created during the analysis of multiple spectra, as described in chapter 5.



Also, a new spectrum report can be created by selecting File/New from the menu. A panel similar to the following will appear.

Select Spectrum Report and click OK.

A panel similar to the following will appear.

Select **Data/Add Spectra** from the menu to add spectra to the report.

Below is a report with 5 spectra added to it. In addition to the elemental concentrations being displayed, the statistics Mean, Standard Deviation, Minimum, and Maximum are calculated and displayed.

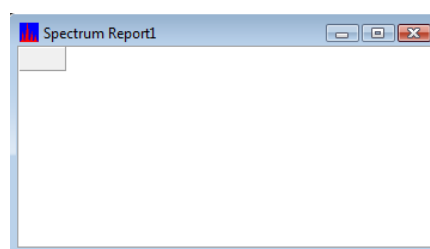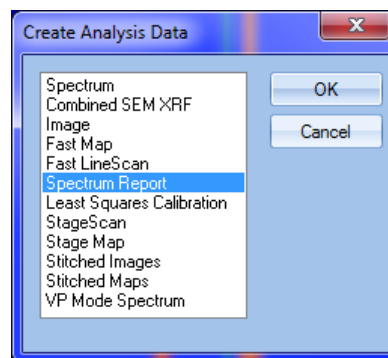

Spectrum	Conc														
	C	Al	Si	Ti	V	Cr	Mn	Fe	Co	Ni	Cu	Zn	Zr	Nb	Mo
321								86.126	1.136	12.321	0.351	0.066			
402		85.426			0.156	4.079	0.724	2.441	0.918	0.821	5.433				
661	2.004	0.000	0.178	0.019	0.011	0.669	0.656	94.453		1.888			0.002	0.004	0.116
662	1.919	0.041	0.340	0.081	0.038	0.286	1.036	95.461		0.556			0.082	0.159	0.000
663	2.093	0.168	0.666	0.047	0.302	1.272	1.491	93.596		0.287			0.033	0.032	0.014
Mean	2.005	21.409	0.395	0.049	0.127	1.576	0.977	74.415	1.027	3.175	2.892	0.066	0.039	0.065	0.044
Std. Dev.	0.087	42.678	0.249	0.031	0.133	1.717	0.380	40.403	0.154	5.149	3.593	0.000	0.041	0.083	0.064
Min	1.919	0.000	0.178	0.019	0.011	0.286	0.656	2.441	0.918	0.287	0.351	0.000	0.002	0.004	0.000
Max	2.093	85.426	0.666	0.081	0.302	4.079	1.491	95.461	1.136	12.321	5.433	0.000	0.082	0.159	0.116

The following menu items are available for Spectrum Reports;

File/Export

Stores the Spectrum Report in an external ASCII text file. The format of the file is a tab-separated-column text file which is compatible with Microsoft Excel spreadsheet. It can also be imported into word processors such as Microsoft Word.

File/Print

Prints the Spectrum Report. Note that the report is printed on a single sheet of paper. The font is adjusted so that the table will fit on the page in the current page orientation. Landscape orientation is often desired for printing of reports.

Edit/Copy

Places a copy of the table on the Windows Clipboard. This can be pasted into Microsoft Excel spreadsheet, or into word processors such as Microsoft Word.

View/Material

When material classification has been calculated for the spectra, displays the material name.

View/Stage Position

Displays the stage location for each spectrum

View/SEM Magnification

Displays the microscope magnification for each spectrum

View/Select Element Values.

Allows for display of any Element values (concentrations, intensities, etc).

View/Select Component Values

Allows for display of any Component values (concentration, type, etc).

Data/Add Spectra

Invokes a dialog to Select Spectra for Report.

Data/Delete Spectrum

Removes the currently selected spectrum from the report. When this is done, the table is redisplayed.


Data/Re-Analyze

Performs quantitative analysis on all of the spectra in the report and redisplay the report. This can be useful if you wish to change any parameters of the quantitative analysis. Using this menu item automates the re-quantification of all of these spectra. the table is redisplayed after the quantitation is completed.

7. Working with Combined SEM/XRF spectra

With the addition of the fX and X-Beam XRF sources to our product line, it is now possible to analyze a sample using both e-beam generated and x-ray-beam generated spectra. Analyzing samples separately with e-beam and x-ray-beam is straight-forward, using the standard spectrum acquisition and analysis tools. Performing combined analysis, using both spectra from a sample, is slightly different. This section of the manual describes the method for doing this combined acquisition and analysis.

To begin, we need to create a new Combined SEM/XRF panel. This can be done by selecting **File/New** from the menu and then selecting **Combined SEM/XRF** as shown below.

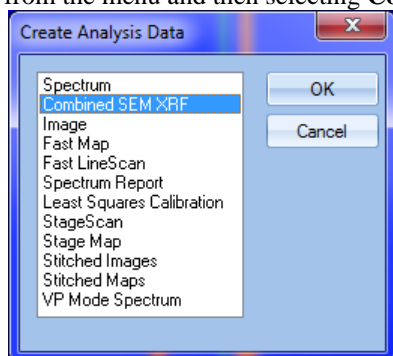


Another way to do this is to click on the Combined SEM/XRF button  on the toolbar.

Below is a combined SEM/XRF spectrum.


On the top-left is the SEM spectrum and below it is the XRF spectrum.

To the right of the spectra is the analysis results panel.

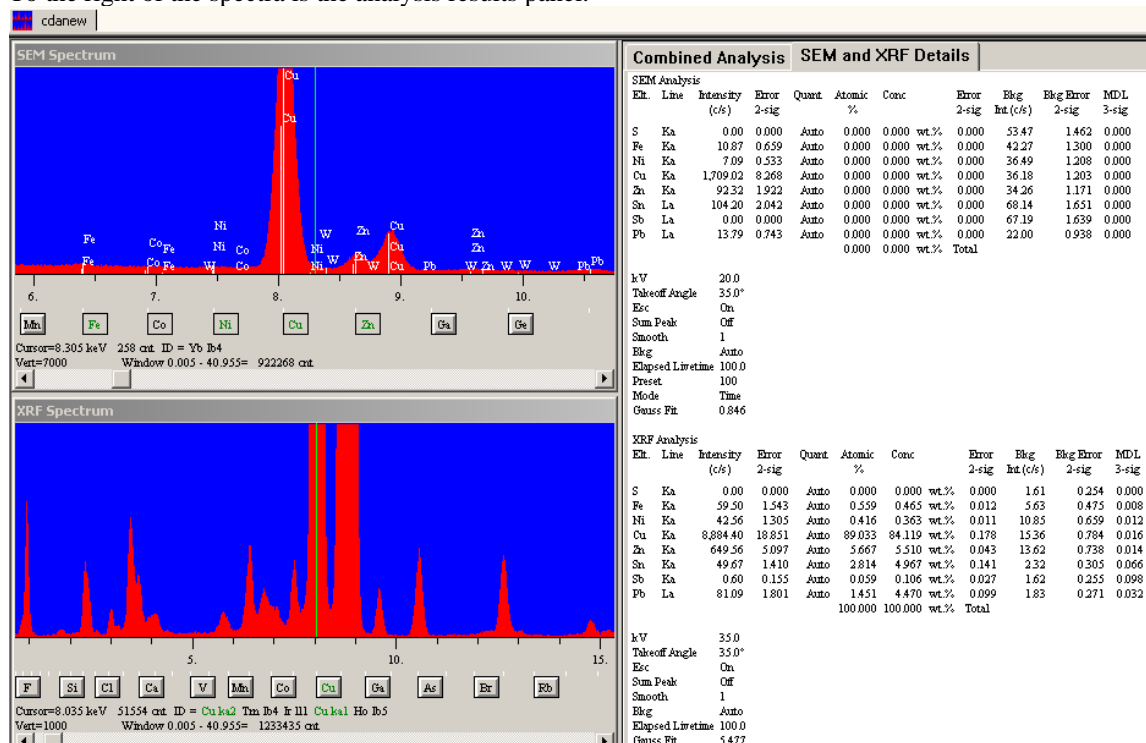

7.1 Acquiring Spectra

Each of the spectra must be acquired separately. Click on the Acquire button on the toolbar. A panel similar to the following will appear.

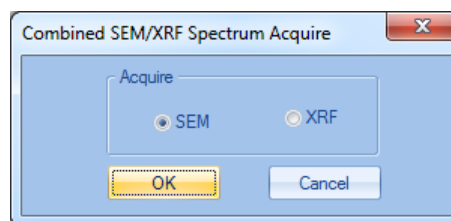

Select either SEM or XRF and pressing OK will start acquisition of the spectrum.

Prior to acquiring the spectra, be sure that the proper beam is turned on (SEM beam for the SEM spectrum, XRF source for the XRF spectrum).

To acquire the SEM spectrum, make sure that the XRF source is turned off, then right-click over the SEM spectrum and select **Acquire** from the menu.

To acquire the XRF spectrum, make sure that the SEM beam is turned off, then right-click over the XRF spectrum and select **Acquire** from the menu.

7.2 Identifying Peaks

Use the same tools for identifying peaks on these spectra as you use with other spectra. The only difference in the tools is that you must use the right-click menu on the spectra to view the Periodic Chart (**View/Periodic Chart**).


Elements identified in one spectrum are automatically added to the other spectrum; however the MLK markers are not automatically displayed on the other spectrum.

7.3 Quantifying Spectra

The Combined SEM/XRF quantitation has 3 unique quantitative methods. These are


- Auto. Uses ZAF and FP methods, selecting automatically which to use.
- LS-SEM. Uses a Least Squares calibration file applied to the SEM spectrum
- LS-XRF. Uses a Least Squares calibration file applied to the XRF spectrum.

To set the quantitation method, right-click on the spectrum and select Properties from the menu. Click on the Quantitation tab, and a panel similar to the following will appear.

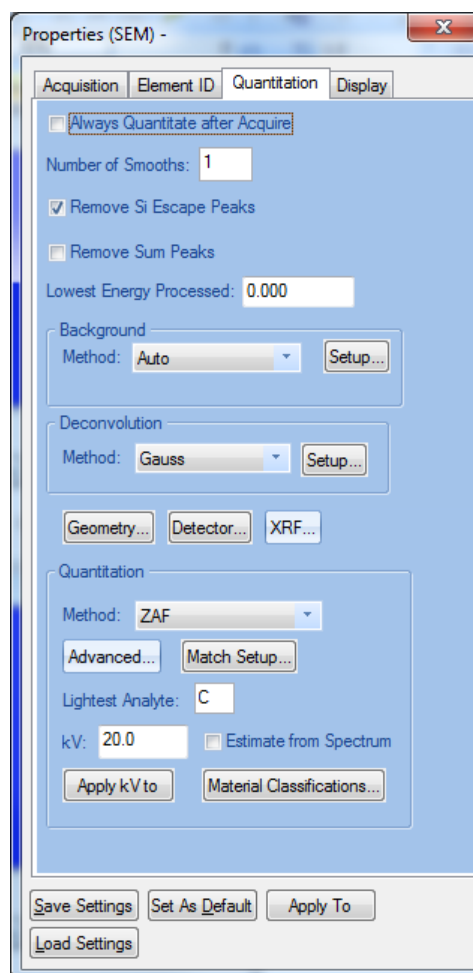

In the Quantitation section select **Method**. A panel similar to the following will appear.

Of course, if you want to quantify specific elements with ZAF or FP, this is always available. Clicking on the Advanced tab on the spectrum Quantitation panel shown above, will allow you to change individual element quantitation methods.

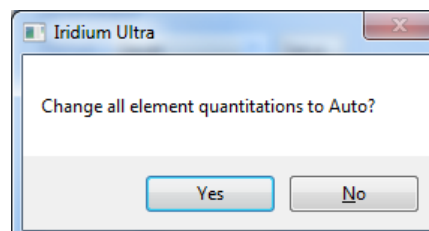

To quantify the combined spectrum, right-click on one of the spectra and select **Analyze**. After quantitation, the results panel will display the **Combined Analysis**.

Combined Analysis			SEM and XRF Details				
Combined Analysis							
Elt.	Line	Intensity (c/s)	Error 2-sig	Quant	Conc		Error 2-sig
S	Ka	0.00	0.000	None	0.000	wt.%	0.000
Fe	Ka	59.50	1.543	FP	0.693	wt.%	0.018
Ni	Ka	7.09	0.533	ZAF	0.252	wt.%	0.019
Cu	Ka	1,709.02	8.268	ZAF	81.581	wt.%	0.395
Zn	Ka	649.56	5.097	FP	6.326	wt.%	0.050
Sn	Ka	49.67	1.410	FP	5.858	wt.%	0.166
Sb	Ka	0.60	0.155	FP	0.125	wt.%	0.032
Pb	La	81.09	1.801	FP	5.164	wt.%	0.115
					100.000	wt.%	Total

The Combined Analysis is a summary analysis report. It give the final elemental and component analysis of the SEM and XRF spectra. Note in the example above that Ni and Cu were analyzed using **ZAF**, and the remaining elements by **FP**. S was not analyzed due to zero intensity, and is reported with analysis method **None**.

For details of the SEM and XRF, click on the SEM and XRF Details tab. This displays the complete analysis for both spectra. Below is an example.

Combined Analysis				SEM and XRF Details			
SEM Analysis							
Elt.	Line	Intensity (c/s)	Error 2-sig	Quant	Conc		Error 2-sig
S	Ka	0.00	0.000	Auto	0.000	wt.%	0.000
Fe	Ka	10.87	0.659	Auto	0.000	wt.%	0.000
Ni	Ka	7.09	0.533	ZAF	0.252	wt.%	0.019
Cu	Ka	1,709.02	8.268	ZAF	81.581	wt.%	0.395
Zn	Ka	92.32	1.922	Auto	0.000	wt.%	0.000
Sn	La	104.20	2.042	Auto	0.000	wt.%	0.000
Sb	La	0.00	0.000	Auto	0.000	wt.%	0.000
Pb	La	13.79	0.743	Auto	0.000	wt.%	0.000
					81.833	wt.%	Total
kV		20.0					
Takeoff Angle		35.0°					
Esc		On					
Sum Peak		Off					
Smooth		1					
Bkg		Auto					
Elapsed Livetime		100.0					
Preset		100					
Mode		Time					
Gauss Fit		0.846					
XRF Analysis							
Elt.	Line	Intensity (c/s)	Error 2-sig	Quant	Conc		Error 2-sig
S	Ka	0.00	0.000	Auto	0.000	wt.%	0.000
Fe	Ka	59.50	1.543	Auto	0.693	wt.%	0.018
Ni	Ka	42.56	1.305	ZAF	0.251	wt.%	0.008
Cu	Ka	8,884.40	18.851	ZAF	81.583	wt.%	0.173
Zn	Ka	649.56	5.097	Auto	6.326	wt.%	0.050
Sn	Ka	49.67	1.410	Auto	5.858	wt.%	0.166
Sb	Ka	0.60	0.155	Auto	0.125	wt.%	0.032
Pb	La	81.09	1.801	Auto	5.164	wt.%	0.115
					100.000	wt.%	Total
kV		35.0					
Takeoff Angle		35.0°					
Esc		On					
Sum Peak		Off					
Smooth		1					
Bkg		Auto					
Elapsed Livetime		100.0					
Gauss Fit		5.477					

8. Working With VP Spectra


When acquiring spectra in variable pressure mode (VP mode), quantitation of spectra needs to account for the effects of the gas in the chamber. To properly account for these effects, one should use the VP Spectrum for quantitation instead of a standard EDS Spectrum.

8.1 Enabling VP Quantitation


To enable this feature in the software, select Tools/System Setup from the menu and click on the Options tab. Select Enable VP Quantitation. After the selection, you must restart the software to complete the selection.

8.2 Acquiring VP Spectra

Select **File/New** from the menu. A panel similar to the following will appear.

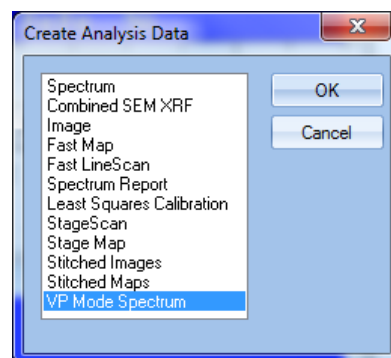


Select **VP Mode Spectrum**. A panel similar to the following will appear

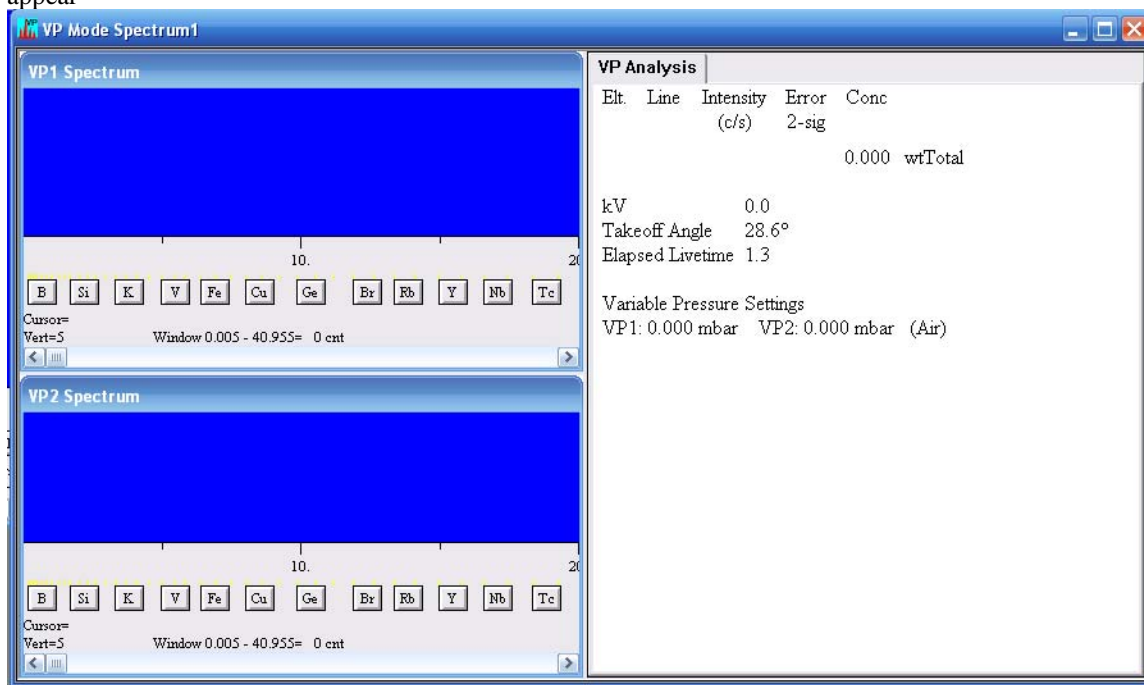


For VP quantitation, two spectra must be acquired at different pressures. In this panel, the two spectra are labeled VP1 and VP2.

To acquire the spectra do the following:

1. Select an appropriate pressure on the SEM for the sample.
2. Right-click over the VP1 spectrum and from the menu select Properties. A panel similar to the following will appear. Enter the VP Mode information (pressure, units, and Atmosphere).

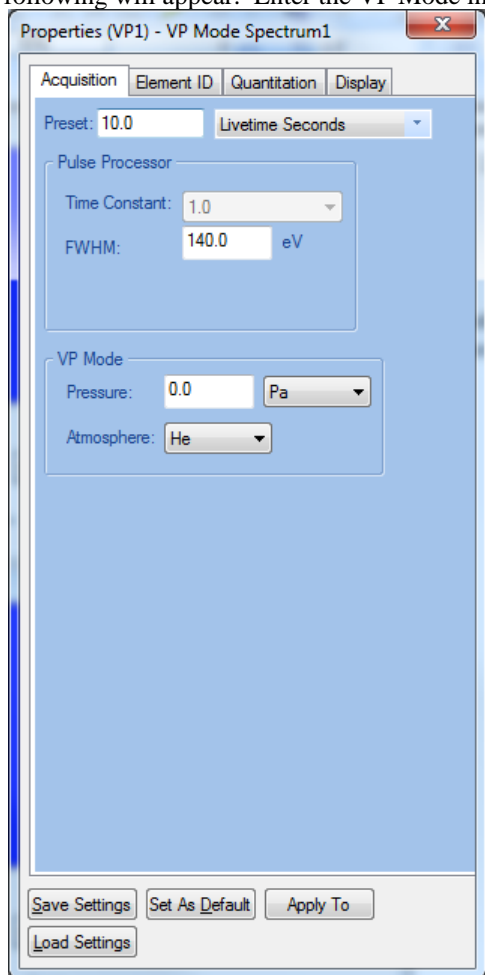

3. Click on the Acquire button to start spectrum acquisition. A panel similar to the following will appear. Select the Acquire spectrum (VP1 or VP2).
4. Repeat steps 1-3 for the VP2 spectrum.

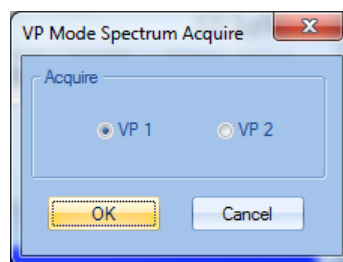


8.3 Quantifying VP Spectra

Quantitation is done by selecting ZAF as the quantitation method. The two spectra will be automatically processed. No other quantitation methods are presently supported with VP Spectra.

9. Working With X-ray Maps

X-ray maps are excellent tools for determining the location of phases, particles, and other features on a sample that can be discriminated by variations in elemental composition. An x-ray map is performed by rastering the microscope's beam over the sample. The scan area of the beam is divided into a rectangular grid of pixels. The beam is then sequentially positioned on each of these pixels and x-rays are acquired. The x-rays are displayed on the screen as rectangular images (maps), one for each element in the element list for the map. The maps display as gray-level images. The map for an element visually depicts the number of x-rays for the element at each pixel. As an example, this x-ray map displays the distribution of elements in a ceramic sample.

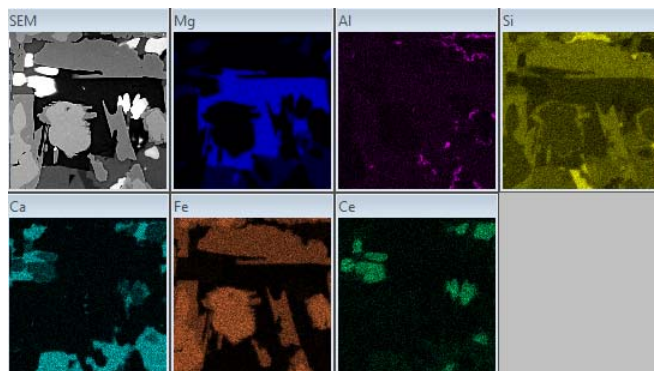

Our software provides an advanced type of X-ray map which is called FastMap. FastMaps acquire and display the x-ray maps for the elements in the element list, and also store information that allow for viewing the full spectrum from each pixel.

Below are the advanced features of the FastMap


- Ability to view “total” spectrum from the x-ray map
- Ability to view the spectrum from each pixel in the map
- Display a map for any additional elements desired without re-acquiring the x-ray map
- FastMaps can be saved with or without the spectral data. When stored with the spectral data, all of the features of FastMaps are retained in the data file. When stored without the spectral data, the data file is much smaller, but only the maps and the total spectrum can be viewed.

9.1 Acquiring An X-ray Map

9.1.1 Preparing the microscope and EDS system for acquisition

- Select an area on the sample for which you wish to acquire an x-ray map
- Optimize the microscope for acquiring the x-ray map. To do this, acquire a spectrum over the area to be mapped. As the spectrum is being acquired, adjust the microscope to get the highest count rate reasonable for the sample. This is important, because the beam will be moved rapidly from pixel to pixel during the x-ray map acquisition. High countrates will improve the quality of the x-ray maps. If the deadtime increases above 40%, select a shorter **Time Constant**. X-ray maps are typically acquired with a shorter time constant than that of spectra.


9.1.2 Creating and Acquiring the X-ray map

To start acquiring an x-ray map, click on the  button on the Toolbar. For integrated EDS systems, select an area on the image for the x-ray map. This is done using the mouse. Click the left mouse down to select a corner of the area, and then drag the mouse to the opposite corner of the area. As the mouse is dragged over the area, a rectangle will be displayed showing the area that will be mapped. Release the left mouse when finished with the selection. To cancel the selection, click the right mouse button.

Once the selection has been made, the x-ray map will begin acquisition. The element list used for the x-ray map is the default element list. The default element list can be set from the toolbar properties of any of the EDS buttons (spectra, x-ray maps, linescans).

9.2 Setting Acquisition Properties

The x-ray map acquisition properties should be optimized for the specific sample. To access the acquisition properties, select Properties from the x-ray map menu. The acquisition properties are found on the Acquisition tab of the x-ray map properties panel.

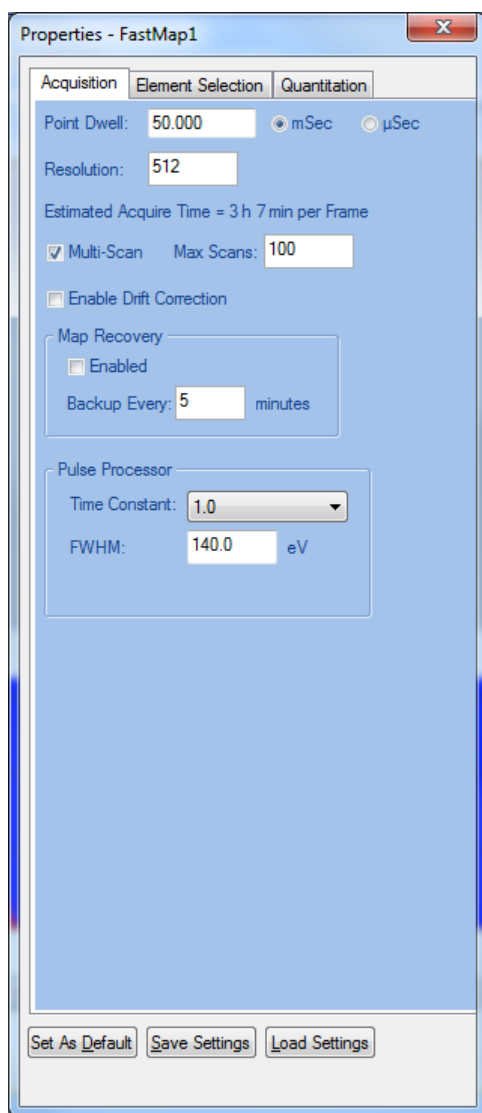

Point Dwell is the acquire time per pixel. The time is given in either milliseconds (mSec), or microseconds (μ Sec). Use microseconds when specifying short dwell times (e.g., below 1 mSec). Increasing the **Point Dwell** time will generally improve the quality of x-ray map, as larger number of x-rays will be accumulated for each point in the image. However, sample charging effects will be greater with longer times and the total time to acquire a complete frame will increase as well. For example, a 256 x 256 resolution x-ray map with a **Point Dwell** time of 50 mSec will take approximately one hour to complete a scan. If the **Point Dwell** time is reduced to 1 mSec it will take approximately 1 minute!


Multi-Scan, described later in this section, is a feature that overcomes these negative consequences of large **Point Dwell** times.

Note: **Point Dwell** should always be greater than 3-4 times the value of the **Time Constant** used for x-ray mapping. For example, for a **Point Dwell** time of 50 μ Sec, the largest **Time Constant** that should be used is 12.5 (50/4). The reason for this is ensure that the x-rays acquired for each point are actually from that beam position! A finite amount of time is required to process an x-ray through the electronics. This time is related to the **Time Constant**. Larger values of **Time Constant** require more time to process each x-ray.

The **Estimated Acquire Time** is the amount of time to acquire 1 frame (number of pixels in X times number of pixels in Y times dwell time/pixel). If Multi-Scan is enabled, then the total time to acquire the map is the estimated acquire time/frame x the number of scans (frames). All calculated times are approximate.

Resolution is the number of pixels across the longest side of the rectangular area of the x-ray map. If the area of the

x-ray map is a square, **Resolution** applies to both the vertical and horizontal sides of the rectangle. Larger values for **Resolution** will require more time for acquisition, but will also yield greater spatial resolution. For example, a 256-resolution square x-ray map with a pixel dwell time of 50 mSec will take approximately one hour to complete a scan. If the **Resolution** is reduced to 128 it will take approximately 14 minutes. The selection of **Resolution** should be made large enough such that the features that are being observed can be seen clearly and their positions accurately defined. Values larger than this add no additional information to the x-ray map.

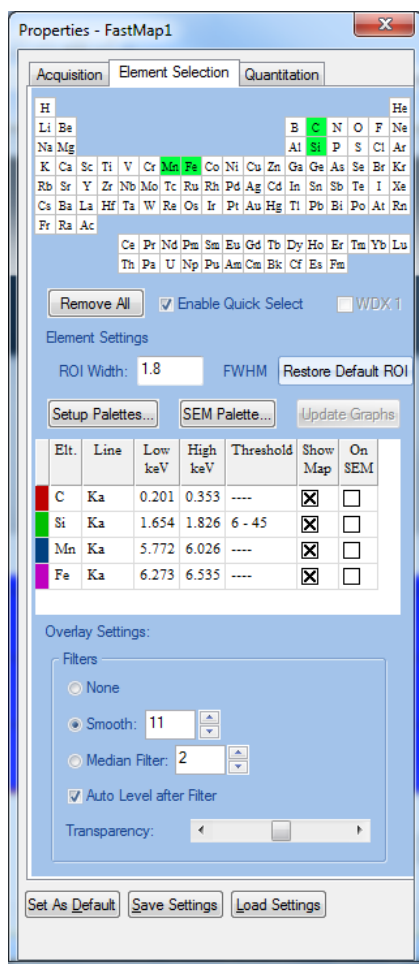

Multi-Scan acquires multiple scans (frames) of the x-ray map. The frames are summed together, producing ever-increasing quality in the x-ray map as the frames are acquired. **Max Scans** is the maximum number of frames that will be acquired. The acquisition can be stopped at any time, allowing the user to determine when the x-ray maps are of sufficient quality. For example, a **Point Dwell** of 100 (μSec) and **Resolution** of 256 (square) will complete a frame in about 7 seconds. If **Multi-Scan** is enabled and **Max Scans** is set to 500, the completed x-ray map will acquire a total of 50 mSec of data for each point. This is calculated as $100 (\mu\text{Sec} \times 500 = 50 \text{ mSec})$. The advantages of performing the x-ray map with **Multi-Scan** are:

- ❑ The x-ray map can be stopped at any time from 7 seconds to one hour (the time to complete all 500 scans). The user can select when the x-ray map has sufficient quality.
- ❑ Sample charging effects are minimized due to the rapid movement of the beam over the area being mapped.

Time Constant is set separately for spectra, x-ray maps and x-ray line scans. The **Time Constant** appropriate for this x-ray map (see “Preparing the microscope and EDS system for acquisition” above for details) should be set here. Also see the note under “**Point Dwell**” above about appropriate settings of **Point Dwell** and **Time Constant**.

Map Recovery is a feature used during acquisition which makes a backup copy of the acquisition which can be used if the acquisition is abnormally terminated. To setup Map Recovery select **Enable** and a backup period (**Backup Every**). If the map acquisition terminates abnormally, restart the EDS software and immediately select **Tools/Recover Fastmap File** from the menu. Note: starting a new FastMap acquisition will erase any previous

recovery information, so it is very important to recover the FastMap file immediately upon restarting the EDS software.

9.2.1 Returning to Acquisition Location

The microscope stage location is stored at the start of acquisition. To return the stage to the location of the previously acquired data, select **View/Go To Stage Location**. This will move the stage to the location where the data were acquired.

9.3 Setting Element Properties


The element list used for the x-ray map is the current element list from the last EDS acquisition. For example, if a spectrum was acquired and peaks were labeled, either manually or using automatic peak identification, the labeled elements will be the element list for the next x-ray map acquired.

Further refinement of this list can be done with the **Element Selection** tab of the **X-ray Map Properties**. To access the x-ray map properties select **Properties** from the x-ray map menu.

Above is the **Element Selection** tab. The elements that will be mapped are indicated on the periodic chart in either the **Always Present** color or the **Automatic Identification** color. Elements can be added and removed from the x-ray map element list via selection on this periodic chart.


When the **Enable Quick Select** option is enabled, elements can be added or removed from the map with the manual element ID features of the Sum Spectrum or the Maximum Pixel Spectrum. These tools include the Element labels on the horizontal axis of the spectrum as well as the Periodic Chart tool for the spectrum.

Remove All clears the element list.

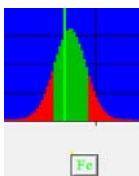

ROI Width is used to calculate the default ROI (integration region) for elements. By default, the element ROIs for maps and linescans is 1.8 FWHM around the peak center. To the left is an example of the ROI for Fe using one FWHM.

By setting the **ROI Width** to 2.0, most of the peak area is included in the map for Fe, as shown below.

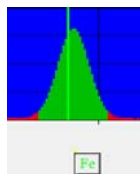

Restore Default ROI will return **ROI Width** to its factory setting.

Setup Palettes allows for configuration of the default palettes.

SEM Palette allows for changing of the display color of the SEM image.

If the ROI is changed for an element, the **Update Graphs** button is enabled. Clicking on this button will recalculate the maps using the new ROIs (integration regions).

The **Element Settings** table displays settings for each element including color, ROI (integration region), and display settings. Below is a description of the table settings.



Map Color

Click on the color block to the left of an element to change the map color.

Line

The line for the element map can be selected. The default ROI (integration region) will be selected, updating the Low keV and High keV settings. Note that the **ROI Width** is used to determine the default ROI.

Low keV High keV

The integration range for the element maps can be customized by changing these values.

Threshold

This column displays the intensity threshold for each element. In the example above, carbon has a threshold of 4 – 49 counts. Clicking on the **Threshold** column for an element displays the histogram from the element. See the section View Histogram on page 102 for details on setting the threshold.

Show Map

If this is selected, the element will have a separate panel displaying the element. This is set by default if the display mode is **Individual Maps Display**. If the display mode is **Overlaid Maps Display**, selecting this option will display a separate panel for this element.

On SEM

If this is selected, the element is overlaid on the SEM image. This is set by default if the display mode is **Overlaid Maps Display**. If the display mode is **Individual Maps Display**, selecting this option for the element will overlay the element on the SEM image.

The Element Settings table allows you to modify which elements are displayed as individual maps (**Display Map**) or overlaid on the SEM image (**Overlay Map**). **Thresholds** for each element can also be selected by clicking on the Threshold column for an individual map. The map histogram is displayed and a threshold can be set for each element.

Overlay Settings control how the overlaid maps are displayed. A filter can be applied to the maps. A **Gaussian Smooth** or **Median Filter** can improve the appearance of the maps. The size of the filters can be controlled; larger values produce a more pronounced effect on the maps. **Auto Color Leveling** can be applied to the maps as well. **Transparency** controls the combining of the maps with the SEM image. The combination can be controlled from opaque maps (no SEM image visible) to transparent maps (no maps visible).

Note: If the x-ray map has been loaded from a disk file and the spectra data have not been stored in the file, it will not be possible to produce maps for new elements.

Adjusting Color Palettes for X-ray Maps


The color palettes for each element and the SEM image can be adjusted. Adjustments in the contrast and brightness of maps can reveal subtle details in the maps that are not visible with the default settings. Each element and the SEM image have a separate color palette, contrast, and brightness settings.

Elt.	Line
C	Ka

The color palettes for elements are adjusted in the Element Selection tab of the Properties panel. To adjust the color palette, click on the button to the left of the element symbol, as shown above for carbon. The following panel will be displayed. Adjusting the contrast and brightness can reveal hidden detail in the maps. Increasing contrast will tend to reveal small variations in the x-ray map. Areas that appear to be of the same intensity, but actually have small variations will be more visible. Increases of contrast may require a decrease in brightness, so as not to saturate the x-ray map.


Color palettes can be created by:

- ❑ **Pseudo Gray.** A color palette is created from a base color. The palette spans through the base color from a starting color of black (least intense), through white (most intense).
- ❑ **Thermal.** A color palette based upon a thermal color scale is constructed.
- ❑ **RGB.** A color palette is constructed which spans the Red Green and Blue ranges specified. The ranges are given as numbers between 0 (least bright) to 255 (most bright).

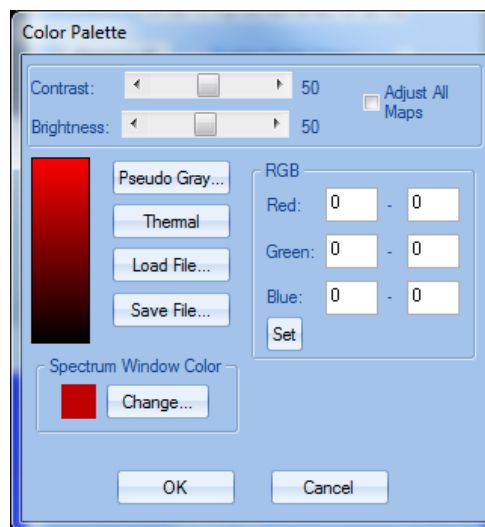

9.3.1.1 Pseudo Gray Color Palettes

To create a Pseudo Gray color palette, click on the **Pseudo Gray** button. The following Windows color selection dialog will appear.

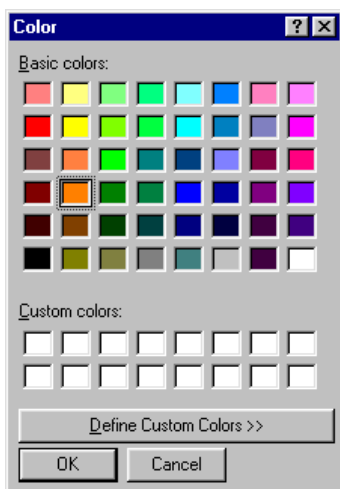

Select a color. This will be the base color for the palette. In this example, an orange color has been selected. The color palette will be constructed such that the least intense areas of the map will be black. As the intensity in the map increases, increasingly brighter shades of the base color will appear. The most intense areas of the map will be white. Below is an example of the orange color palette, created from the selection to the left.



9.3.1.2 Thermal Color Palette

To create a thermal palette, click on the Thermal button. The following palette will be constructed and displayed in the dialog.

9.3.1.3 RGB Color Palette



To create a RGB color palette, first select ranges of **Red**, **Green**, and **Blue** for the palette. Next, click on the **Set** button. Shown here are ranges for an inverted red palette...

...and this is the palette created by these ranges. In this color palette, only the color Red is used. For the least intense values in the map, the brightest red value (255) is used. Likewise, for the most intense value in the map, the least bright value (0) is used.




9.3.1.4 Color Palette Files

Default color palettes are used when creating new x-ray maps. The default color palettes are stored in files in the directory that the EDS application is installed. The files are named defpal1.plt, defpal2.plt, ... defpal8.plt. These files are provided with the application, but can be replaced with color palettes created by the user.


Two functions in this dialog allow for viewing and saving these color palette files. These are the **Load File** and **Save File** functions.

To view a color palette file, click on the **Load File** button. A dialog similar to this will appear.

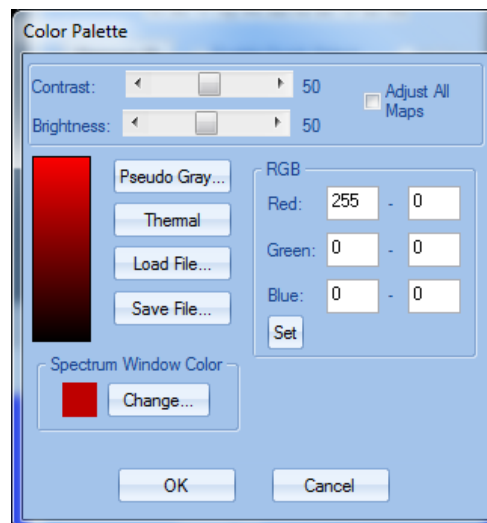


Select a file from the list and click **Open**. The color palette will be displayed in the dialog, as shown below. This is the file defpal1.plt.

Note: the color palette files are stored in the folder c:\ixrf\palettes.

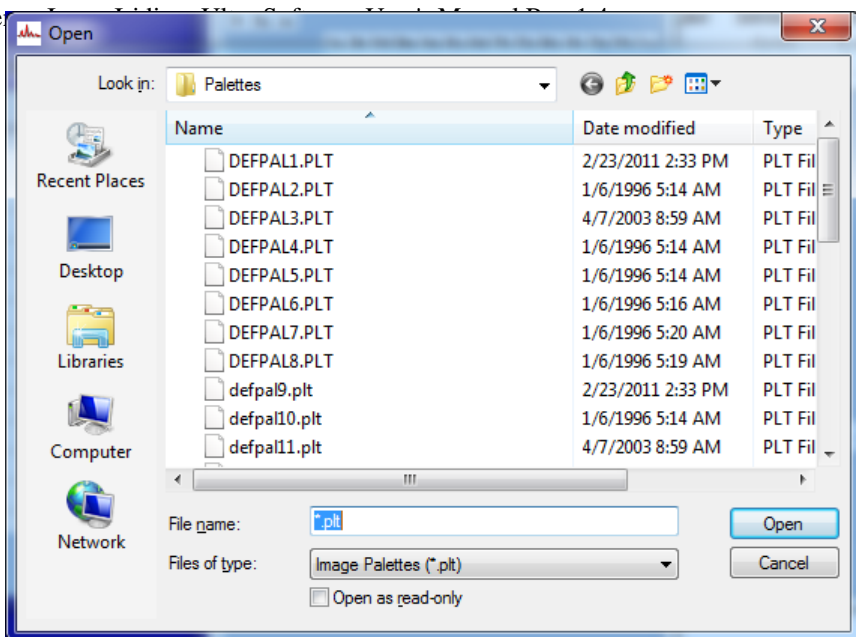

To replace one of the default palette files with the present color palette, click on the **Save File** button. A dialog similar to the following will appear.

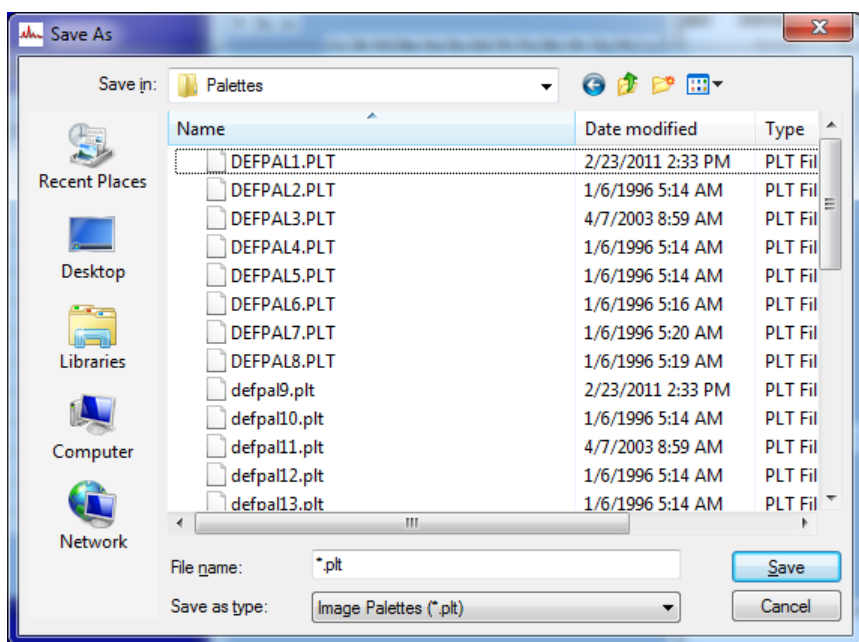



Select the color palette file that you wish to replace from the list and click on the **Save** button.

9.3.2 Setup Palette Files

By default, the palette files are assigned to elements in sequential order (e.g., defpal1, defpal2, defpal3) as elements are added to the map. Using the **Setup Palettes** panel allows for assigning a specific color palette to an element. To access the Setup Palettes panel, click on **Setup Palettes** on the **Element Selection** tab of the Properties panel, as shown.

A panel similar to the following will appear.

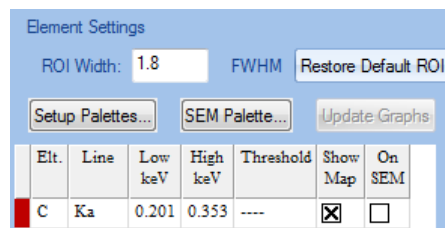

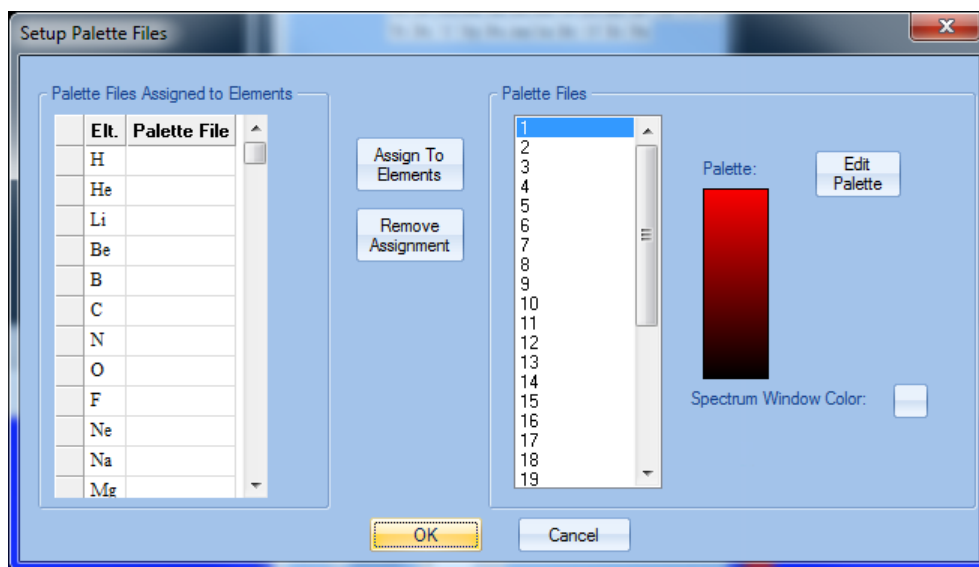

To assign an element to a palette:

1. Select the element(s) in the list on the left side panel by clicking on the gray button to the left of the element name.
2. Select a palette from the list on the right side of the panel. As you select the palette it will be displayed in the box to the right of the list of palettes.
3. Click on the **Assign to Elements** button. This will assign the elements selected in step (1) to the palette file selected in step (2).


To remove an assignment of an element to a palette:

4. Select the element(s) in the list on the left side panel by clicking on the gray button to the left of the element name.
5. Click on the **Remove Assignment** button.

You can also edit the palettes in this panel. To edit a palette:

1. Select a palette from the list on the right side of the panel.
2. Click on the Edit Palette button. A panel similar to the following will appear. This panel is described above in section 7.4.

9.4 Spectral Imaging

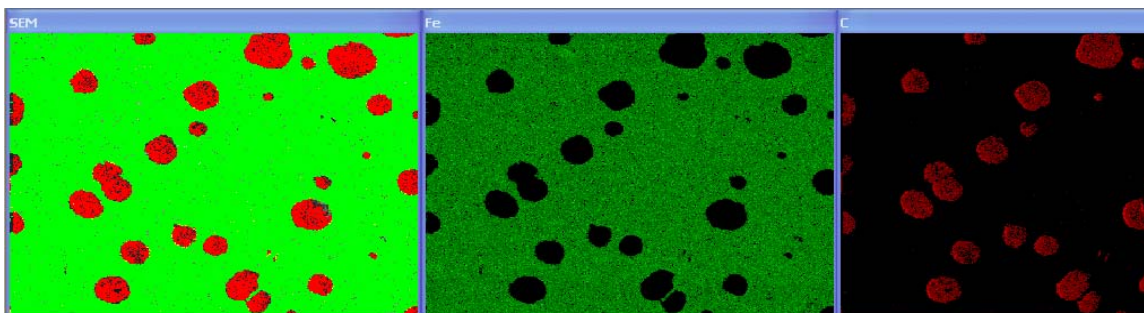

Spectral Imaging provides a multi-element overlay over the SEM image in a FastMap. Above is an example of a typical Fastmap with spectral imaging. Notice that the panel that normally displays the SEM image is colorized and has overlays corresponding to the iron and carbon maps.

Some of the key features of spectral imaging are:

1. Overlays dynamically update during FastMap acquisition.
2. Element overlays can be added/removed dynamically during acquisition.
3. The element overlays utilize the threshold settings to improve the overlay display.

There are two basic display modes for FastMaps:


1. **Individual Maps Mode.** This is the typical display mode, where all elements are displayed in individual panels in the FastMap window.
2. **Overlaid Maps Mode.** No individual maps are displayed. Only the SEM image is displayed. Elements can be overlaid on the SEM image.

Selection of the display mode is done with the menu items: **View/Individual Maps Mode** and **View/Overlay Maps Mode**. The last selected display mode is retained for subsequent new FastMaps. The display mode is also retained in each FastMap file, so each map will be displayed as they appeared when they were saved.

The **Element Selection** property panel (refer to section 9.3, page 96), allows for selection of display mode and threshold for each element, and overlay settings on the SEM image.

9.5 View Histogram

Histograms for each element can be displayed with the **View/Histogram** menu item or on the **Element Selection** property panel for the FastMap. Shown below is a histogram for Fe.

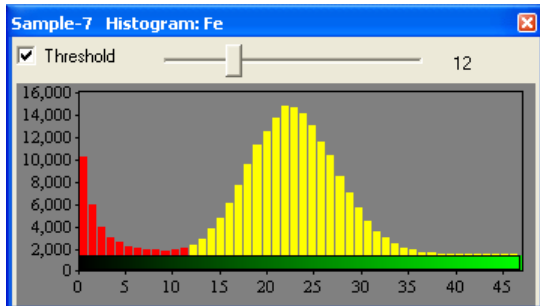

The histogram display has a colorbar (green in this example) at the bottom showing the correlation between intensities and color in the map.


Each map has a threshold setting for display. Initially this threshold is disabled, so all intensity levels are displayed in the map and overlay. Sometimes it is useful to display only a given range of intensities, for example to exclude very low levels of intensity.

To enable a threshold, select **Threshold**, as shown above. When first selected, the threshold is shown as the full range of values in the map. Using the slider, you can select a minimum threshold for the intensity. The values displayed are colored yellow in the histogram. As the user modifies the threshold, the map and overlay on the SEM image are updated.


9.6 The Sum Spectrum and Maximum Pixel

The Sum Spectrum records all x-rays that have been acquired during the map acquisition, thus it is the sum of all x-rays from all pixels in the map. The Summation Spectrum is sensitive to the dominant features of the data cube.

The Sum spectrum is always available in the display area below the maps, as shown below.

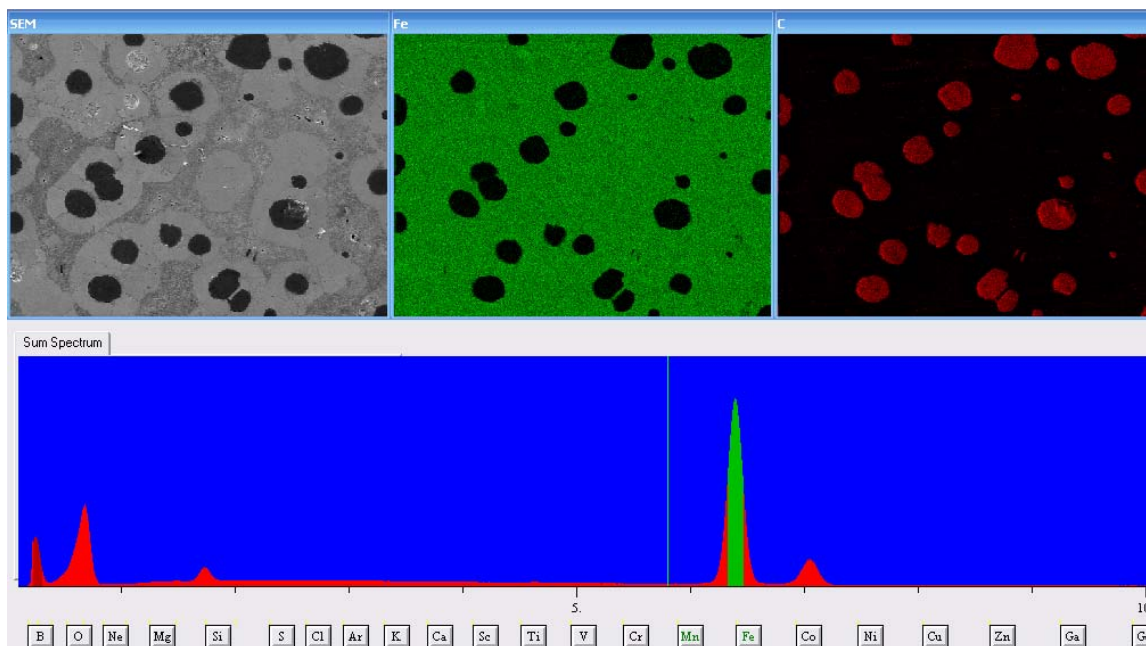

The Maximum Pixel Spectrum is calculated and displayed with the menu item **Process/Maximum Pixel Spectrum**. It can be used to detect elements that are only present in a few pixels in the map. The Maximum Pixel Spectrum is a spectrum comprised of the maximum x-ray intensity from all pixels in the map. For example, the intensity in the spectrum at 6.4 keV is the maximum intensity found at 6.4 keV from all of the pixels in the map. This pseudo-spectrum has the principal characteristics of a real spectrum so that x-ray peaks corresponding to highly localized trace constituents or foreign contaminants, even those that are confined to one pixel of the image, can be seen at a glance. Below is an example of a Maximum Pixel Spectrum.

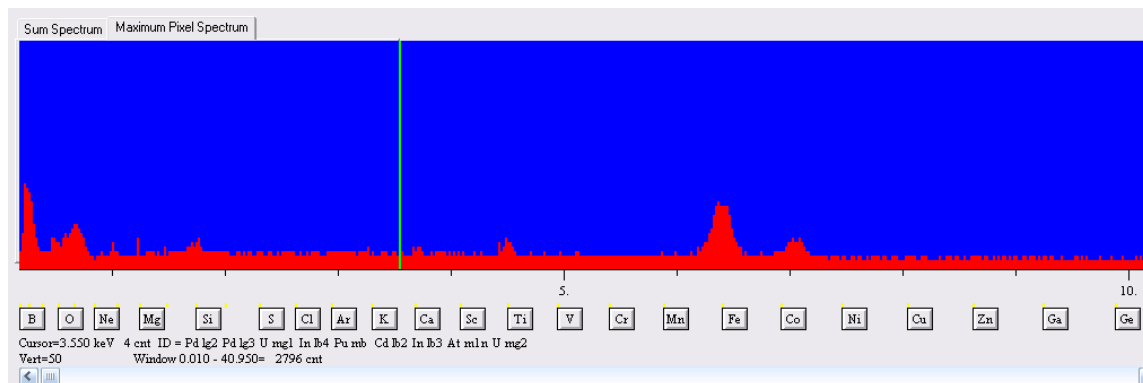


9.6.1 Element Selection

Both Sum Spectrum and Maximum Pixel Spectrum can be used to directly add or remove element maps to the display. All of the manual peak identification techniques used on these spectra will invoke a feature to add/remove the selected element. For example, clicking an element label button below the spectrum, or using the Periodic Chart tool of the spectrum will automatically add/remove the selected element.

9.7 Exporting X-ray Maps

X-ray map files can be exported to a wide selection of industry standard image file formats (JPEG, TIFF, BMP, etc). Selecting **File/Export** from the menu displays a standard file panel with the following additional selections.

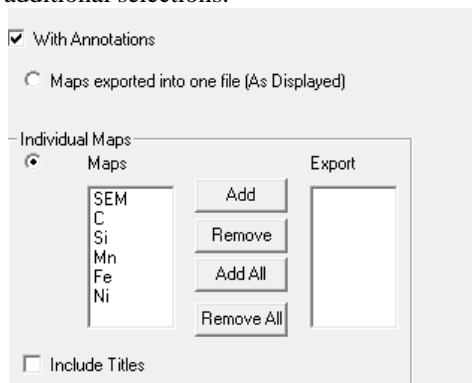

The x-ray maps can be exported in two basic formats:

- In a single file, combining all x-ray maps as displayed on the screen
- Individually

Export into one file

To export the x-ray maps into a single image file that is similar to the displayed maps, select **Maps exported into one file**. Enter a **File name** and click on the Save button to export the x-ray maps.

Export Individually


To export individually, select **Individual Maps**. Then select from the Maps list the elements that you wish to export using the **Add** or **Add All** to add to the list of exported maps. **Remove** and **Remove All** will remove the selected maps from the exports list. The maps can have **titles** at the top of the images or not.

Enter a **File name** for the images. The actual file names will have the element name appended to the file name. For example, if the file name was TestSample, the names of the image files would be TestSample-SEM, TestSample-O, TestSample-Cr, etc.


Click on the **Save** button to finish and export the x-ray maps.

9.8 Viewing Intensity/Composition of Points on X-ray Maps

Selecting **View/Element Intensities** from the menu to inspect the x-ray data of individual pixels (points) in the maps. The following panel will appear:

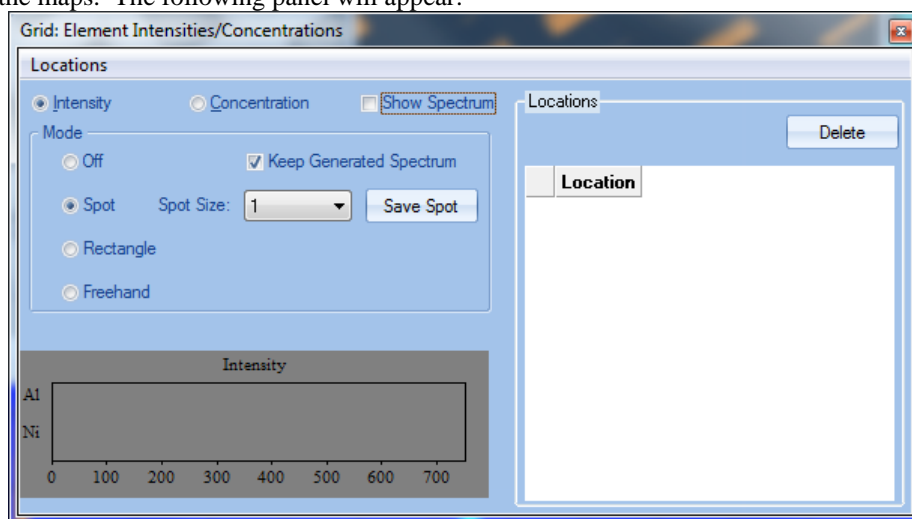

Click anywhere on a map to select a location to inspect the x-ray intensities at that point, as shown below.

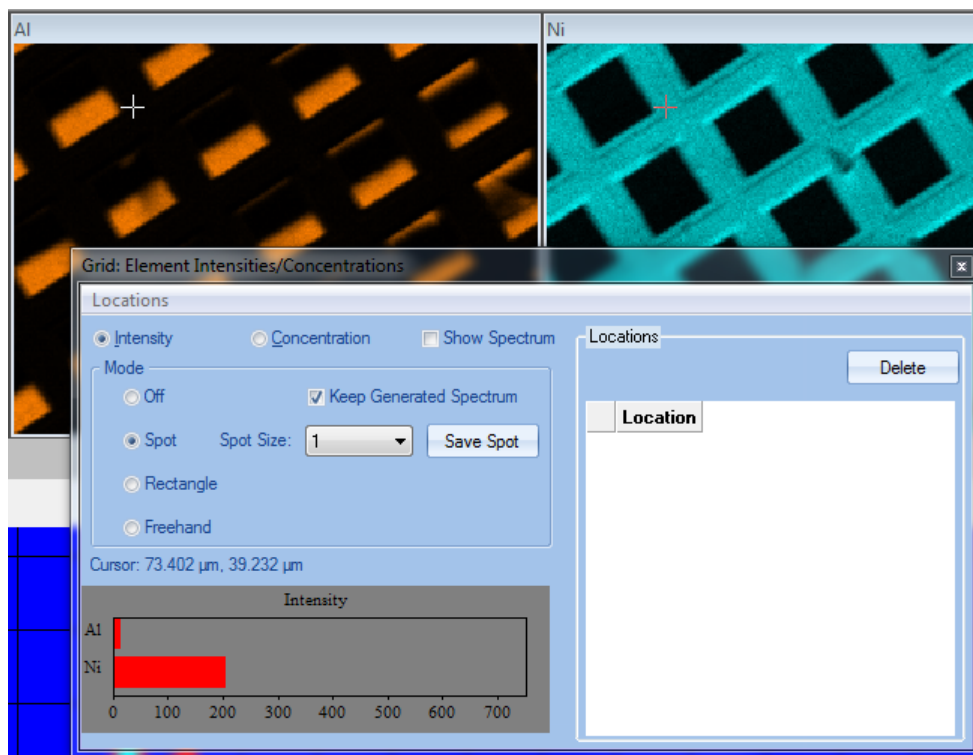

The panel now displays a histogram of the intensity of each element at the selected point.

9.8.1 Modes

There are 3 active modes to view the x-ray map data: **Spot**, **Rectangle**, and **Freehand**. These modes are described below, along with the inactive (**Off**) mode. The Intensity or Concentration selector determines the values that will be displayed in the histogram and the Locations list (described later).

9.8.1.1 Off Mode

No interaction with the x-ray maps. This mode is set after a Rectangle or Freehand has completed, and after a Save Spot operation completes.

9.8.1.2 Spot Mode

With the left mouse button pressed over an x-ray map or the included microscope image, the intensities or concentrations from the spot are displayed in the histogram. If **Show Spectrum** is selected, the spectrum for the location on the x-ray map will be displayed below the x-ray maps.

Spot Size can be set to a value larger than 1 so as to include adjacent pixels in the spot intensities. The values for **Spot Size** are:

9.8.1.3 Spot Size	9.8.1.4 Description
1	The single pixel at the spot location
3	3 x 3 grid of pixels. The spot location is the center pixel of the grid.
5	5 x 5 grid of pixels. The spot location is the center pixel of the grid.
7	7 x 7 grid of pixels. The spot location is the center pixel of the grid.
9	9 x 9 grid of pixels. The spot location is the center pixel of the grid.
11	11 x 11 grid of pixels. The spot location is the center pixel of the grid.

The **Save Spot** option will store the spot location on the maps, create a spectrum file from the spectra at the spot location, and add the location to the **Locations** list. Thus, the spot data can be reviewed similarly to the **Rectangle** and **Freehand** data. If **Show Spectrum** is selected, a spectrum for the location will be created and displayed.

9.8.1.5 Rectangle Mode

When selected, the user can select a rectangular area on any of the maps or image. After completing the selection, the spectra from the selected area are added together. A spectrum is created, it is analyzed, and the intensities or concentrations are displayed in the histogram. The rectangle location is labeled and displayed on all of the maps and the image. The labeled data are added to the **Locations** list below the histogram. If **Show Spectrum** is selected the spectrum is created from the area and displayed.


9.8.1.6 Freehand Mode

When selected, the user can select an arbitrary area on any of the maps or image. After completing the selection, the area is closed by connecting the last pixel selected to the first pixel selected. Then the spectra from the selected area are added together. A spectrum is created, it is analyzed, and the intensities or concentrations are displayed in the histogram. The freehand location is labeled and displayed on all of the maps and the image. The labeled data are added to the **Locations** list on the histogram. If **Show Spectrum** is selected the spectrum is created from the area and displayed.

9.8.1.7 Locations List


When one or more **Rectangle**, **Freehand**, or **Saved Spots** have been created on the x-ray map, the **Locations** list is visible on the right side of the panel. If the list is not visible, grab the border of the panel and drag to the right to show the list of locations. The **Locations** list displays the **Rectangle**, **Freehand**,

and **Saved Spots**. Below is an example of the locations list with three locations. Selecting a location from the list will re-display the histogram data for that location. **Intensities and Concentrations** are available for display in the histogram, and are also displayed in the **Locations** list. Locations can be deleted from the list by selecting one from the list and clicking on the **Delete** button.

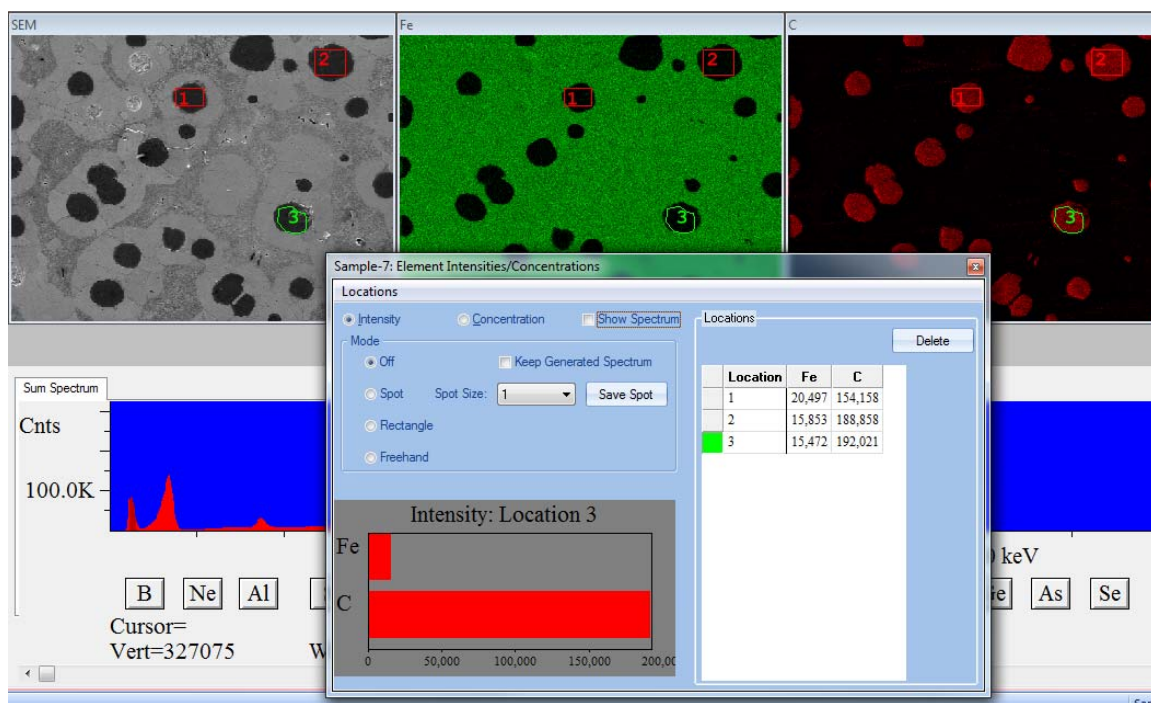


9.8.2 Locations Menu

The locations menu at the top of the panel can be used to print the locations list, copy it to the Windows clipboard, or export it to TAB delimited text file.

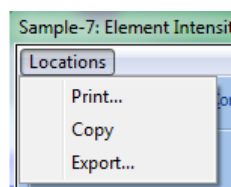


Selecting **Concentration** in the panel will apply ZAF corrections to the intensities and re-display the histogram with these calculated values in weight percent, as shown. The **Locations** list will also display concentrations.

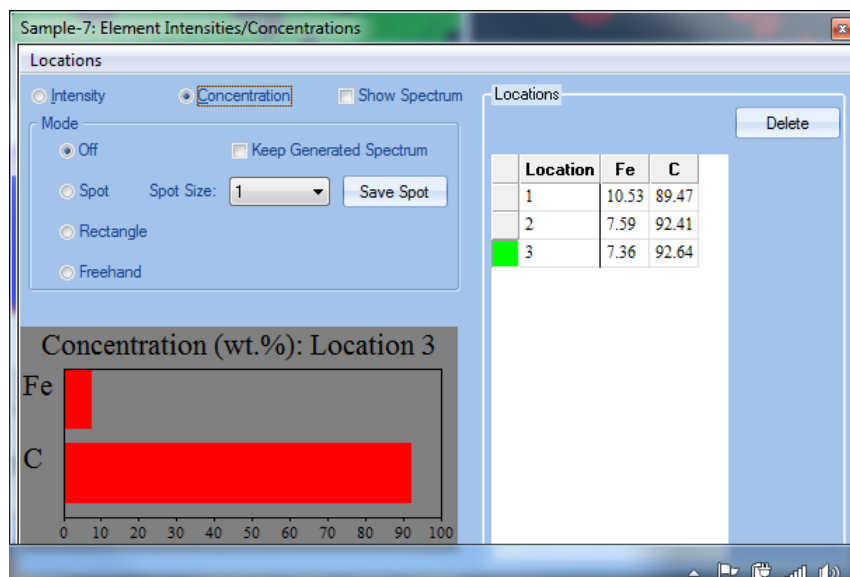


 
9.9 Overlaying X-ray Maps (Composites)


X-ray maps can be overlaid to reveal relationships of combinations of elements and the SEM image. The map formed by overlaying the elements is referred to as a Composite map. Below is an example of Fe and C overlaid on the SEM image.

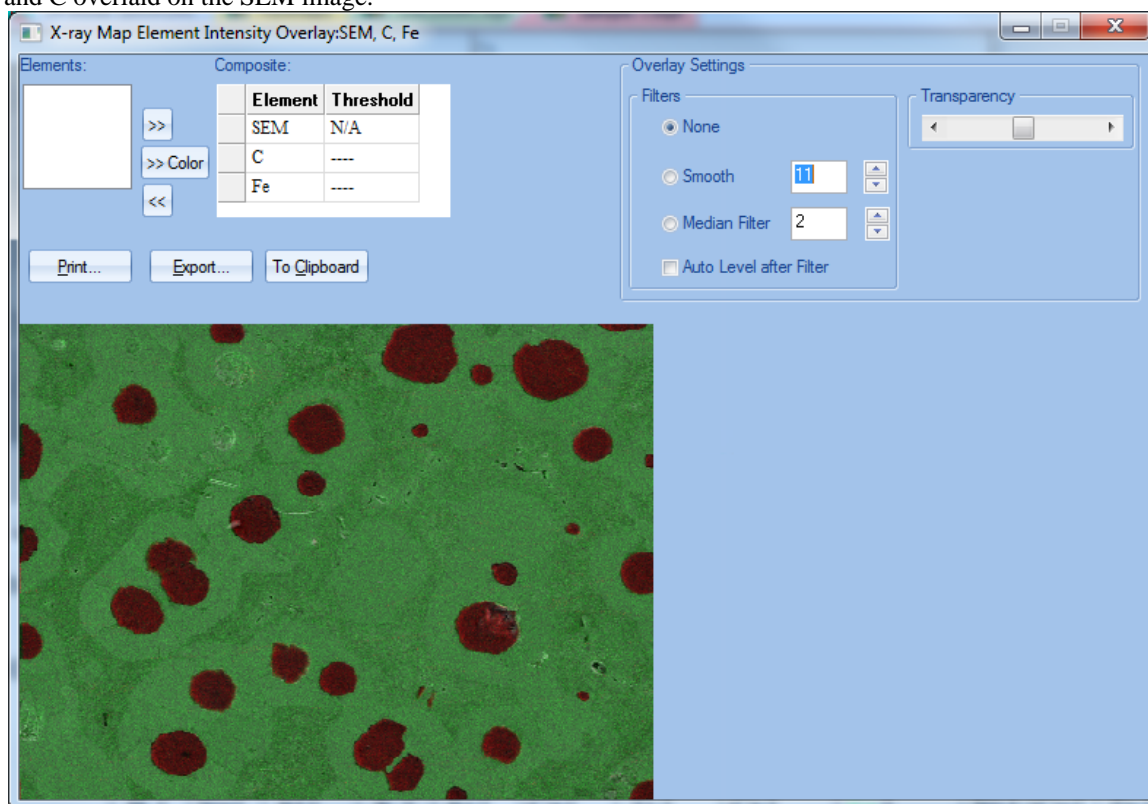


Selecting **View/Overlay Elements** from the menu, the following panel appears.

Selecting from the list of **Elements** on the left of the panel and clicking on one of the following buttons will overlay elements:

  This button adds the selected element to the **Composite**. The color used for the element is the next default color available. There are three default colors; Red, Green, and Blue. They are selected in that order. When all three default colors have been used in the **Composite**, only the  button (described below) can be used to add more elements.

 This button adds the selected element to the **Composite** using any color. The following standard Windows color selection dialog will appear. Select a color for the element using this dialog.

The  button is used to remove an element from the Composite. Select an element from the **Composite** list and then click this button to remove it.

Each element in the **Composite** has a threshold. The threshold selects a minimum x-ray count in the map for display of a pixel from the element. A common use of threshold is to determine a “background” level for an element. By default, the threshold is set to 0, which will overlay any intensity from the element on the **Composite**. By increasing the threshold for an element, any pixels with




counts below the threshold will be excluded from the **Composite**. To change the threshold for an element, click on the threshold column of the table in the row of the element you wish to change. The histogram will appear for the selected element. You can modify the threshold for the element as described in the section **View Histogram**.

Overlay Settings are identical to those found on the Element Selection tab of the FastMap properties. Refer to section 9.3 on page 96 for details.


The composite map can be **exported** to a graphics file, **printed**, or **copied** to the Windows clipboard.

9.10 Element Quantitative X-ray Maps

Individual element x-ray maps calculated from quantitative analysis on the maps can be generated.

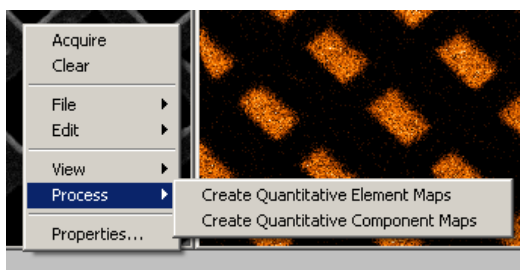

Select **Process/Create Quantitative Element Maps** from the menu. A panel similar to the following will appear.

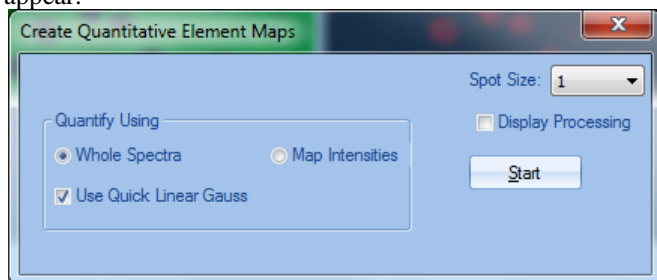

Whole Spectra processes the spectra for each pixel in the map. Full spectrum processing is performed. This is the recommended option.

Map Intensities uses the map intensities directly in the ZAF corrections. No background or overlap corrections are performed.

Use Quick Linear Gauss enables an optimized linear Gaussian deconvolution. This option can be used for most maps, and significantly improves the speed of quantitation.


Spot Size sets the pixel size for the processing. It is best to examine spectra from points on the map using View/Intensities and Concentrations to get a good idea as to the total counts in the spectra of the map. Increasing the spot size will combine adjacent points' spectra to create a spectrum with more total counts and usually better formed peaks. This can be important when performing background and overlap corrections.

When **Display Processing** is selected, the individual pixel spectra are displayed during quantitation. This could be useful for setting up the quantitation and diagnosing quantitation issues, but it slows down the process of creating the map by 20%. De-selecting this option will create the maps in a shorter time period.

Start. Click on **Start** to begin the quantitation of the maps. The button will change to **Stop**. Pressing this button will cancel the quantitation process.

9.11 Component Quantitative X-ray Maps


Individual component x-ray maps calculated from quantitative analysis on the maps can be generated.

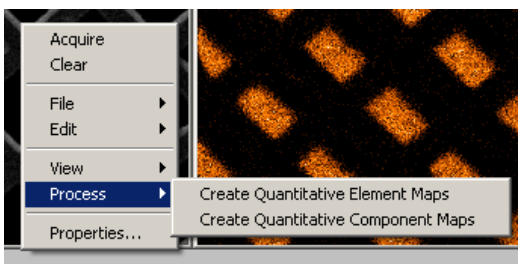

This feature will produce maps of the components (e.g., oxides) that have been set up in the x-ray map quantitation properties.


Select **Process/Create Quantitative Component Maps** from the menu. A panel similar to the following will appear.

This panel is identical in function to the Element Quantitative x-ray maps above.

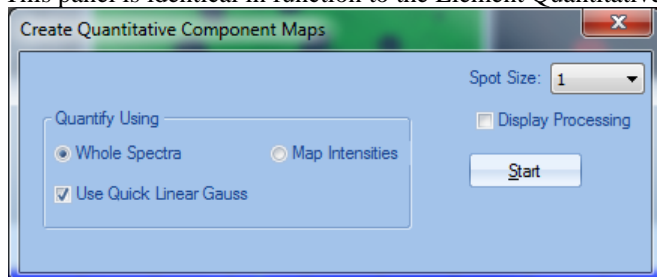

9.12 Viewing Quantitative Maps


To select viewing of the Intensities, Quantitative Element, or Quantitative Component maps use the View menu, as shown below.

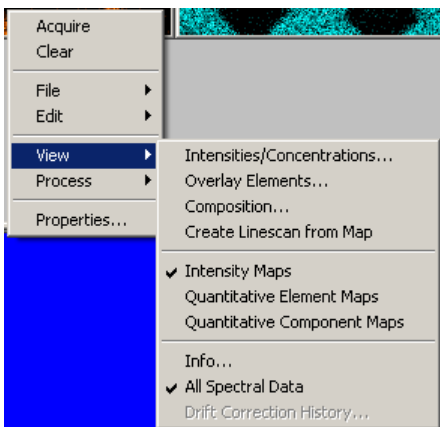

9.13 Quantifying X-ray Maps (Composition)

Composition analysis of x-ray maps is designed to find locations on a map that contain specified elemental concentrations. Quantification is performed on each pixel (point) in the map, and the calculated elemental concentrations are compared to the specified concentrations. The pixels that match the specification are then displayed in a separate map. To perform the composition analysis, select **View/Composition** from the menu. The following panel will appear.

Below is the new X-ray Map Composition Tool panel.

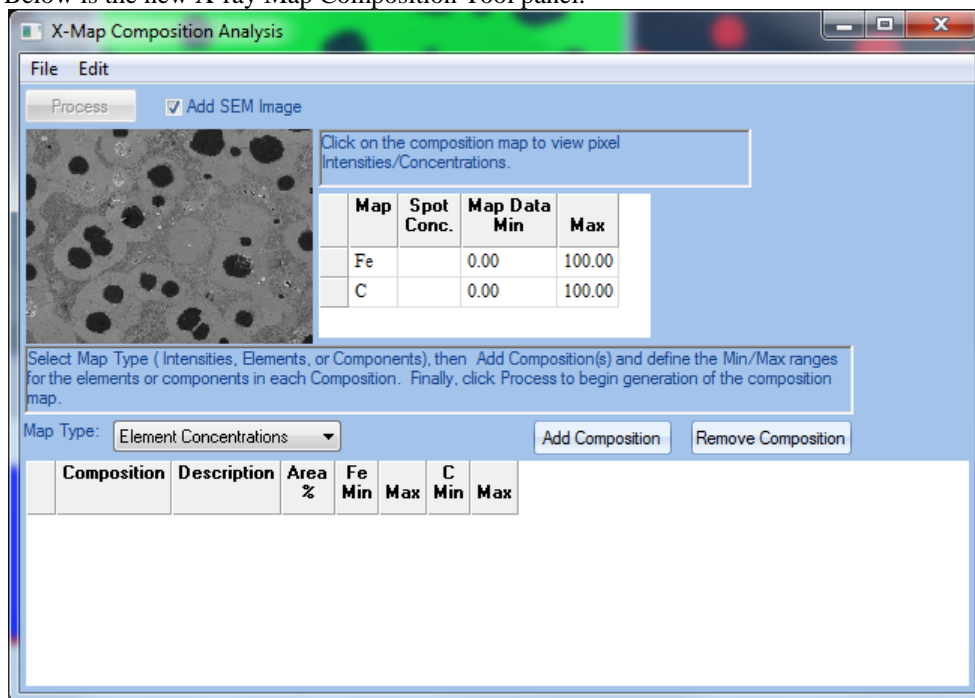

The panel has a menu. The menu items are:

File/Load Min/Max Settings. The composition settings can be saved and loaded, to support repeatable processing of maps.

File/Save Min/Max Settings. This saves the composition settings.

File/Print. This prints the image and the composition analysis.

File/Export. This exports the image and composition analysis to a bitmap file.

Edit/Copy. This copies the image and composition analysis to the clipboard to support pasting into another application.

Process. This starts the processing of the image. If concentration maps are required and don't exist, they are created as well.


View/Add SEM. This overlays the SEM image on the composition maps.

The composition tool can work with intensity maps, element concentration maps, or component concentration maps. This is selected from the list below the displayed image, as shown below.



A map Composition is a set of intensity/concentration ranges. Map compositions typically relate to phases or element distributions in the sample. In this example, there are two compositions, aluminum stub and nickel grid.

To begin the composition analysis, you must first define the compositions that you wish to view. Each composition is added with the **Add Composition** button. Clicking on the **Add Composition** button will display a panel similar to the following.

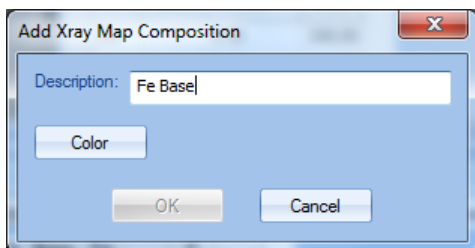

The description can be any text. In our example, we use Fe Base. Each composition must also have a color associated with it. This will be the color that will be used to show the composition on the composition map.

Click on the **Color** button and a panel similar to the following will appear.



Select a color for the composition from this palette of colors. It is best to select colors that are distinct from the other compositions that you are defining for this sample.

Below is the completed list of compositions for the sample.


Composition	Description	Area %	Fe Min	Fe Max	C Min	C Max
	Fe Base	0.0	0.00	0.00	0.00	0.00
	Carbon	0.0	0.00	0.00	0.00	0.00

Now we must set up the ranges (min/max) for the compositions. To do this, enter the numbers in the table. Below is an example for this sample.

Composition	Description	Area %	Fe Min	Max	C Min	Max
	Fe Base	0.0	10.00	100.00	0.00	0.00
	Carbon	0.0	0.00	0.00	10.00	100.00

For a composition, it is not necessary to have all element ranges specified. In this example, only Fe is defined for the Fe Base, and only C is specified for the Carbon. This is indicated by the color of the numbers in the table.

After setting up the compositions, you can process the maps to create the composition analysis map. To do this, click the **Process** button. Below is the processed image.

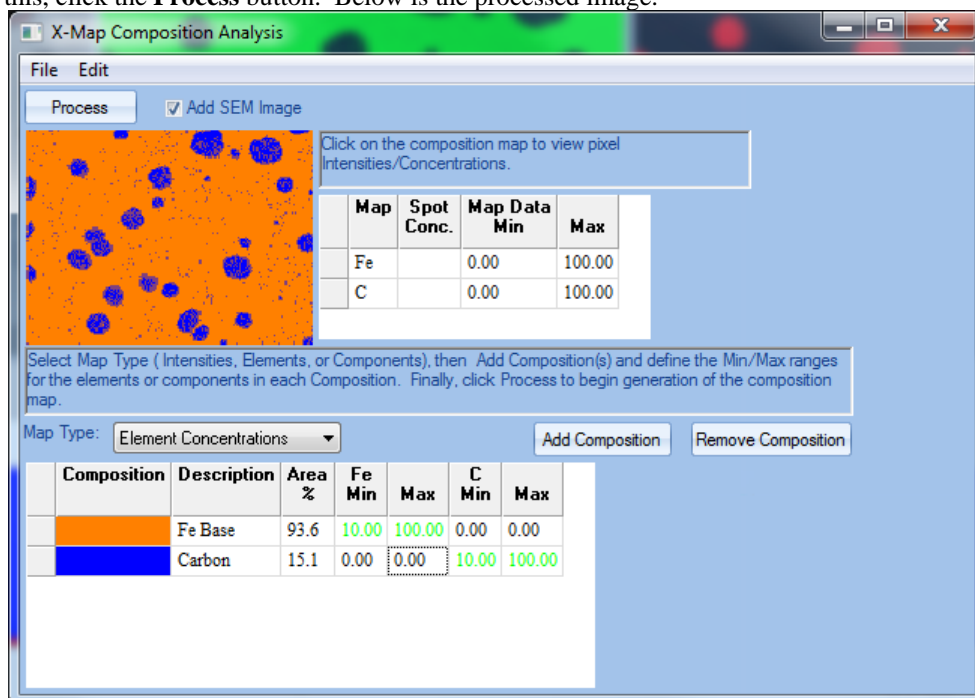


When you click on the image, the table to the right of the image displays the value at that point on the map in the **Conc** column. It also displays the minimum (**Min**) and maximum (**Max**) values for each of the maps. This can be useful when determining the min/max values for individual compositions.

9.14 Scatter Plot Analysis

Scatter plot analysis of element maps provides a tool for understanding the relationship between two element maps. To begin using this feature, select Process/Scatter Plot Analysis from the menu.

An example is shown below of a scatter plot of oxygen vs tungsten concentrations. The selected area from the scatter plot is WO₃. To use the panel, select a **map type** and the data to be displayed on the **vertical** and **horizontal** axis. A scatter plot will be displayed. Then click on **Select Area** and use the mouse to

select a rectangular region on the scatter plot. A map of the selected area will be automatically generated.

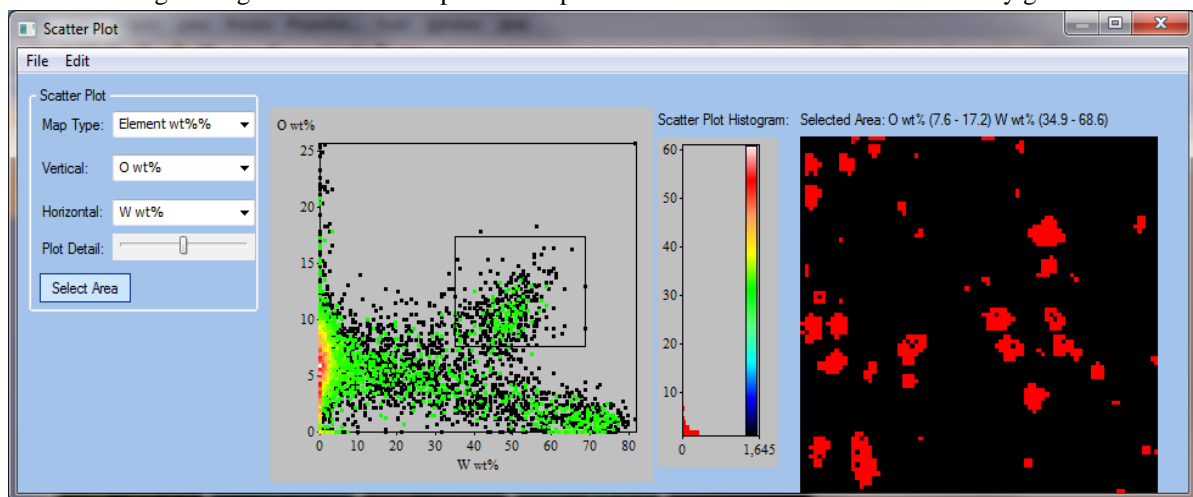

The Scatter Plot Analysis data displayed can be Printed, Exported, and Copied from the panel's menu.


9.15 Extracting Linescans from Maps

It is sometimes desirable to extract a linescan from a map. This process extracts the spectra data from a line defined by the user on the x-ray map. The linescan is not acquired from the sample; the spectral data is taken directly from the stored x-ray map spectra. This allows for the viewing of a linescan from an x-ray map after x-ray map acquisition has taken place.

To extract a linescan from a map:

1. Select the menu item **Process/Create Linescan from Map**.


A panel similar to the following will appear.

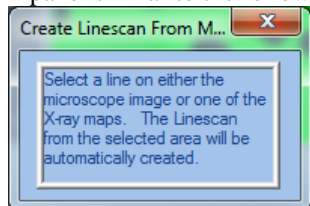


2. Move the mouse over the map to the starting location of the desired linescan. Press the left mouse button down and drag the mouse to the end location for the linescan. Lift the left mouse button.
3. A linescan will be generated from the map data.

9.16 Annotating Maps

Annotations can be added to each map and the SEM image. To add annotations, position the cursor over a map and right-click. From the menu select Edit/Annotations, as shown below.

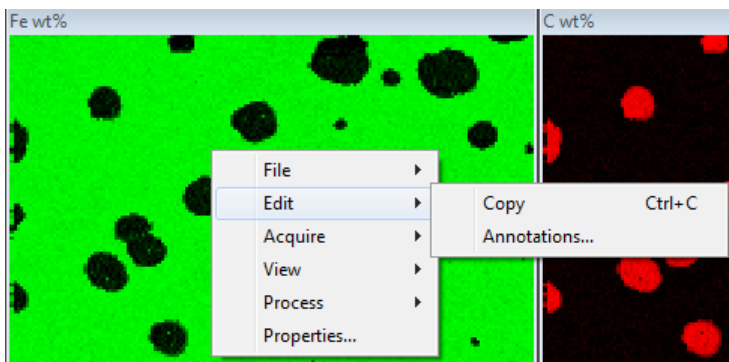

A panel similar to the following will appear. This annotation tool is identical to image annotations, and is described in the **Digital Imaging** manual.

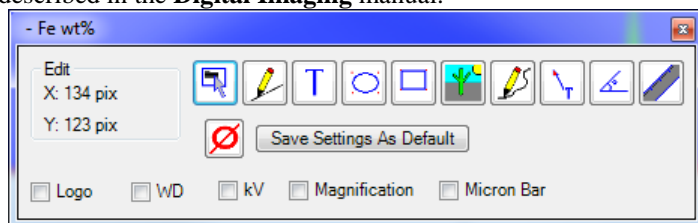

The annotations are placed only on the map selected. To add annotations to a different map, close the annotations panel and move the cursor over another map, right-click and select Edit/Annotations from the menu again.


9.17 3D Viewer


To view a map as a 3D surface, select **View/3D** from the menu.

After selecting **View/3D**, a panel similar to the following will appear.

Select the element to view in the list on the left side. Click on **OK** to create the 3D view of the map.


The intensity of each pixel in the map is used as a height (Z axis), thus forming a surface from the data. Below is an example of the 3D view.

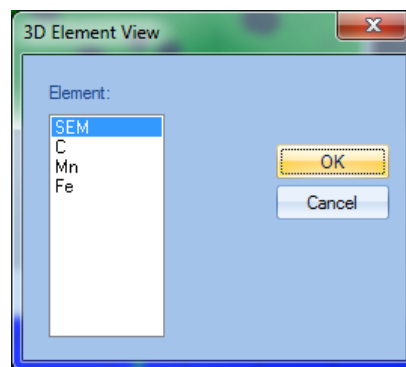

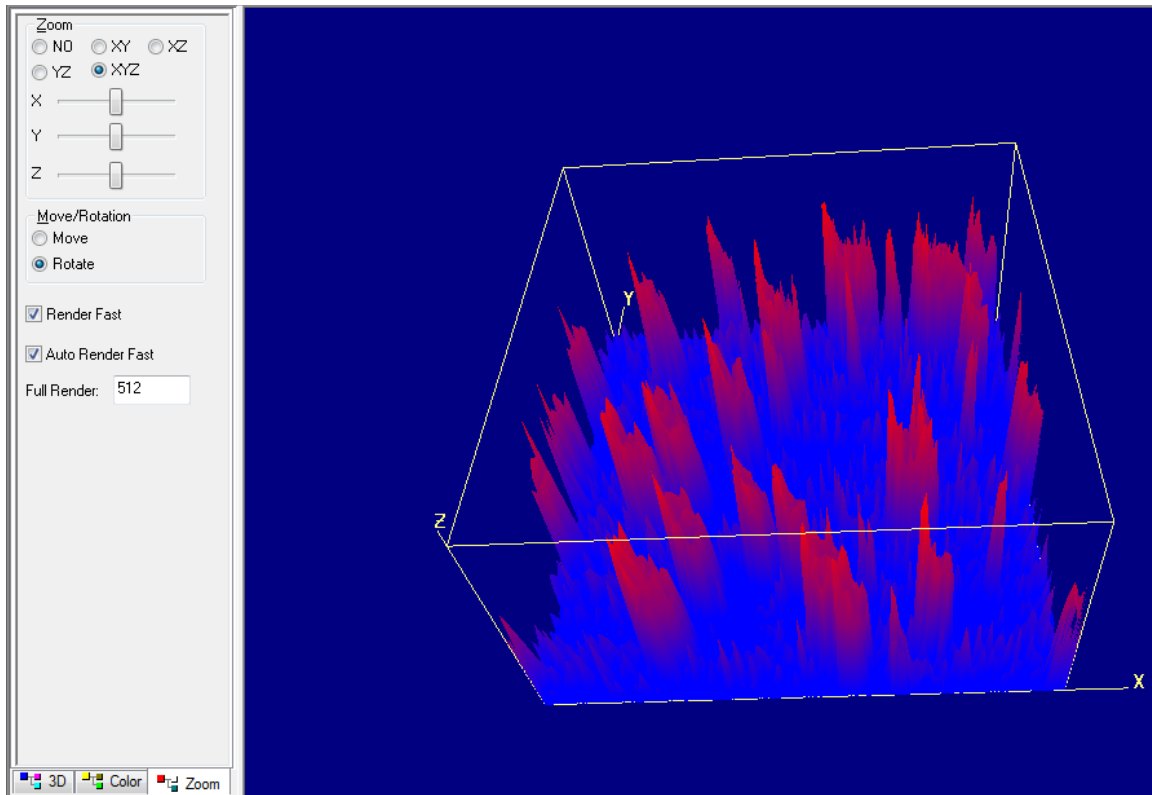

The 3D viewer has a control panel on the left side for manipulating the view, and the image view on the right side. There are three control panels: **3D**, **Color**, and **Zoom**. Clicking on the respective tab at the bottom of the control panel selects the specific panel.


9.17.1 3D Control Panel

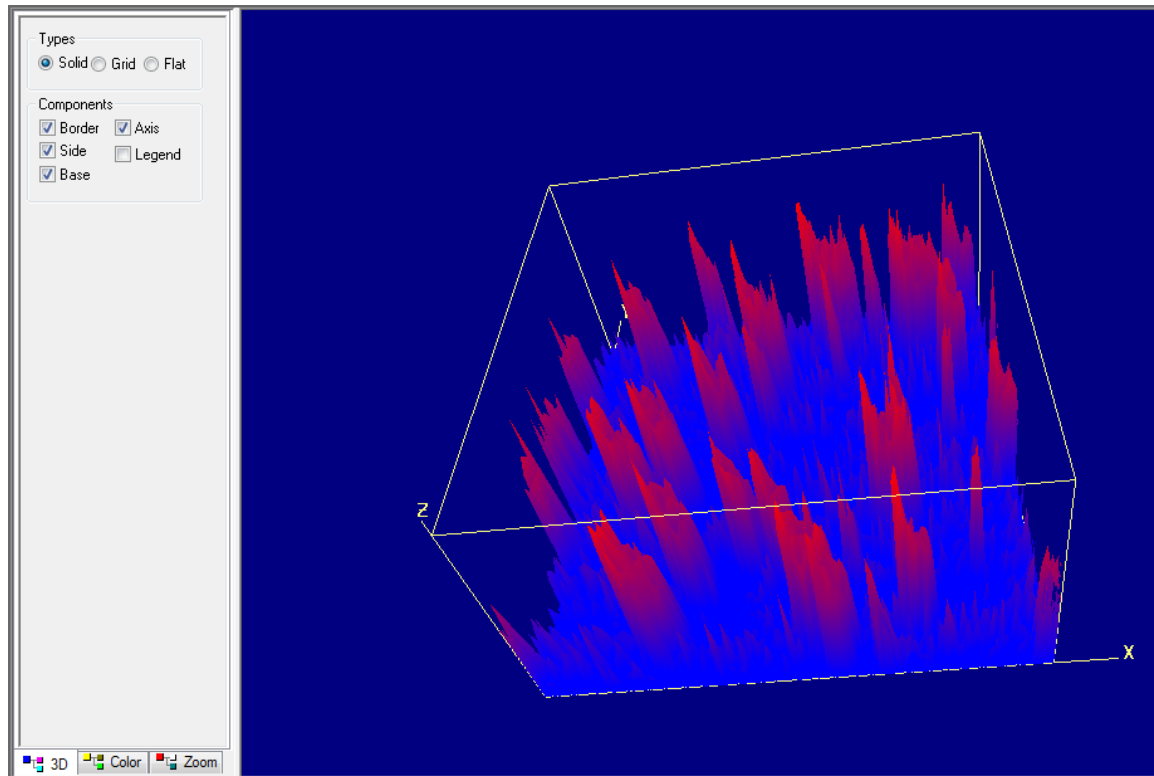

The 3D control panel sets up the basic display type for the 3D view. Types of view are **Solid** (as shown above), **Grid**, or **Flat**. Grid type displays the image with a mesh of lines. Flat type is identical to the normal image presentation, with no height (Z) information.

The image can have **Border**, **Sides**, **Base**, **Axis**, and **Legends** added by selecting them from this control panel. The legend is useful in correlating the color to a Z height.

9.17.2 Color Control Panel

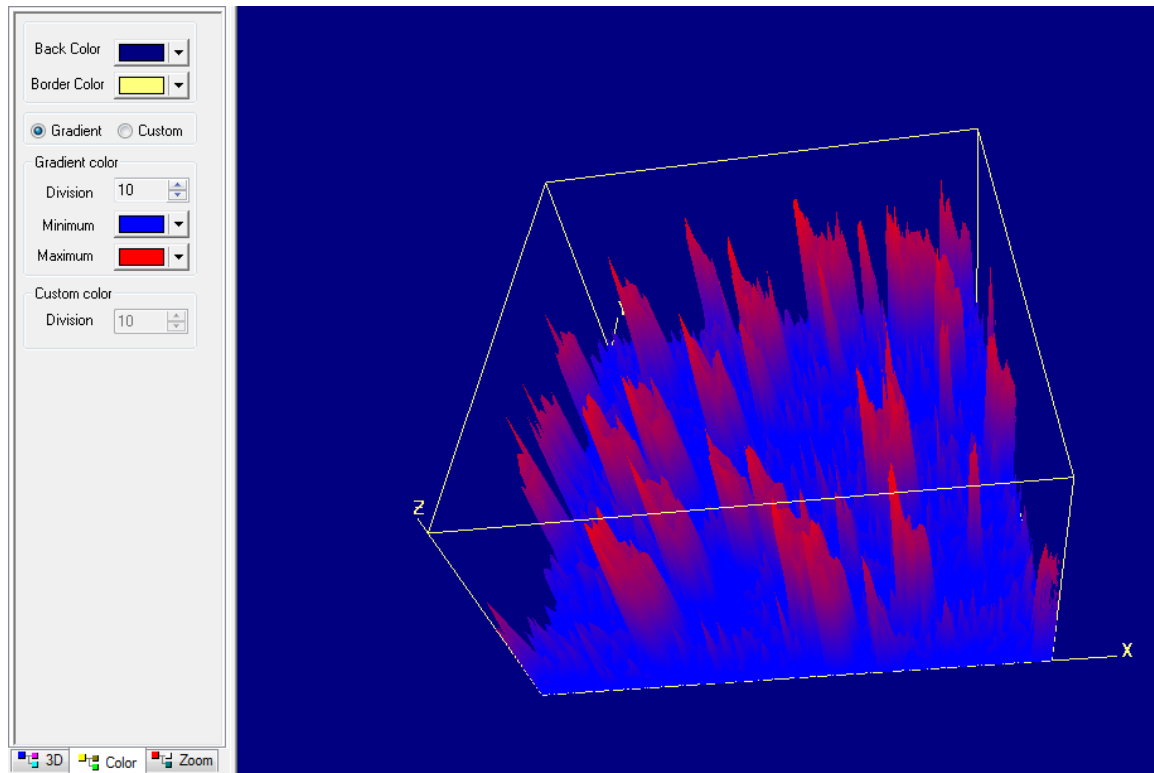

The **Color** control panel establishes the colors used for the image.


Back Color sets the background color for display.

Border Color sets the border and axis label colors.

Gradient color defines the colors used for the image by setting a color for the **Minimum** and **Maximum** heights, and a **Division** for gradient. A palette of colors for the image is then automatically generated.

Custom Color allows for setting up custom colors for each **Division**.

9.17.3 Zoom Control Panel

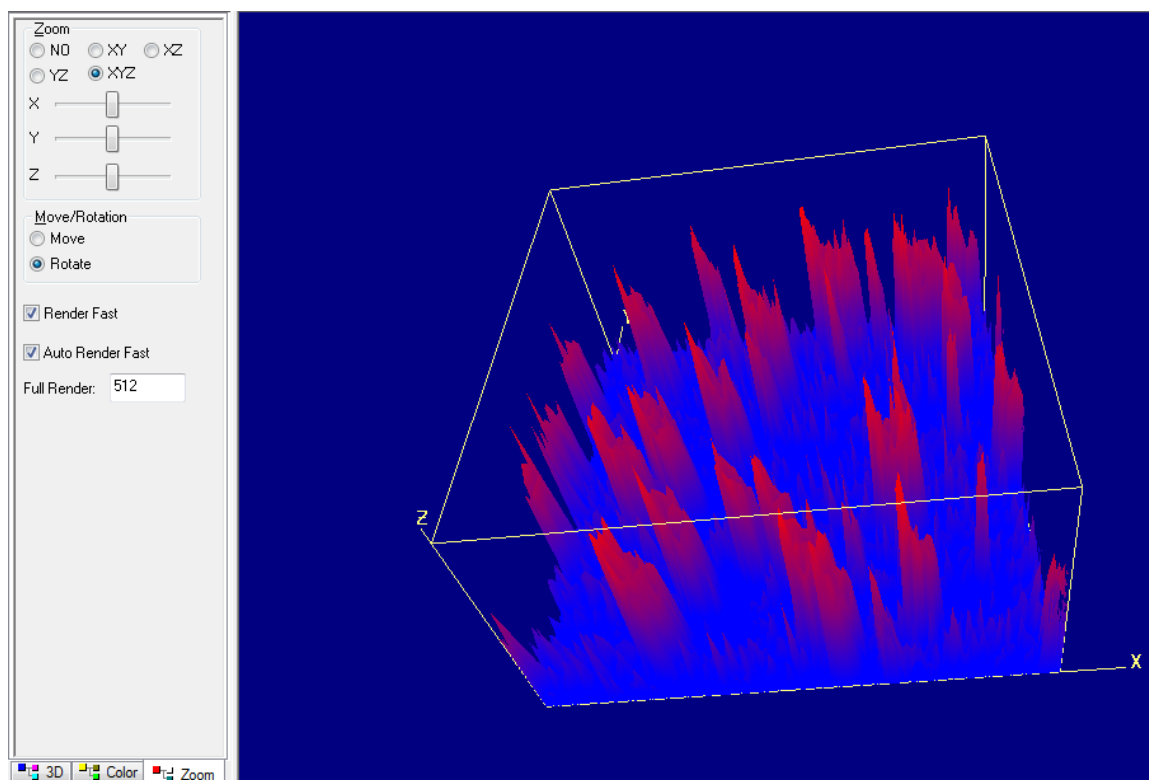

The Zoom Control panel allows for zoom, rotation, and moving of the image.

The **Zoom** slider adjusts the size of the image.

The **Move** or **Rotate** options select the mouse actions. When **Move** is selected, dragging the mouse over the image will slide the image in the direction of the dragging. When **Rotate** or **Center Rotate** are selected, dragging the mouse will rotate the image.

The **Render Fast** option displays the 3D image in a reduced resolution. This can be useful for large images when rotating or moving the image is slow.

With the **Auto Render Fast** option enabled, anytime the mouse is used to rotate or move the image, the image is automatically rendered in fast mode (reduced resolution).

Full Render is the maximum resolution that the image will be displayed at, when not in Render Fast mode. The Full Render resolution maximum resolution is 1024, or the original data resolution, whichever is smaller.

9.17.4 3D Menu

File/Print

File/Print Preview

File/Print Setup

These are standard printing options

Edit/Copy

Copies the 3D view to the windows clipboard


9.18 X-ray Map Drift Correction

Some samples are difficult to acquire x-ray maps from because of sample drift during acquisition of the map. Quality x-ray maps may take more than ½ hour of acquisition time. During this time, certain samples may drift horizontally or vertically. This drift will cause a blurring of the maps.

It is possible to determine this drift by acquiring digital images during the map acquisition and tracking the change of position of a feature in the image. Enabling drift correction for x-ray maps does this.


Normally, x-ray maps are acquired using the full scan range of the our electronics. This acquires a map that corresponds to the full image of the microscope. When drift correction is enabled, a “border” region around the full image is reserved for any drift corrections that may be necessary during the map acquisition.

The panel below shows a digital image and the border (red rectangle). The map will acquire data inside the rectangle labeled **Map Scan Area**. This will allow for the sample to drift horizontally and vertically by the distance outside the rectangle.

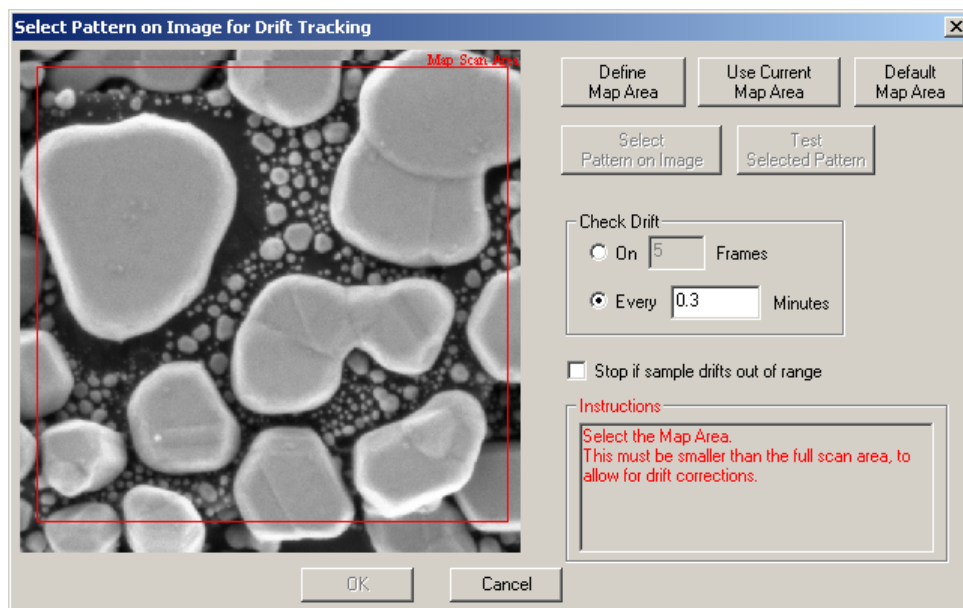


9.18.1 Enabling Drift Correction

To begin using drift correction, check the Enable Drift Correction setting on the acquisition panel of the properties for x-ray maps, as shown on the right.

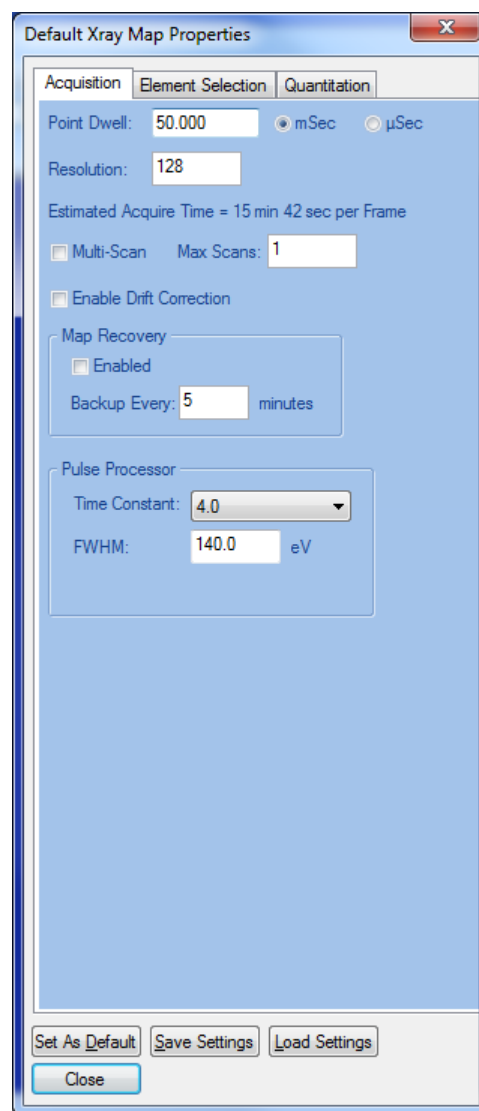

9.18.2 Acquiring Maps with Drift Correction

With drift correction enabled, whenever an x-ray map is acquired the following panel will appear.

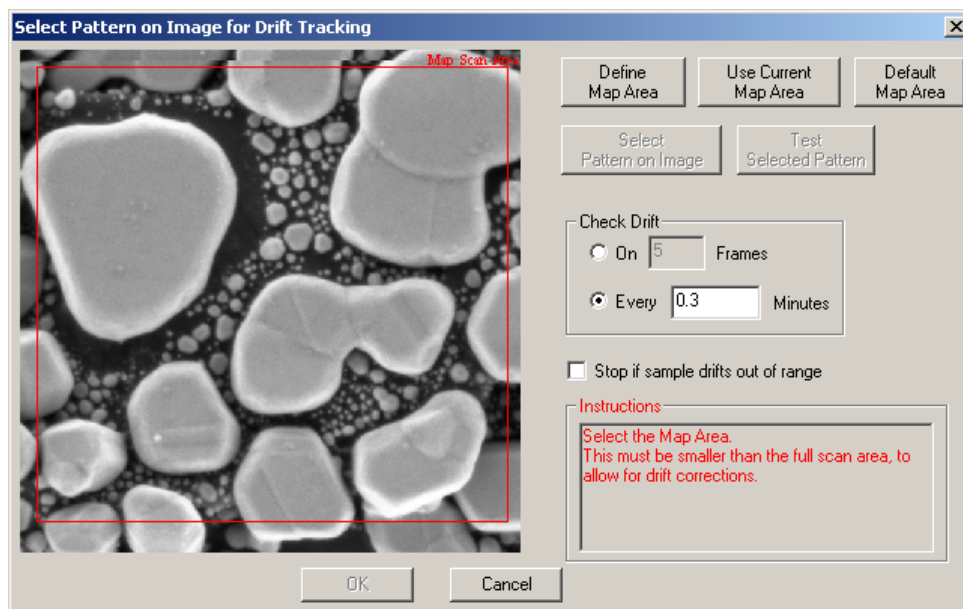

A digital image will be acquired. Instructions for setup are displayed in the lower right corner of the panel. The first step is to select the map area. This is the actual area for the x-ray map. It must be smaller than the full image area so that our electronics can make adjustments to the beam positioning (horizontal and vertical) to accommodate for the drift.

There are three options for defining the Map Area:

1. Click on **Define Map Area**. This allows you to select a rectangular area on the image. This area will be the actual area that the map will be acquired over. The remaining image area will be used for drift correction.
2. Click on **Use Current Map Area**. Displayed on the image is the Map Scan Area that was used for the previous map with drift correction. If you wish to use the same map area, select this option.
3. Click on **Default Map Area**. This selects the system default map area (10% border on all sides).

After selecting the map area, you will need to select a pattern in the map area that the drift correction software will use for tracking movement. Select a feature on the image that is locally unique.


To select a pattern, click on **Select Pattern On Image**. Then select a rectangular area on the map area around the pattern you wish to use. You can test the pattern after selecting it by pressing the **Test Selected Pattern** button. The result of the test should be within 1 pixel. If the test yields results greater than 1 pixel, you may want to consider selecting another pattern on the image or adjusting the image acquisition parameters for better image quality.

Drift correction is performed at the end of a map frame. It can be performed at a specified time interval or number of frames. For example, if you want the correction to be performed every 30 seconds, select **Every** in the **Check Drift** area, and input 0.5 in the **Minutes** edit box. Or, if you want the correction performed every 5 frames select **On** in the **Check Drift** area, and input 5 in the **Frames** edit box. The drift correction will be performed repeatedly based upon your selection of the interval (time or frames).

It is possible that insufficient border area was reserved for drift correction. In this case you can select whether to stop the map immediately or to let the map continue. Use the option **Stop if sample drifts out of range**.

10. Working with X-ray Linescans

X-ray linescans are excellent tools for determining the location of phases, particles, and other features on a sample that can be discriminated by variations in elemental composition. An x-ray linescan is performed by acquiring x-ray data at evenly spaced points along a horizontal line on the sample. The x-rays are displayed on the screen as line graphs, one for each element in the element list for the linescan. As an example, the x-ray linescan below displays the distribution of Si, Pd, Fe, and Cr.

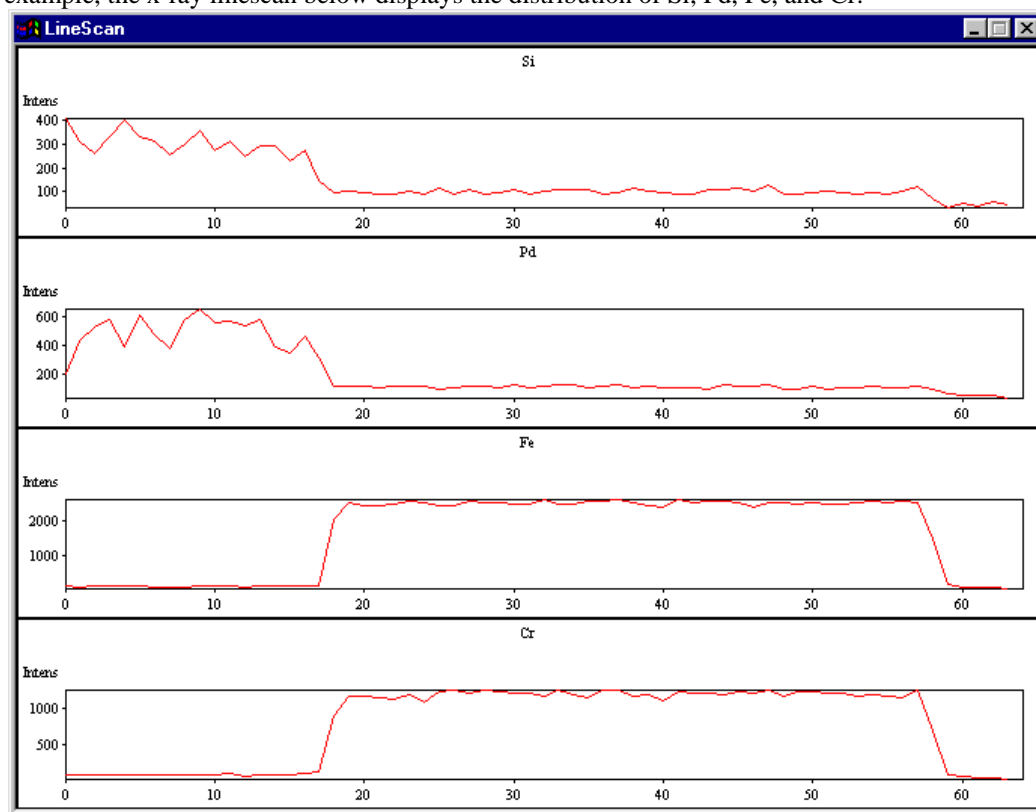

Our EDS software provides an advanced type of x-ray linescan which we call FastLineScan. FastLineScans acquire and display the x-ray linescans for all elements in the element list, and also store information that allow for viewing the full spectrum from each point on the linescan.

Below are the advanced features of the FastLineScan

- Ability to view “total” spectrum from the x-ray linescan.
- Ability to view the spectrum from each point on the linescan.
- Display a linescan for any additional elements desired without re-acquiring the x-ray linescan.
- FastLineScans can be saved with or without the spectral data. When stored with the spectral data, all of the features of FastLineScans are retained in the data file. When stored without the spectral data, the data file is much smaller, but only the linescans and the total spectrum can be viewed.


10.1 Acquiring X-ray Linescan

10.1.1 Preparing the microscope and EDS system for acquisition

- Select an area on the sample that you wish to acquire an x-ray linescan
- Optimize the microscope for acquiring the x-ray linescan. To do this, acquire a spectrum over the area of the linescan. As the spectrum is being acquired, adjust the microscope to get the highest countrate reasonable for the sample. This is important, because the beam may be moved rapidly



from point to point during the x-ray linescan acquisition. High countrates will improve the quality of the x-ray linescans. If the deadtime increases above 40%, select a shorter **Time Constant**. X-ray linescans are typically acquired with a shorter time constant than spectra.

10.1.2 Creating and Acquiring the X-ray linescan


To start acquiring an x-ray linescan, click on the  button on the Toolbar.

For integrated EDS systems, select a line on the image for the x-ray linescan. This is done using the mouse. A crosshair cursor will appear on the image. Click the left mouse at the vertical location of the line that you wish to scan. To cancel the selection of the scan line and the acquisition of the linescan, click the right mouse button. Once the selection has been made, the x-ray linescan will begin acquisition. The element list used for the x-ray linescan is the default element list. The default element list can be set from the toolbar properties of any of the EDS buttons (spectra, x-ray maps, linescans).

For EDS software, the linescan will immediately start acquisition of a digital image to be used for the linescan. After the image is acquired, a panel similar to the following will appear to allow for selection of a line for the linescan on the image.

A horizontal line can be selected on the image with the  button. An arbitrary line on the image can be selected with the  button.

After selecting a line on the image with one of the above tools, the linescan is automatically acquired. You may stop acquisition of the linescan and adjust the linescan acquisition parameters if desired.

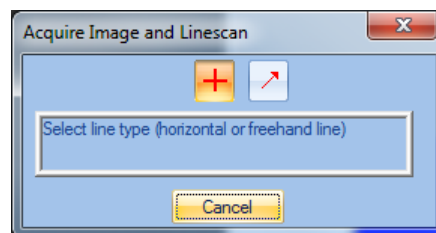

Note: in the EDS application, the image in the linescan window has a menu identical to a digital image menu. Be sure to click over the linescan (not the image) to access the linescan menu items.

10.2 Setting Acquisition Properties


The x-ray linescan acquisition properties should be optimized for the specific sample. To access the acquisition properties, select **Properties** from the x-ray linescan menu. The acquisition properties are found on the **Acquisition** tab of the x-ray linescan properties panel.

Point Dwell is the acquire time per point. The time is given in either milliseconds (mSec), or microseconds (µSec). Use microseconds when specifying short dwell times (e.g., below 1 mSec). Increasing the Point Dwell time will generally improve the quality of x-ray linescan, as larger number of x-rays will be accumulated for each point.

However, sample charging effects will be greater with longer times and the total time to acquire a complete frame will increase as well. For example, a 256 resolution x-ray linescan with a Point Dwell time of 2000 mSec (2 seconds) will take approximately 8 ½ minutes to acquire. If the Point Dwell time is reduced to 100 mSec (1/10 second) it will take approximately 26 seconds!

Multi-Scan, described later in this section, is a feature that overcomes these negative consequences of large Point Dwell times.

Note: Point Dwell should always be greater than 3-4 times the value of the time constant used for x-ray linescan. For example, for a Point Dwell time of 50 (µSec, the largest time constant that should be used is 12.5 (50/4). The reason for this is ensure that the x-rays acquired for each point are actually from that beam position! A finite amount of time is required to process an x-ray through the electronics. This time is related to the time constant. Larger values of time constant require more time to process each x-ray.

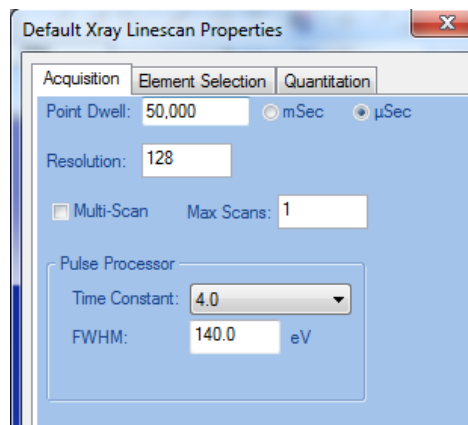

Resolution is the number of points on the line from which the x-ray data will be acquired. Larger values for Resolution will require more time for acquisition, but will also yield greater spatial resolution in the linescan. For example, a 512-resolution square x-ray linescan with a Point Dwell time of 100 mSec will take approximately 50 seconds to acquire. If the resolution is reduced to 128 it will take approximately 13 seconds. The selection of Resolution should be made large enough such that the features that are being observed can be seen clearly and their positions accurately defined. Values larger than this add no additional information to the x-ray linescan.

Multi-Scan acquires multiple scans of the line of the x-ray linescan. The scans are summed together, producing ever-increasing quality in the x-ray linescan as the scans are acquired. Max Scans is the maximum number of scans that will be acquired. The acquisition can be stopped at any time, allowing the user to determine when the x-ray linescan is of sufficient quality. For example, a Point Dwell of 100 mSec and Resolution of 256 will complete a frame in about 26 seconds. If Multi-Scan is enabled and Max Scans is set to 500, the completed x-ray linescan will acquire a total of 50 seconds of data for each point. This is calculated as $100 \text{ mSec} \times 500 = 50 \text{ seconds}$. The advantages of performing the x-ray linescan with Multi-Scan are:

- ❑ The x-ray linescan can be stopped at any time from 26 seconds to 3 ½ hours (the time to complete all 500 scans). The user can select when the x-ray linescan has sufficient quality.
- ❑ Sample charging effects are minimized due to the rapid movement of the beam over the line being acquired.

10.2.1 Returning to Acquisition Location

The microscope stage location is stored at the start of acquisition. To return the stage to the location of the previously acquired data, select **View/Go To Stage Location**. This will move the stage to the location where the data were acquired.

10.3 Setting Element Properties


The element list used for the x-ray linescan is the current element list from the last EDS acquisition. For example, if a spectrum was acquired and peaks were labeled, either manually or using automatic peak identification, the labeled elements will be the element list for the next x-ray linescan acquired.

Further refinement of this list can be done with the **Element Selection** tab of the X-ray LineScan properties. To access the x-ray linescan properties select **Properties** from the x-ray linescan menu.

Shown is the **Element Selection** tab. The elements that will be acquired are indicated on the periodic chart in either the **Always Present** color or the **Automatic Identification** color. Elements can be added and removed from the x-ray linescan element list via selection on this periodic chart.

Scale Linescans selects the method of display for the linescans.

Note: If the x-ray linescan has been loaded from a disk file and the spectra data have not been stored in the file, it will not be possible to produce linescans for new elements.

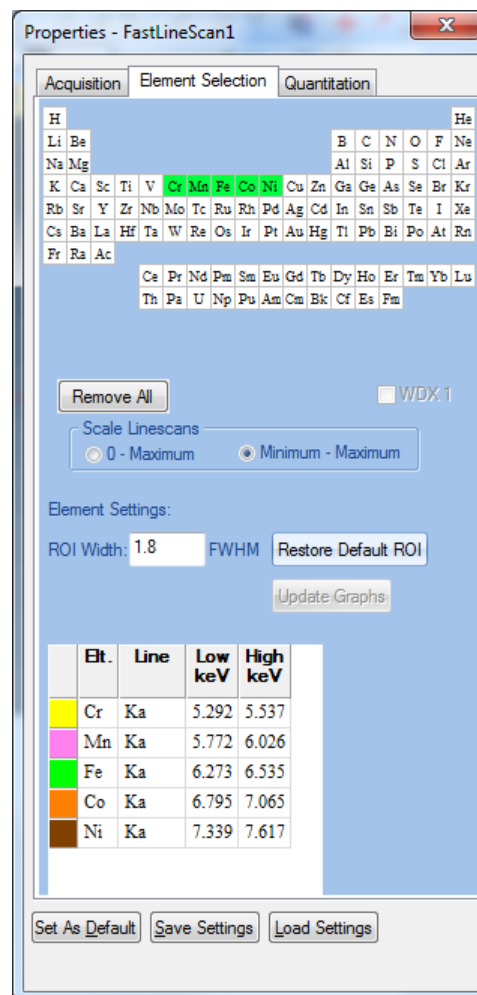

The **Element Settings** section of this panel is used to further refine the element list. The integration region (ROI) for each element can be adjusted. Note that a unique color is displayed to the right of each element in the list. This color corresponds to the colored regions of the spectrum displayed below the linescans. After changing the ROI for an element, it is necessary to press the **Update Graphs** button to apply the changes made.



The element linescans are constructed using the x-rays whose energy are close to the selected line (e.g., Ka, La, Ma). Default lines are selected for each element when the element is added to the element list.

Clicking in the **Line** column of the table modifies the line selected for each element.

When making a new selection for line, the **Low keV** and **High keV** entries in the table are updated. The **Low keV** and **High keV** display the x-ray energies used to construct the linescan for each element. In the example above the Si linescan is constructed using the Ka line series x-rays of Si, which correspond to energies between 1.691 – 1.789 keV. If a different line is selected for an element the **Update Graphs** button must be pressed to apply the changes to the linescans.

By default, the element ROIs for maps and linescans is 1.8 FWHM around the peak center. Below is an example of the ROI for Fe using one FWHM.


By setting the **ROI Width** to 2.0, most of the peak area is included in the map for Fe, as shown below.

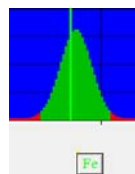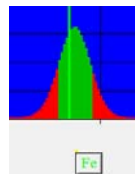


10.4 Viewing Intensities and Concentrations

Select **View/Intensities Concentrations** from the menu to inspect the x-ray data at individual points on the linescan. This panel will appear.


Click anywhere on a linescan to select a point to inspect the x-ray intensities, as shown below.

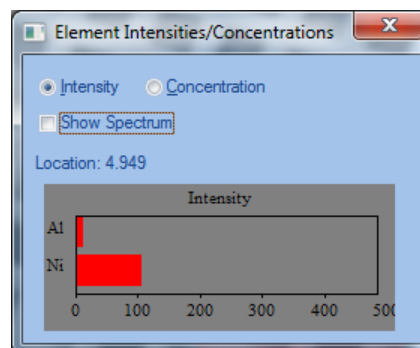

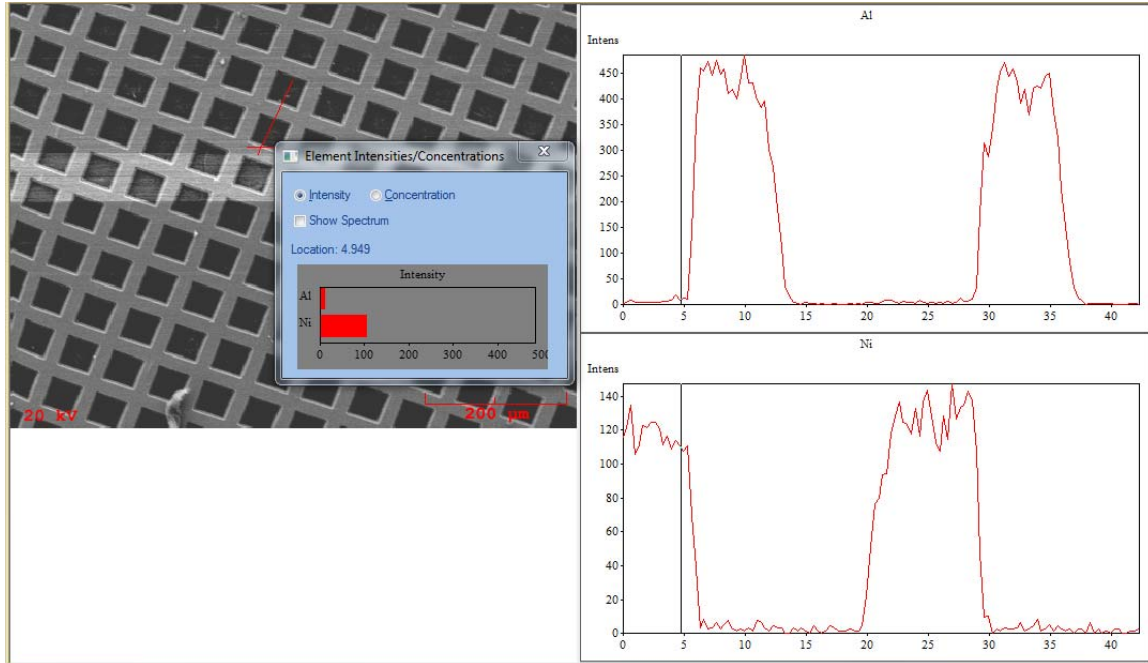


The panel now displays a histogram of the intensity of each element at the selected point.
 Selecting **Concentration** in the panel will apply ZAF corrections to the intensities and re-display the histogram with these calculated values in weight percent, as shown here.

Note: All points on the linescan must be quantified during this process. This may take a considerable amount of time. A progress panel will appear with a **Cancel** button. If you do not wish to complete the calculation and display of concentration data, you may press the **Cancel** button.
 Clicking on another location on the linescan will display the concentration at the newly selected point.

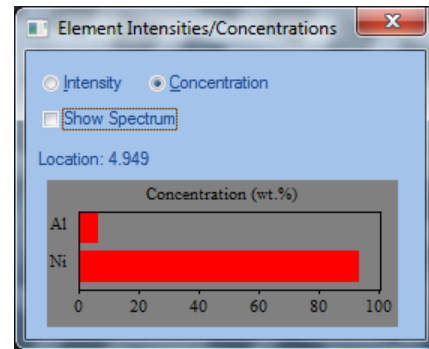


10.5 Overlay Linescans

Linescans can be combined and overlaid on the SEM image using the **View/Overlay Linescans** menu item. A panel similar to the following will appear when this menu item is selected.

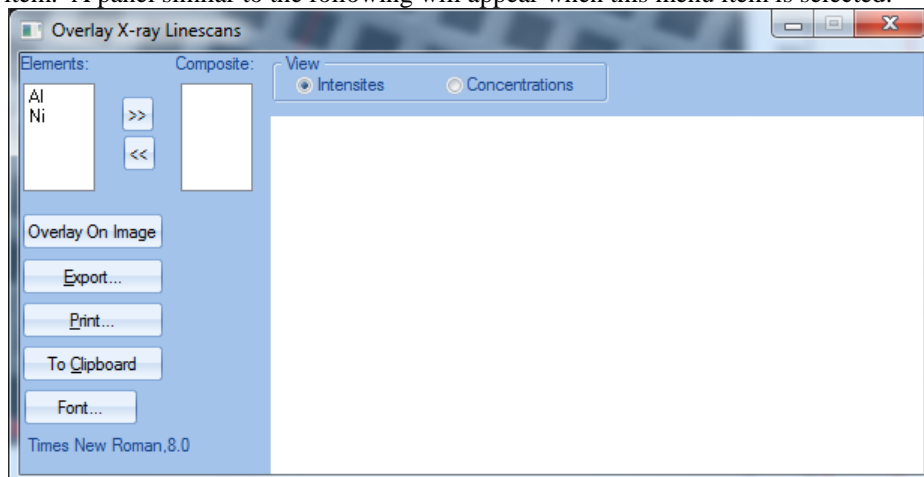


The **Elements** list contains all linescans that can be combined. To add a linescan, select it from the **Elements** list and click on the **>>** button. Another way to add the linescan is to double-click it. A panel similar to the following will appear. Select a color for the linescan.


After selecting a color, the combined linescan on the right side of the panel will be re-displayed with the selected element added.

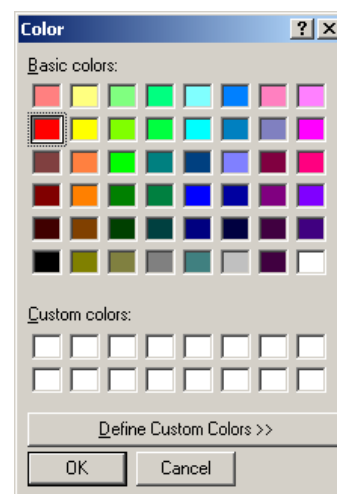

This procedure can be repeated to combine other element linescans. Below is an example of a combination of Al and Ni.

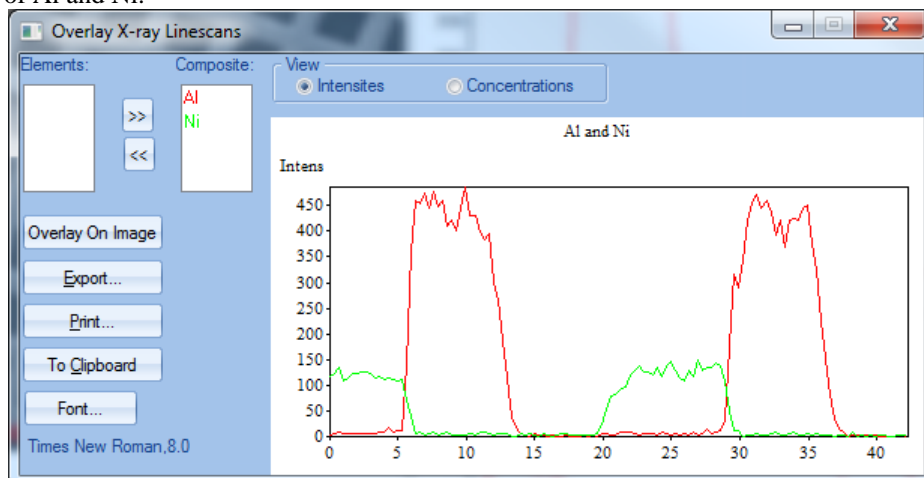

The panel can be re-sized, making the graph larger or smaller, as desired. With the mouse, grab a corner of the panel and drag it to change the size of the panel.

Elements can be removed from the combined graph by selecting from the **Composite** list and then clicking on the  button. Another way to remove an element is to double-click it. After removing the element, the graph will be re-displayed with the remaining elements in the **Composite** list.


10.5.1 Intensities or Concentrations

The combined graph can be displayed as intensities or concentrations. This is selected using the buttons in the **View** section above the graph.

10.5.2 Overlay On Image

For the EDS software, the linescan can be overlaid on the SEM image. Click on the **Overlay On Image** button to copy the combined graph onto the image. Below is an example of a graph overlaid on the image.

The graph is now an annotation on the image. The graph can be moved, sized, and deleted using the **Edit/Annotations** panel for the image. The graph can be moved, but will always retain its alignment to the location that the linescan was acquired. Otherwise, moving and sizing the graph is done identically to other annotations on images (text, lines, etc.).

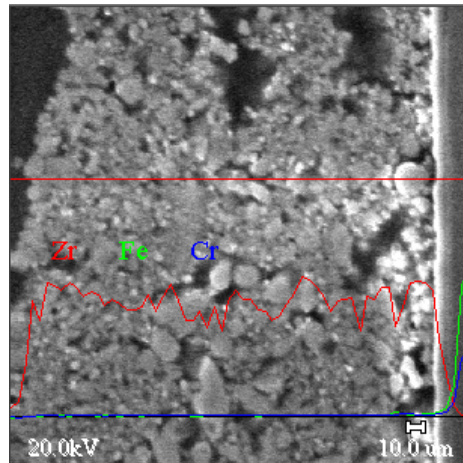

10.5.3 Export, Print, and Clipboard

The combined graph can be exported to a graphics file (TIFF, BMP, etc), printed, or copied to the Windows clipboard.

10.6 Printing Linescans


Linescans can be printed using several pre-defined styles. For EDS systems, the image can be printed with the linescans. There are two basic printing styles, as shown in the panel below.

10.6.1 Single Page Output Style

For this style, all of the linescans are fit to a single page of paper. The image can be included on the page. For portrait output, the image is printed at the top of the page. For landscape output, the image is printed on the left side of the page.

10.6.2 Multi-Page Output

For this style, you specify the number of linescans per page. Thus, if you have 8 linescans, and print 2 per page, the output will be 4 pages. The image can be printed, if desired, on either the first page or on every page.

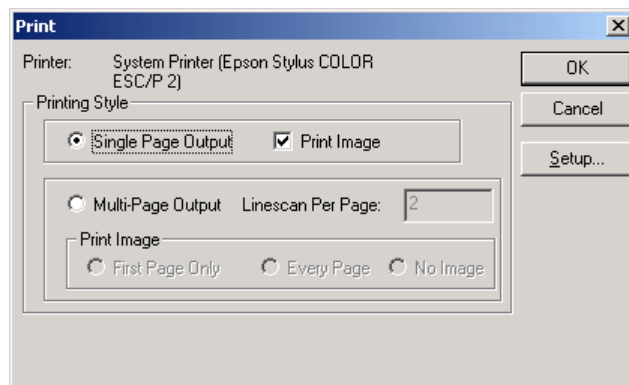

11. RoboStage

RoboStage allows unattended acquisition of multiple EDS data from anywhere on the microscope's stage using the existing stage automation for the microscope to position the stage for each EDS data acquisition. Data are automatically saved in either individual data files or an EDS Dataset file.

Below is the main panel for RoboStage. This panel is accessed from the menu item **Tools/RoboStage**.

Name	Type	Position X (mm)	Y (mm)	Magnification	Settings File	Auto Focus	Auto B/C	Grid (Rows, Cols)	Grid Overlap
LK-1	Image	65.884	23.016	500		<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>		
LK-2	Spectrum	65.619	22.893	1,000		<input type="checkbox"/>	<input type="checkbox"/>		
LK-3	FastMap	65.993	22.548	750		<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>		
LK-4	FastLineScan	65.885	22.446	1,800		<input type="checkbox"/>	<input type="checkbox"/>		

The buttons in the center of the panel (Spectrum, Image, FastMap, etc) are used to select data to be acquired at the current stage position.

The top portion of the panel deals with how the data will be stored:

- Sample Name sets the base name for all of the data acquired. In the above example, LK is the base name.
- Save Data. Selecting Individual Files will store each EDS data (Spectrum, Image, FastMap, etc) in separate files. Selecting EDS DataSet will store all of the EDS data in a single EDS DataSet file.

In this example there are four data to be acquired, labeled LK-1 through LK-4. At the bottom of the panel is a list of the data to be acquired, the X-Y stage location (if the SEM is equipped with a motorized stage that our software can control), the magnification to be used, and whether or not the operator wishes to execute Auto Focus and/or Auto Brightness/Contrast (if those options can be controlled by the EDS software). This varies by microscope vendor and model.

The **Delete** button is used to remove one or more entries from the list. Select the entry(s) by clicking on the buttons on the left side of the list (hold the shift key down to select multiple entries), and then click the **Delete** button.

The **Go To** button is used to navigate to a selected entry in the list. Select an entry in the list and click **Go To**. The stage will be driven to the location of the entry.

The **Start Acquisition** button is used to start and stop acquisition. During acquisition, the button label changes to **Stop Acquisition**.

Save List and Load List

Lists of data to acquire can be stored and recalled. If you routinely acquire data (e.g, images, spectra, fast maps), this feature can save the time of setting up the analysis positions. The stage locations, magnification, and other required setup information for acquiring the data are stored in a file when you select **Save List**. These settings can be recalled by clicking on **Load List** and selecting a file.

To use RoboStage do the following:

1. Select a **Sample Name**.
2. Select how the data are to be stored (**Individual Files/EDS Dataset**).
3. Move the stage to an area of interest and click on the data that you want (Spectrum, Image, FastMap, etc). For Stitched Images and Stitched Maps, a panel will be displayed to further setup the acquisition. Those panels are described in the section on Stitched Images and Stitched Maps.
4. Click the **Start Acquisition** button.

Turn Beam Off After Acquisition


This feature can be used to turn off the high voltage when an acquisition completes. In this manner, you are not adversely affecting filament life when the microscope is not being used. For example, you might wish to start a data acquisition run at the end of your workday which might take several hours to acquire. You can set everything up ahead of time, and collect the data while the microscope is unattended, and when data collection has finished, the beam will be turned off automatically.

12. Stitched Images and Stitched Maps


Image and Map stitching allow for acquisition of images/maps over a large area. This is done by moving the stage (automatically or manually) to adjacent fields, forming a grid of images/maps from the data acquired at each field. This grid of images/maps can be stitched together into a single image/map file.

12.1 Acquisition

To acquire a stitched image/map select File/New from the menu and then select Stitched Images or Stitched Maps, as shown below.

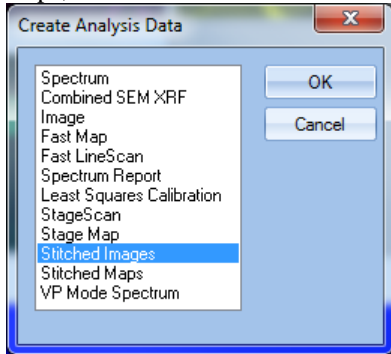


A panel similar to the following will appear.

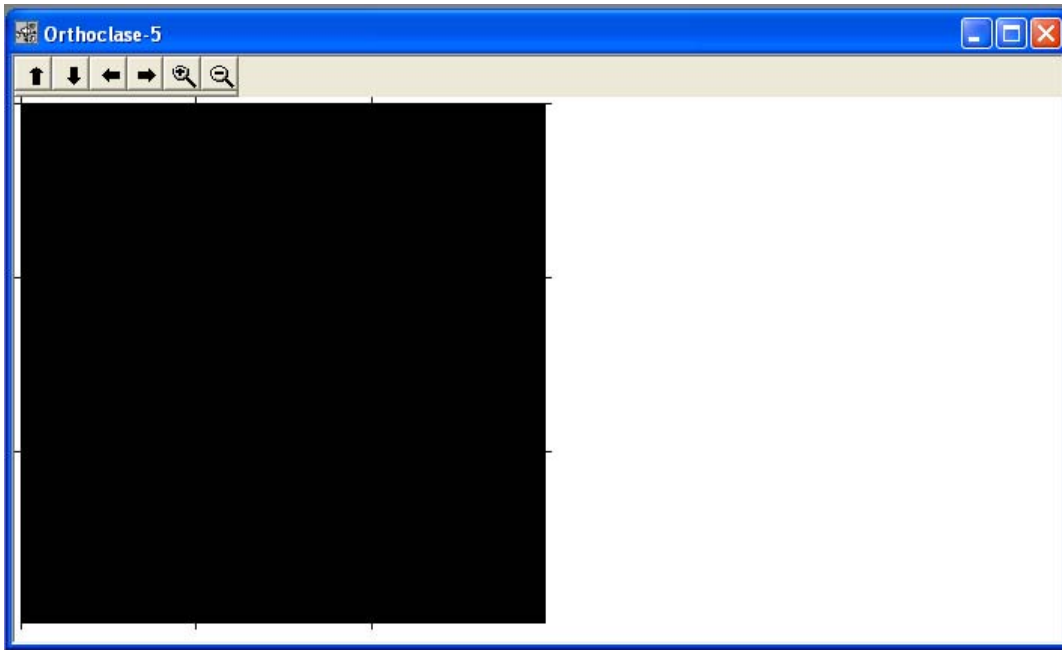

Prior to acquiring the stitched image/map, setup the microscope at the desired magnification for the stitched image/map.

Click on the **Acquire** button to begin acquisition of the stitched images/maps.

A panel similar to the following will appear.

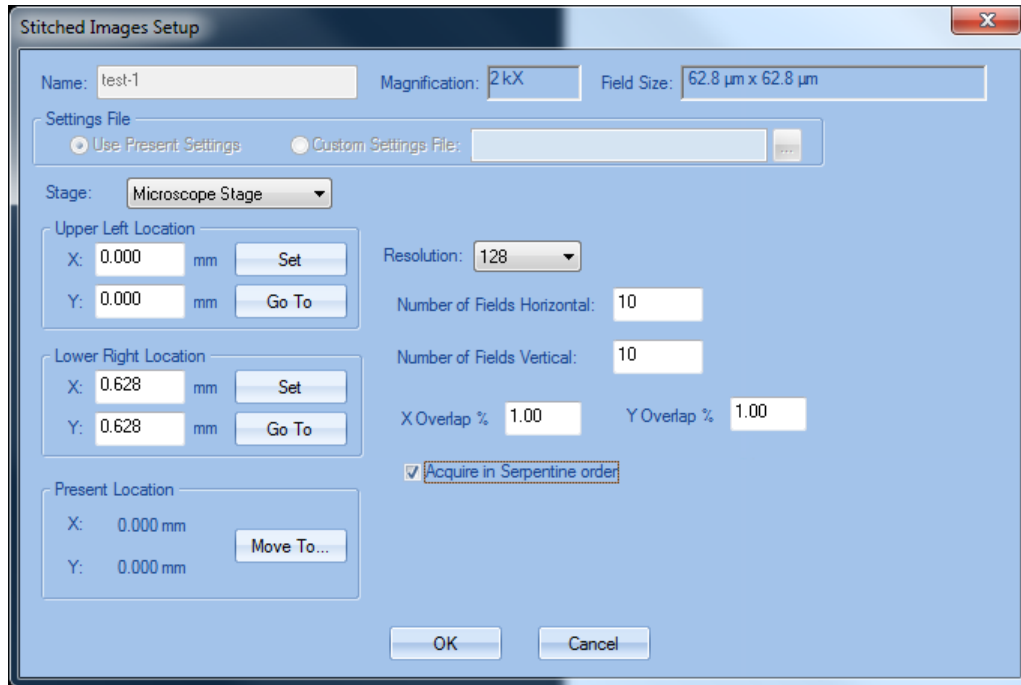

This panel is used to setup the acquisition.

Name: This is the stitched image file name.

Magnification: This is the present microscope magnification.

Field Size: Calculated from the magnification calibration in the EDS software, this is the size of each image field. This can be used to verify the calibration on the SEM prior to starting the stitched image/map acquisition. If there is a discrepancy between this field size and the SEM field size, it is recommended that you do an image calibration prior to proceeding.

Stage: This selects the stage that will be used for the automated operation. Normally, this is set to **Microscope Stage**. However, if you do not have an automated stage, or if you want to manually position the stage, you may select **None** from the list.

Upper Left Location: Move the stage to the upper left location for the stitched images and click **Set**. This will record the stage location. At anytime you can click on **Go To** move the stage back to the upper left location. This can be useful in verifying the area for acquisition.

Lower Right Location: Move the stage to the lower right location for the stitched images and click **Set**. This will record the stage location. At anytime you can click on **Go To** move the stage back to the lower right location. This can be useful in verifying the area for acquisition.

Number of Fields Horizontal: This is the number of images horizontally in the stitched image. This is calculated automatically when you select an upper left and lower right corner. The automatic calculation can be changed manually by entering a number here.

Number of Fields Vertical: This is the number of images vertically in the stitched image. This is calculated automatically when you select an upper left and lower right corner. The automatic calculation can be changed manually by entering a number here.

X Overlap % and Y Overlap %: There can be an error in the stage positioning for each of the images. To allow for this error, an overlap can be specified, as a percent of the width and height of the image. Typical values of overlap are 1-5%.

Acquire in Serpentine order: Normally, images are acquired left-to-right on each row of the stitched image/map. With this option selected, the images will be collected left-to-right for the first row, right-to-left for the second row, etc. This will improve throughput, but may lead to some additional misalignment of the images due to backlash in the stage.


Resolution: This is the pixel resolution of the image(s)/maps(s) being acquired. The software supports 4096 x 4096 pixel resolution images and maps. Care should be taken to ensure that this maximum resolution is not exceeded when setting up the area to be acquired.

Present Location: This displays the present location of the stage. The stage can be moved via the software by clicking on the **Move To** button.

OK: Clicking on **OK** will start the acquisition.

12.2 Editing

Below is a 2x2 stitched map after acquisition.

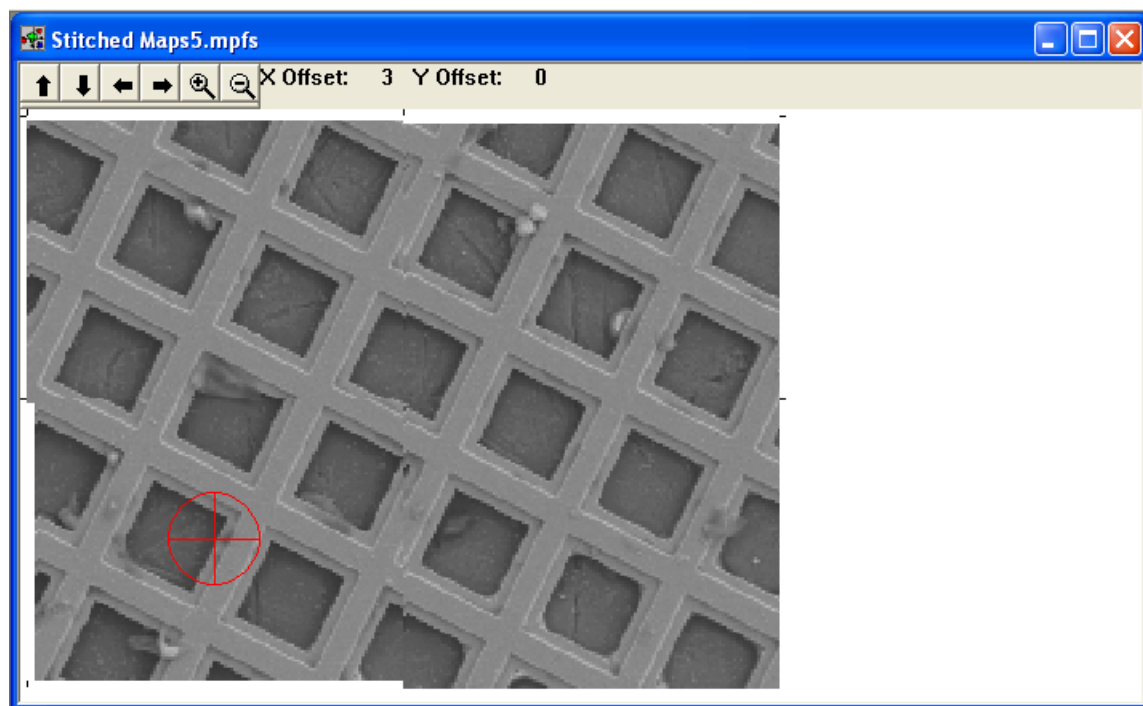

Note: prior to editing or exporting a stitched image/map, it is highly recommended that you save the stitched image/map.


Tick marks on the perimeter of the maps indicate the boundaries of the 4 maps.



The toolbar buttons can be used to manually slide the images left/right and up/down to align the data fields. To align a field, first click on it to select it. A red cursor will appear, as shown in the example above.

Once a field is selected, use the arrow buttons on the toolbar to adjust the position of the field. The offset (in pixels) is given for the selected field. In the example above, the selected field has been moved 3 pixels to the right, and no vertical adjustment (0).

Multiple fields can be selected to move a group of fields together. To select multiple fields, hold the Shift key on the keyboard and click on the fields.

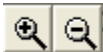The  buttons on the toolbar can be used to zoom in on the fields. This is useful for fine adjustment of the field offsets.

12.3 *Saving and Exporting*

Stitched Image/Map files are saved in a format different from images and maps, in that they contain a collection of images/maps. It is important to save the stitched images/maps after acquisition and also after any editing has been performed in order to retain the data.

Select **File/Save As** from the menu to save the stitched image/map.


Exporting a Stitched Image/Map creates a single image/map file which can be processed by the EDS software as a single image/map. If you wish to perform any processing on the stitched image/map, it is necessary to first Export the stitched image/map.

Select **File/Export as Stitched** from the menu to export the stitched image/map.

For stitched images, the **File/Export as Individual** menu item is available. This will export each of the images separately to a bitmap file (JPEG, TIFF, etc). The names of each of the individual images are suffixed with their row and column numbers respectively.

13. WDX Support


Support for a single WDX channel input for FastMaps and FastLinescans is provided as an option to the EDS software. When this option is enabled, as shown below, the WDX1 signal input can be selected.

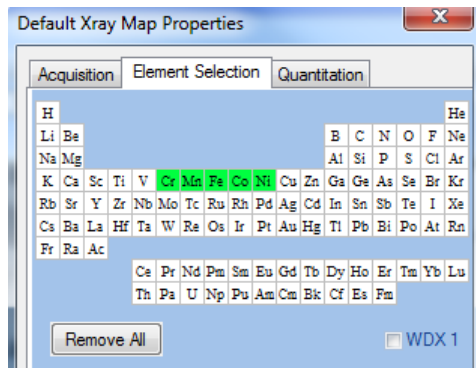

When this option is selected, a map/linescan will be acquired from the WDX signal. The WDX signal is not used in the quantitation of maps/linescans, but is available for all display functionality (overlays, etc).


14. Energy Calibration

Energy Calibration, and related setup and calibration of our Models 500/550i Digital Pulse Processor (DPP) are accessed from the **Utility/Energy Calibration** menu item of a spectrum. When performing any of these operations, it will first be necessary to have a spectrum. Refer the section on Working With Spectra if you are unfamiliar with acquiring spectra. Selecting **Utility/Energy Calibration** from the menu will display a panel similar to the following:

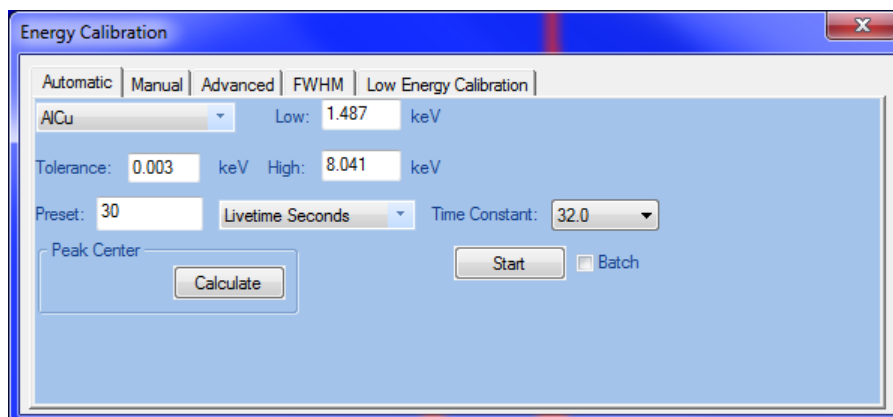


14.1 Offset DAC Calibration (Model 500 only)

Whenever a detector is connected to our Model 500 Digital Pulse Processor (DPP) for the first time, the Offset DAC Calibration must be performed. This is only necessary with revisions A and B, and C of the Model 510. To determine the revision of the DPP, click on the Advanced tab on the Energy Calibration panel, as shown below.

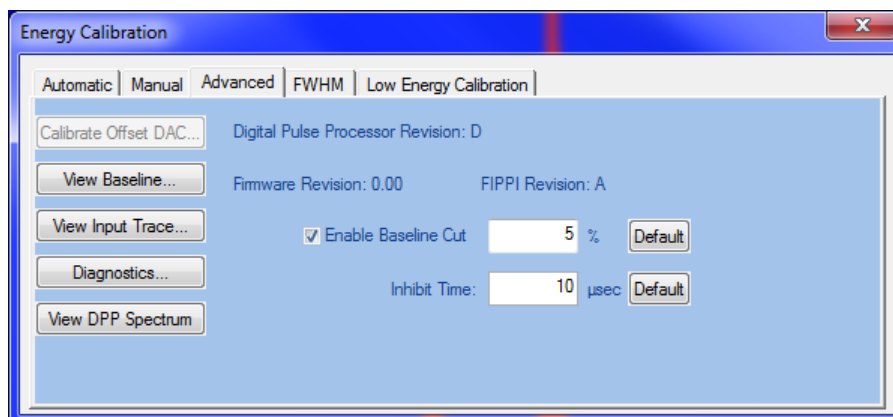

In the above example, the revision is D, the Calibrate Offset DAC is not necessary. To perform the Offset DAC Calibration do the following:

1. The power on the DPP should be turned on for at least one hour prior to performing this calibration. If the power is off, turn on the power and continue with this calibration after one hour.
2. With the **Energy Calibration** displayed, click on the **Advanced** tab. A panel similar to the one shown above will appear. Click on the **Calibrate Offset DAC...** button.
3. A dialog similar to the following will appear. Click on the **Calibrate** button.

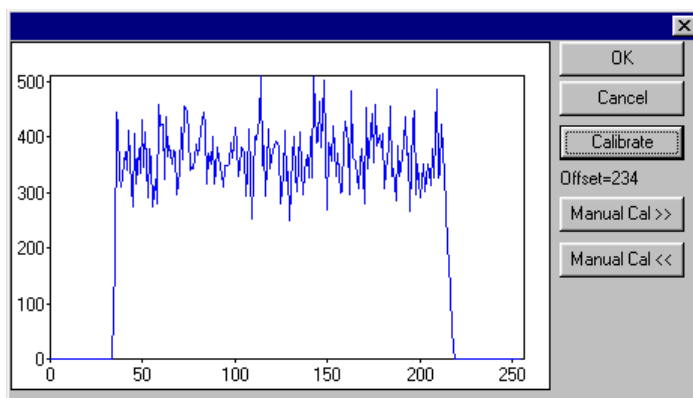

4. After a few seconds a histogram will appear. It should be centered which indicates that the signal falls within the range of the input of the DPP.
5. Click **OK**.
6. The Offset DAC Calibration is now completed.

14.2 Manual Energy Calibration and Threshold Adjustments


Whenever a detector is connected to our Models 500/550i Digital Pulse Processor (DPP) for the first time, Manual Energy Calibration and Threshold Adjustments are required. Manual Energy Calibration adjusts the gain and zero settings of the DPP such that the peaks in the spectrum are in approximately the correct locations. This is necessary before performing Threshold Adjustments.


After performing Manual Energy Calibration and Threshold Adjustments, the Automatic Energy Calibration should be performed. This will ensure that the DPP is finely calibrated.

There should be a known sample with two well-separated peaks, such as Al and Cu, in the microscope.


The power on the DPP should be turned on for at least one hour prior to performing this calibration. If the power is off, turn on the power and continue with this calibration after one hour.

1. Select the desired Pulse Processor Filter Time Constant and Full Scale. Full Scale does not apply to all hardware configurations. If Full Scale does not appear in the panel, it does not apply to your hardware configuration. The Full Scale can be selected from the **Spectrum Properties** menu item on the **Acquisition** tab. This is shown at right. Normally Full Scale should be set to 40 keV. The **Time Constant** can also be selected here, or alternatively, in the **Energy Calibration** panel as shown below.

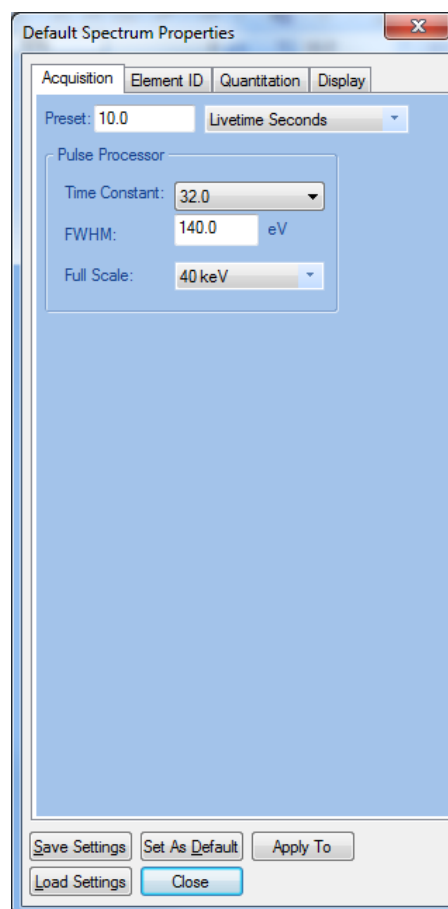

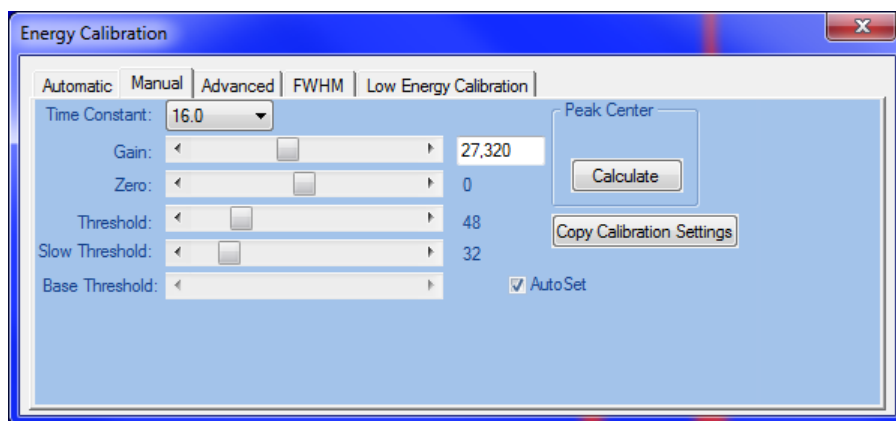

2. Set **Slow Threshold** to 0.
3. Start acquiring a spectrum.
4. Adjust the (**Fine**) **Gain** until the peaks are within 100 eV of their correct locations.
5. While observing the low end of the spectrum, adjust the **Threshold** down until a noise peak starts to appear at the lowest energy. Adjust the **Threshold** higher until the peak just disappears.
6. Adjust the **Slow Threshold** higher until the cut-off is slightly below the lowest desired peak.
7. Stop acquiring the spectrum.
8. The correct **Gain**, **Threshold**, and **Slow Threshold** settings for each **Time Constant** are typically very similar. To aide in initial setup of the DPP, an option to **Copy Calibration Settings** can be used. If this is the first **Time Constant** being calibrated, it is recommended to use the **Copy Calibration Settings** option. This will copy the calibration settings for the selected **Time Constant** to all of the other **Time Constants**, thus setting up all of the other **Time Constants** to reasonable settings. Click on the **Copy Calibration Settings** button and a dialog similar to the one here will appear. Click on **OK** to copy these settings to all other **Time Constants**.
9. If you have performed the **Copy Calibration Settings**, it is recommended to acquire a spectrum at each of the remaining **Time Constants** to ensure that the settings for **Gain**, **Threshold**, and **Slow Threshold** are reasonable. Select another **Time Constant** from the **Energy Calibration** panel and acquire a spectrum. If the peak positions are more than 100 eV from their correct locations, a small adjustment of the **Fine Gain** may be necessary. Also, if a noise peak appears at the low energy region of the spectrum, a slight adjustment of the **Slow Threshold** and/or **Threshold** will be required.
10. If you have not performed the **Copy Calibration Settings**, repeat steps 1 through 8 for each of the remaining **Time Constants**.
11. When all **Time Constants** have been calibrated, proceed to the Automatic Energy Calibration.

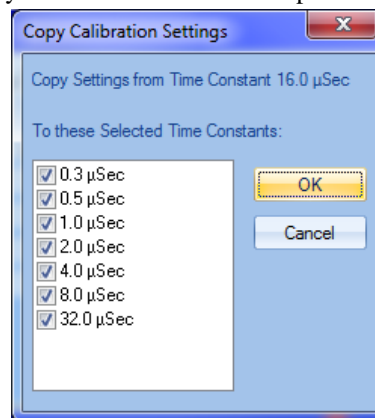

Note: If it is impossible to remove the noise peak using the Thresholds, as described above, it may be necessary to disable the **Base Threshold AutoSet**, and adjust it manually. To manually adjust the Base Threshold do the following:

1. Unselect AutoSet option.
2. Increase Base Threshold until the noise peak disappears.

14.3 Automatic Energy Calibration

Automatic Energy Calibration performs fine adjustments the Gain and Zero of the DPP, to achieve optimal calibration of the energy scale of the spectrum. Acquiring a spectrum with known peaks in it, and then automatically measuring the energies of these peaks performs this. From the measured and known energies of the peaks, adjustments are made to the Gain and Zero of the DPP. This process is repeated until the known peak and the measured peak energies agree to within the desired tolerance. Click on the **Automatic** tab of the **Energy Calibration** panel to access the Automatic Energy Calibration. A panel will appear as shown here.

The power on the DPP should be turned on for at least one hour prior to performing this calibration. If the power is off, turn on the power and continue with this calibration after one hour.

The known peaks for the calibration are selected from the list in the upper left corner. Shown in this example is the AlCu sample. This sample has an Al α peak at 1.487 keV and a Cu α peak at 8.041 keV. These are displayed as the Low and High peaks in this example. If Al-Cu is used, note that the Al α peak must be larger than the Cu-L α peak. If necessary, change the area from which the spectrum is being acquired. Also note that sufficient EHT must be applied to efficiently excite the Cu α peak. At least 20 keV is recommended. Tolerance is normally set to .003 keV. The calibration will continue to adjust the Gain and Zero until both peaks (Al and Cu) are within .003 keV of the known energies.



Preset is set in **Livetime Seconds** or **Integral Counts**. This value overrides the setting in the spectrum during the automatic calibration. If the count rate is less than 2000 c/s, it is recommended that the **Preset** be at least 40 seconds. Longer **Preset** values will generally yield more accurate energy calibration.

Batch can be used to calibrate all time constants sequentially. This can significantly reduce the tedium of the calibration process. Select **Batch** prior to starting the calibration if this option is desired.

Click on the **Start** button to begin the automatic energy calibration. If the **Batch** option was selected, a dialog similar to the following will appear.

Select the Time Constants that you wish to calibrate and click OK to begin the calibration.


The automatic energy calibration can take several minutes to complete for each Time Constant. During the calibration, the status of the calibration is displayed and the **Start** button is replaced with a **Stop** button. If you wish to cancel the calibration, press **Stop**. Otherwise, when the button text returns to **Start**, the calibration is complete.

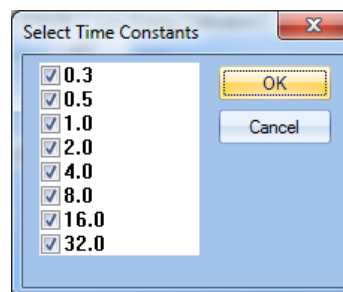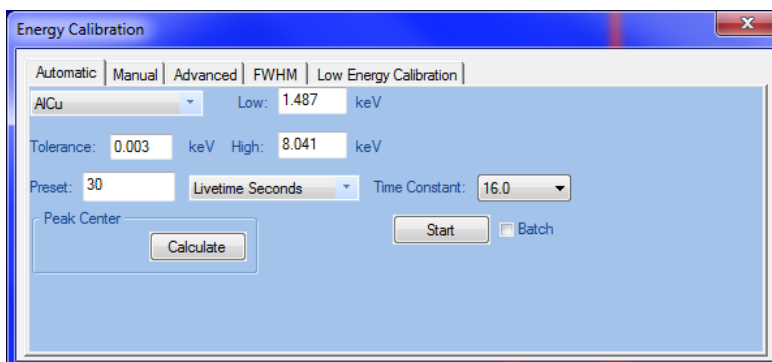

14.4 Low Energy Calibration

Low Energy Calibration can be used to calibrate the low energy portion of the spectrum. On some systems, it has been noted that the peaks for light elements (i.e., carbon and oxygen) appear shifted in the spectrum even though the higher energy peaks (i.e., aluminum and copper) are in their correct positions. To correct for this, a special

Low Energy Calibration tab is provided in the **Energy Calibration** panel, as shown to the right.

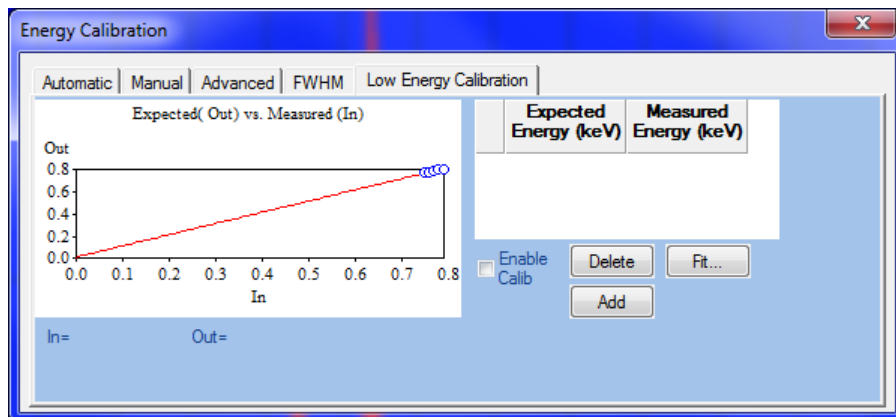

Low Energy Calibration can be enabled for each of the time constants. For digital electronics, it is practical to enable calibration for time constants 32, 16, 8, and 4 microseconds. Shorter time constants are not normally used for light element detection.

To calibrate and enable the **Low Energy Calibration** for a time constant do the following:

Select the time constant. This can be done from the **Manual** or **Automatic** tab of the **Energy Calibration** panel. Ensure that the normal energy calibration is correct. You can do this by acquiring a spectrum with two known elements in it and ensuring that the peaks are at the correct energies. For example, you may wish to use the aluminum and copper calibration material that you probably use for energy calibration.


In the **Low Energy Calibration** tab, ensure that the **Enable Calib** checkbox is not enabled, as shown here.



For the calibration, it is necessary to ensure that the **Low Energy Calibration** is not enabled.


You will now need to acquire a spectrum that has light element peaks in it. You will need two peaks for the calibration. Carbon and Fluorine are good choices. Oxygen can be used in place of Fluorine, if Fluorine is not available. You can use two spectra (the peaks don't have to come from a single sample). What you will need is the measured peak energy of the peaks. For example, if you have a spectrum containing carbon and the measured peak energy is 0.252 keV, we know that it is expected to be at 0.282 keV (weighted average $K\alpha$ peak of carbon). Likewise, if you have a spectrum (maybe the same as the first spectrum) with oxygen in it and the measured peak energy is 0.510 keV, we know that it is expected at 0.523 keV. Once you have these values of measured peak energy and expected peak energy, click on the **Add** button. The following dialog will appear:

Enter the energy that you measured the peak to be at (in our example, this is 0.252 keV), and the expected energy (in our example, 0.282). Note that these energies are given in keV, not eV. Click on **OK** to enter these as a calibration point.

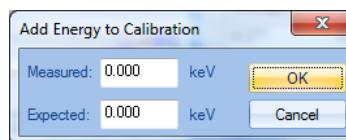

Click again on the **Add** button, this time entering the measured and expected energies of the second peak (in our example this would be the oxygen peak measured at 0.650 keV and expected at 0.677 keV). Again, click on the **OK** button to enter this as a calibration point.


Next click on the **Fit** button. The following dialog will appear:

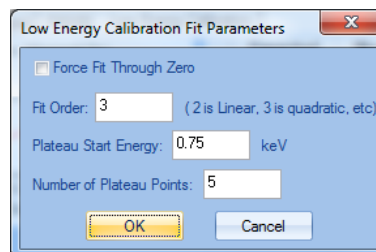

The normal settings for this dialog are shown. It is best to start with these values for the calibration. It is important to make sure that **Force Fit Through Zero** is *not* selected. To set the displayed values select the **OK** button.

You will notice that a curve is displayed on the left side of the **Low Energy Calibration** tab, as shown below.

This curve displays on the horizontal axis the energies that you entered as the measured energies and the vertical axis as the expected energies. You can click on the curve and a readout below the curve will display the energy in (measured) and the resultant energy out (expected). This can be used to verify that the calibration will work well for the peaks that you have entered.

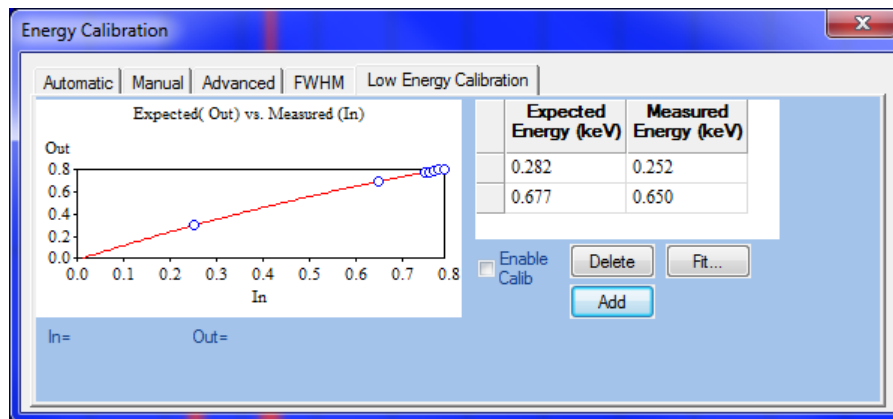

Finally, select the **Enable Calib** option.


You can now acquire a spectrum with this new calibration. The low energy peaks should now appear in the correct position in the spectrum, and the higher energy peaks should also remain in their proper calibrated locations.

This low energy calibration should be performed for each of the time constants that you expect to use. You should not have to perform this calibration each time you do a normal energy calibration. This calibration should normally be required only once.


14.5 View Input

As an aid in trouble-shooting, the input signal can be viewed. This is accessed from the **Advanced** tab of the **Energy Calibration** panel as shown.

Click on **View Input Trace**. A dialog similar to below will appear.

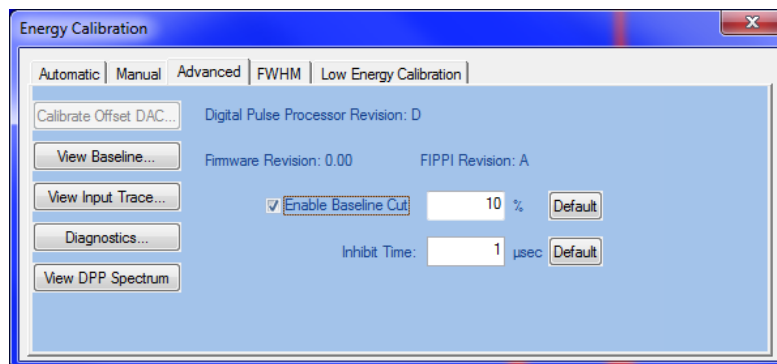

This is an example of Mn X-rays. Each vertical step is proportional to the energy of the event. The downward slope is caused by a ramp signal, which has been added to the input to keep it within the ADC input range. The **Sample Period** can be changed to view longer or shorter time periods. The **Sample Period**, entered in microseconds, is the time between each reading of the Input. In the example shown, the **Sample Period** is 1 microsecond. There are 8000 samples taken, so the total time displayed is 8000 microseconds. Note that for long Sample Periods, a significant delay will occur while the data are being collected. An hourglass cursor will appear on the screen during this time to indicate that the system is busy with the sampling of the input.

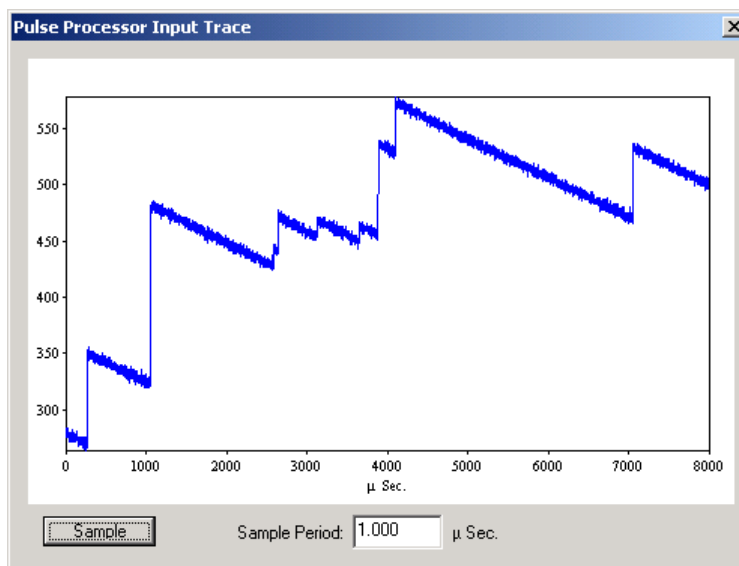

14.6 Calculating Detector FWHM


Accurate quantitation of spectra requires measurement of the FWHM (Full Width at Half-Maximum) of the detector. This measurement is used, for example, in the gaussian peak deconvolution during spectrum quantitation. FWHM can also be an indication of the “health” of the detector. Increases in the FWHM can indicate a failure of the detector.

FWHM is the measure of the width of a peak. The Mn K α peak is used by most manufacturers of detectors for specifying FWHM. This is also the peak width used by the quantitative analysis software. Peaks at higher energy will typically have larger FWHM values, and those of lower energy will have smaller values. This is accounted for in the software. Only the FWHM of the Mn K α is required.

FWHM is measured at each of the processing time constants. Larger time constants will produce smaller values for FWHM. Smaller values of FWHM are desirable for quantitation, as this makes the deconvolution process of complex overlapped peaks easier.

To measure the FWHM:


1. Select the **FWHM** tab on the **Energy Calibration** panel. A panel similar to the following will appear.
2. With a pure Mn sample, start acquiring a spectrum. Adjust the count rate such that it is approximately 1000 c/s (counts per second).
3. Set the acquire time to 100 seconds for the spectrum.
4. Ensure that the **Peak Center** on the FWHM panel is set to 5.9. This is the approximate peak center energy for the Mn K α peak. Ensure that **Iterations** is set to the number of repetitions of the measurement desired. The default is 10. It is recommended to use at least 4. The field **Threshold** may contain any value between 0 and 1 (excluding 0 and 1), the default value is 0.1. This value is used to calculate the Full Width at Threshold Max (FWThM). For example if the **Threshold** field contains 0.1 then it will calculate the Full Width at Tenth Max. Though the calculated result is not used by the software and can be ignored for all energy calibration purposes the ratio between the FWThM and the FWHM is very useful in determining detector quality and calibration.
5. Click on the **Start** button. This will begin acquiring spectra. After the acquisition of each spectrum, the FWHM, peak center, FWThM, and FWThM/FWHM will be calculated and displayed in the panel. Statistical calculations of **Minimum**, **Maximum**, **Mean**, and Standard Deviation (**STD**) will be calculated.
6. At the end of the calculation, the **Mean** value for the FWHM can be used for the FWHM of the current time constant. Click on the **Update System FWHM** button to store this value permanently. This FWHM will be used for processing of all spectra acquired with this time constant. Note that spectra acquired before this action will use the previous stored value for FWHM.
7. You may wish to print and/or copy the results of the FWHM calculation.
8. Repeat this procedure for each time constant.

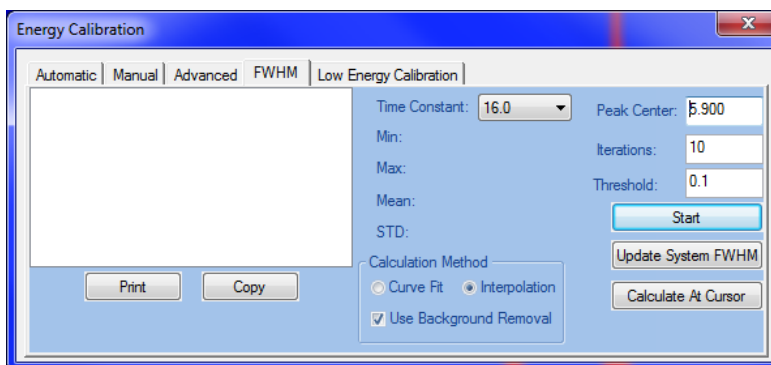

Calculate At Cursor. This calculates the FWHM at the cursor location on the spectrum. It can be used to measure the FWHM of any peak, without the need to acquire the spectrum. This can be useful for previously acquired spectra, and also for measuring FWHM of peaks other than Mn.

Calculation Method. There are two methods for calculating FWHM. **Curve Fit** uses a theoretical gaussian model fit to the spectrum. The FWHM is calculated from this theoretical fit. Because **Curve Fit** uses a theoretical model of the spectrum the FWThM is set to the FWHM. **Interpolation** finds the half-maximum data channels above and below the peak center channel. Interpolation is the technique used to find mid-channel energies (e.g., between 5.953 keV).

Selecting **Use Background Removal** will automatically calculate a background under the peak and remove it prior to calculating the FWHM. The calculated background is displayed, as shown.

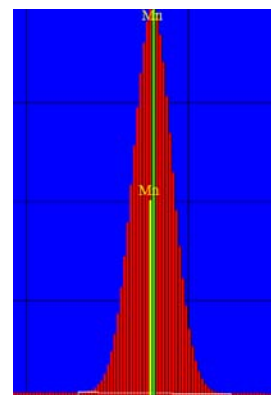

Print. Prints the FWHM calculations

Copy. Copies the FWHM calculations to the Windows clipboard.